

Instructions of CDS500 Series Servo Drive

Delixi (Hangzhou) Inverter Co., Ltd.

To Users

Dear Users,

Thank you for choosing the CDS500 series servo drive (hereinafter referred to as “the Product”) manufactured by Delixi (Hangzhou) Inverter Co., Ltd. (Delixi) Please keep an eye to the followings for better usage experience:

1. Fasten the parts, or conductor, or connecting bolts of conductor, in particular, before the Product is mounted and debugged; otherwise, fire will be triggered where parts are connected due to overheat.
2. The mounting location should be well designed and ventilated.
3. Do NOT connect the servo driver’s incoming/outgoing power wire inversely; otherwise, it will explode.
4. Do NOT start/stop the motor by switching on/off the Product’s main circuit; otherwise, the Product will undergo faults repeatedly.
5. Select the Product properly depending on the real load power (load working current). For any heavy load, select the Product with 1 or 2 grades higher; otherwise, overcurrent or overload will occur!
6. The Product should enjoy Grade IP10 protection, which means, solid objects with diameter of or over 12.5 mm are inaccessible to the Product. The Product is not waterproof.
7. Once idled for over half a year, increase the voltage slowly by using a voltage regulator when powering on the Product; otherwise, electric shock and explosion will occur!
8. AC output reactor must be added if wiring between motor and the Product is over 50 m; otherwise, both of the motor and the Product will be damaged!

As a high-performance medium and small-power AC servo drive developed by Delixi, the Product has power range of 100W~7.5kW, supports MODBUS communication protocol and provides RS-485/RS-232 communication interfaces to realize online running of multiple servo drivers with the help of upper computer. The Product can be used easily based on rigid meters, inertia Identification and parameter self-rectification functions, making it applicable to the automation equipment such as semiconductor manufacturing equipment, chip mounter, perforating machine of printed circuit board, handling machinery, food processing machinery, machine tool and transmission machinery, in order to control the position, speed and torque precisely.

Please inspect and clean the Product at shutdown state regularly to ensure long-term and safe running. For any difficulty in inspection, please call 0571-86680070 for after-sales service. Technicians will be assigned to provide assistance in solving the problems at site and ensure safe and reliable running of the Product.

Contents

Contents.....	1
Chapter 1 Safety & Notice.....	1
1.1 Acceptance.....	1
1.2 Safety Notice.....	2
1.3 Maintenance & Inspection.....	4
1.4 Inspection Items and Period.....	4
Chapter 2 Product Information.....	5
2.1 About the Product.....	5
2.1.1 Nameplate and Model.....	5
2.1.2 Composition of Servo Drive.....	6
2.1.3 Technical Data.....	7
2.1.4 Product List.....	8
2.1.5 Appearance & Mounting Dimensions.....	9
2.1.6 Specification of Brake Resistor.....	10
2.2 About the Servo Motor.....	11
2.2.1 Nameplate and Model.....	11
2.2.2 Specification of Servo Motor.....	12
2.2.3 Servo motor size specifications	13
2.3 Wiring Diagram of Servo System.....	16
2.3.1 Wiring Diagram of 1-phase 220V System.....	16
2.3.2 Wiring Diagram of 3-phase 220V/380V System.....	17
Chapter 3 Mounting & Wiring.....	18
3.1 Mounting of Servo Drive.....	18
3.1.1 Requirements for Mounting Places and Environment.....	18
3.1.2 Mounting Notice.....	18
3.2 Mounting of Servo Motor.....	19
3.2.1 Mounting Location.....	19
3.2.2 Ambient Conditions.....	19
3.2.3 Mounting Notice.....	20
3.3 Wiring.....	21
3.3.1 Mounting Notice.....	21
3.3.2 Wiring.....	21
3.3.3 Wire Specification.....	22
3.3.4 Layout of Drive Terminal Pins.....	22
3.3.5 About the Main Circuit Terminal.....	23
3.3.6 Wiring of Brake Resistor.....	24
3.3.7 Cases of Power Supply Wiring.....	24
3.3.8 Connection of Power Line between Servo Drive and Servo Motor.....	25
3.3.9 Connection of Encoder Line between Servo Drive and Servo Motor.....	26
3.4 Connection of Control Signal Terminal CN1 of Servo Drive.....	29
3.4.1 Input Signal.....	29
3.4.2 Input Signal of Analog Quantity.....	32
3.4.3 Output Signal of Analog Quantity.....	32
3.4.4 Digital Input/output Signal.....	33
3.4.5 Frequency Division Output Signals of Encoder.....	35
3.4.6 Brake Output.....	36
3.5 CN3/CN4 Wiring of RS-485 Communication.....	37

3.6 Wiring under Three Control Modes.....	38
3.6.1 Wiring Diagram of Speed Control Mode.....	38
3.6.2 Wiring Diagram of Torque Control Mode.....	39
3.6.3 Wiring Diagram of Position Control Mode.....	40
Chapter 4 Panel Display and Operation.....	41
4.1 Composition of Panel.....	41
4.2 Panel Display.....	41
4.2.1 Switching of Panel Display.....	42
4.2.2 Monitoring Layer.....	42
4.2.3 Servo Status (F9.0.32)	43
4.2.4 Parameter Display.....	43
4.2.5 Fault Display.....	45
4.3 Parameter Setting.....	45
4.4 Jog Running.....	46
4.5 Test Run of Sr.....	47
4.6 User Password.....	48
Chapter 5 Parameter Introduction.....	49
5.1 Motor Parameter F0.0.....	50
5.2 Basic Control Parameter F1.0.....	50
5.3 Position Control Parameter F1.1.....	52
5.4 Speed Control Parameter F1.2.....	53
5.5 Torque Control Parameter F1.3.....	55
5.6 Parameters of Input/output Terminal F2.0.....	56
5.7 Analog Quantity Parameter F2.1.....	59
5.8 Calibration Parameter F2.2.....	59
5.9 Internal Position Control Parameter F3.0.....	60
5.10 Internal Speed Control Parameter F3.1.....	61
5.11 Gain Parameter F4.0.....	62
5.12 Self-adaption Parameter F4.1.....	63
5.13 Fault Protection and Troubleshooting F5.0.....	64
5.14 Fault Records F5.1.....	64
5.15 Display Control Parameter F6.0.....	65
5.16 Drive Information F6.1.....	66
5.17 User Function Customization F7.0.....	66
5.18 Communication Parameter F8.0.....	67
5.19 Monitoring Parameter F9.0.....	68
Chapter 6 Introduction to RS-485 Communication.....	70
6.1 About RS-485 Communication Interface.....	70
6.2 Introduction to RS-485 Communication Parameter.....	70
6.3 Introduction to Standard MODBUS Communication Format.....	71
6.3.1 Character Structure.....	71
6.3.2 MODBUS RTU Communication Data Structure.....	72
6.4 Definition of Parameter Address of Communication Protocol.....	73
6.5 Examples.....	73
Chapter 7 Troubleshooting.....	74
7.1 Fault and Alarm Records.....	74
7.2 Diagnosis and Troubleshooting of Faults of Servo Drive.....	74
Annex 1 Recommended Combination for Servo System.....	77

Chapter 1 Safety & Notice

Please read the Instructions carefully before installation, operation, maintenance and inspection of the Product.

Please read the Chapter carefully before using the Product to keep safety of operator, equipment and property.

Notice of safe running is divided into “Warning” and “Attention” in the Instructions.



Warning

: Potential hazards. Major casualties may occur if violated.



Attention

: Potential hazards. Minor or moderate damages of operator and equipment may occur if violated. Applies to warning to unsafe operation.



1.1 Acceptance


Inspection items as shown in table below:

Inspection Items	Introduction
Whether the Product's model is consistent with that on order?	Check the model on lateral nameplate of the Product
Whether the servo motor's model is consistent with that on order?	Check the model on the nameplate of servo motor
Whether parts are damaged?	Visually inspect the appearance to see if there's damage during transport.
Whether rotation axis of servo motor is smooth?	Rotate the axis of servo motor slightly
Whether the Instructions, quality certificate and warranty card are attached?	Check the Instructions, quality certificate and warranty card of servo drive

For any violation of items above, please contact us or our agent.

1.2 Safety Notice

 Warning	Installation and maintenance should be carried out by professional technicians only.
	The Product's rated voltage must be consistent with AC power and voltage grade; otherwise, personal injury or fire may occur!
	Do NOT connect power of AC main circuit to output terminal U, V or W; otherwise, the Product will be damaged and warranty card will be invalid.
	Do NOT connect power supply unless panel is mounted. Do NOT remove the shell once powered on; otherwise, electric shock may occur!
	The Product's ground terminal must be grounded (Type D); otherwise, electric shock will occur!
	Do NOT touch the Product's high-voltage terminals once powered on; otherwise, electric shock will occur!
	Due to large-amount of electric energy stored in the Product's capacitor, do NOT maintain or operate the Product unless it is powered off for at least 10 min, charging indicator is off or voltage of positive/negative busbar is below 36V; otherwise, electric shock will occur!
	Do NOT connect or disconnect the conductor and connector if circuit is powered on; otherwise, personal injury will occur!
	Do NOT touch the revolving parts of running servo motor; otherwise, personal injury will occur!
	Do NOT touch the electronic components; otherwise, they will be damaged easily by static electricity!
 ESD Anti-static	Do NOT power on until cover plate is closed; otherwise, electric shock and explosion will occur!
	Do NOT mix the input terminal; otherwise, explosion and property loss will occur!
	Once idled for over half a year, increase the voltage slowly by using a voltage regulator when powering on the Product; otherwise, electric shock and explosion will occur!
	Do NOT handle the Product with wet hands; otherwise, electric shock will occur!
	Parts MUST be replaced professional technicians only! Do NOT leave thread residue or metal objects in the Product; otherwise, fire hazards will occur!
	Once control panel is replaced, do NOT start the Product unless parameters are set properly; otherwise, property loss will occur!

 Attention	Storage	Do NOT store or place the Product in places below; otherwise, fire hazards, electric shock or damage will occur!
		Places with direct sunlight, ultrahigh environment, ultrahigh relative humidity, high temperature difference, condensation, corrosive gas or combustible gas; places with large amount of dust, salt or metal powders, as well as places with dropping of water, oil and drugs, shocking or impact to the Product. Do NOT handle the Product by holding its cable or motor axis; otherwise, personal injury or fault will occur!
	Installation	Do NOT install the Product in places with water splashing or corrosion.
		Do NOT use the Product near flammable gas or combustibles; otherwise, electric shock or fire hazard will occur!
		Make sure the Product has specified spacing with inner surface of cabinet or other machines and install it at the correct direction; otherwise, fire hazards or faults will occur!
		Do NOT apply ultrahigh impacts; otherwise, faults will occur!
	Wiring	Do NOT connect the Product's output terminal U, V and W to 3-phase power supply; otherwise, personal injury or fire hazard will occur!
		Power terminal MUST be connected to motor terminal firmly; otherwise, fire hazards will occur easily!
		Do NOT cross the power wire and signal wire in the same pipe nor bound them together! Instead, keep power wire and signal wire separated for at least 30 cm during wiring!
		Double stranded shielded cable, of which both ends should be grounded, should be used as signal wire and encoder cable.
	Running	Make sure to carry out no-load commissioning (not connected to transmission shaft) of servo motor; otherwise, personal injury will occur!
		Make sure to set rotational inertia ratio correctly if online auto tuning is disabled; otherwise, vibration will occur!
		For any alarm, do NOT reset nor restart until fault is removed and safety is guaranteed; otherwise, personal injury will occur!
		Do NOT apply general braking by using the brake motor's brake function; otherwise, faults will occur!

1.3 Maintenance & Inspection

1. The Product should be powered on/off by trained operators only.
2. Do NOT start insulation resistance test until the Product is fully disconnected from all external equipment; otherwise, faults will occur!
3. Do NOT clean the Product using gasoline, diluent, alcohol, acid or alkali detergent; otherwise, shell will be discolored or damaged!
4. Once the Product is replaced, do NOT restart it until the parameters of replaced product is fully transferred to the new one; otherwise, damage will occur!
5. Do NOT change wiring at powered-on status; otherwise, electric shock or personal injury will occur!
6. Do NOT dismantle the servo motor without permission; otherwise, electric shock or personal injury will occur!

1.4 Inspection Items and Period


The ambient environment for the servo system: Annual mean ambient temperature: 30℃; Mean load rate: Below 80 %; daily running period: Below 20 h. Carry out daily and regular inspection according to the following key points:

Type	Inspection Period	Inspection Items
Daily Inspection	Daily	Whether there's odor
		Whether power voltage is normal
		Whether there's abnormal vibration and noise
		Whether air inlet has thread residue of fiber
		Check the ambient temperature, moisture, dust and foreign matters
		Whether front end and connector of drive are clean
		Whether load end has foreign matters
Regular Inspection	Annual	Whether fastened part is loose
		Whether it is overheated
		Whether terminal board is damaged
		Whether fastened part of terminal board is loose

Chapter 2 Product Information

2.1 About the Product

2.1.1 Nameplate and Model

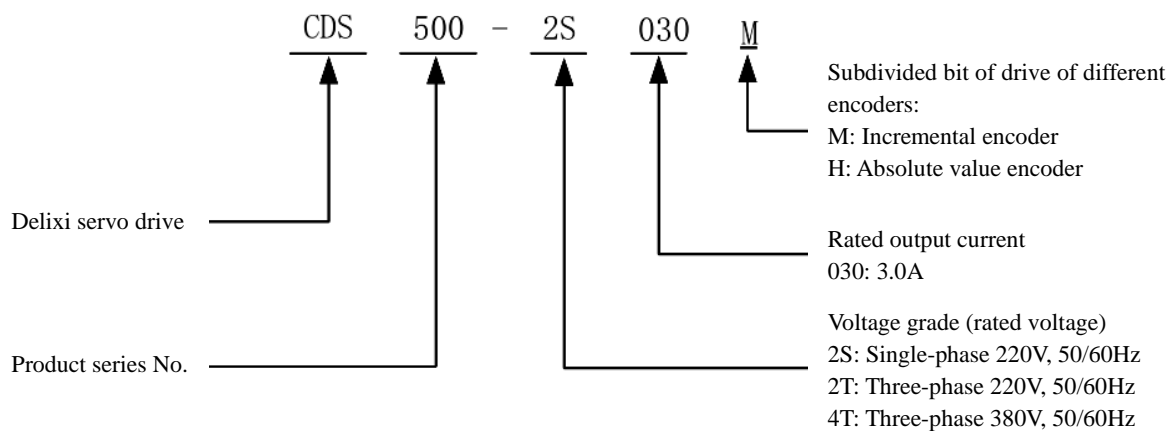

DELIXI

Model: CDS500-2S030M

Input: AC 1PH 220V ± 15% 50/60Hz

Output: AC 3PH 0-220V 0-400Hz 3.0A


Hardware Ver.: 1.1.00 Software Ver.: 1.12



CDS500-2S03019G000003

德力西(杭州)变频器有限公司
DELIXI HANGZHOU INVERTER CO., LTD.

2.1.2 Composition of Servo Drive

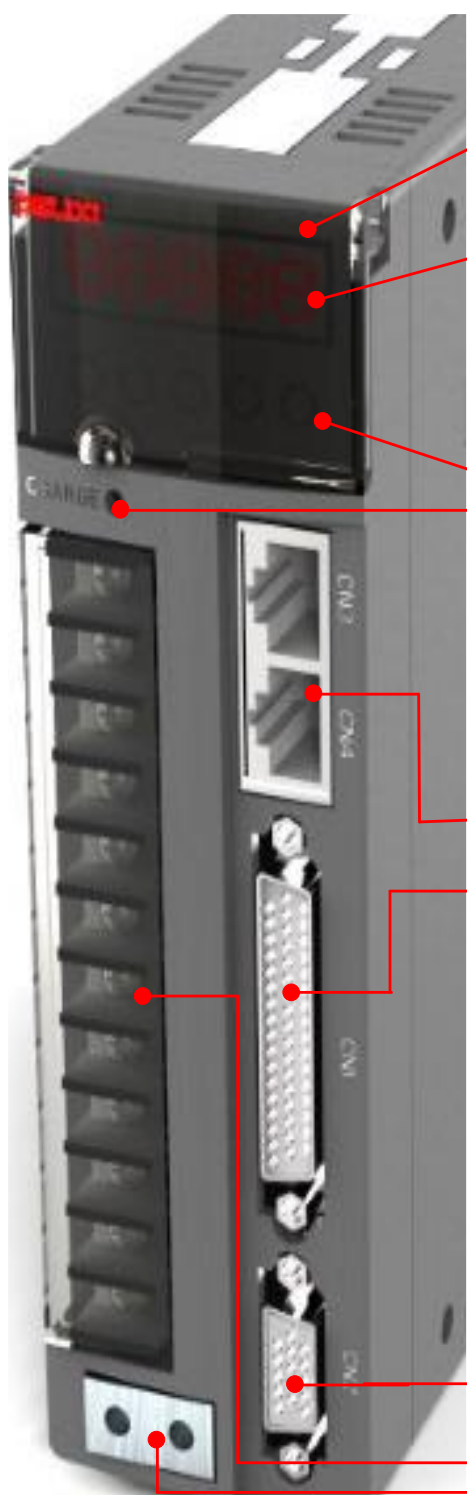

Name	Introduction
Interface CN5	Oscilloscope and backstage software interface
LED	5-bit LED to display the Product's running status and parameter setting
Keys	
CHARGE power indicator	The Product is powered on if this indicator is on. However, it is not the only factor for determining whether the Product is powered on or off. Make sure the upper circuit is disconnected and capacitor is fully discharged before touching the Product's live parts.
Communication interface CN3/CN4	With parallel connection internally, Interface CN3/CN4 applies to connection of communication device RS-485
Drive control interface CN1	44-pin female terminal interface for controlling drive input/output signals
Interface of encoder CN2	15-pin female terminal interface for connecting the motor encoder
Input terminal of control power supply L1C/L2C	Input terminal of control power supply L1C/L2C Connect power supply of control circuit correctly by referring to parameters on the Product's nameplate
Power input terminal of main circuit R, S, T (or L1, L2)	Power input terminal of main circuit R, S, T (or L1, L2) Connect power supply of main circuit correctly by referring to parameters on the Product's nameplate
P_{Φ} , \ominus DC busbar terminal	DC busbar terminal applies to common DC busbar of multiple drives
Connect P_{Φ} , D, C to brake resistance terminal	Connect short contact tag between P_{Φ} and D as default. Remove the short contact tag between P_{Φ} and D and connect brake resistor to P_{Φ} and C before external connection of brake resistor.
Motor connection terminal U, V, W	Connected to Phase U, V, W of servo motor
Ground terminal of drive PE	Connected to grounding terminal and power grounding terminal of servo motor for purpose of grounding

Composition of Servo Drive

2.1.3 Technical Data

Item		Specification	
Basic Parameters	Rated current	2S series	1.6~10.0A
		2T series	1.6~20A
		4T series	8.5~20A
	Power supply of main circuit	2S series	1-phase AC220V ±10%, 50/60Hz
		2T series	Three-phase AC220V ±10%, 50/60Hz
		4T series	3-phase AC380V ±10%, 50/60Hz
	Power supply of control circuit	2S series	1-phase AC220V ±10%, 50/60Hz
		2T series	
		4T series	1-phase AC380V ±10%, 50/60Hz
Control Mode		Position control, speed control and torque control	
Encoder Feedback		Incremental encoder; absolute value encoder	
Regenerative Brake		Internal/external	
Configuration	P24V power supply	P24V-COM; max. output: 200 mA	
	P5V power supply	P5V-GND; max. output: 200 mA	
	Pulse input	P_HI, PULSE+, PULSE-, S_HI, SGN+, SGN-; both of differential input and open collector input are supported	
	Digital input	8-way digital input terminal (DI1~DI8). Both of internal/external power supply are supported	
	Digital output	4-way digital output terminal (DO1~DO4); max. output: 20 mA	
	Analog input	1-way analog input (AIN), DC ±10V, 12-bit conversion accuracy	
	Analog output	1-way analog output (AO1+, AO1-), DC ±10V; min. output: 1mA	
	Frequency dividing output	Differential output (≤500kHz); collector output (≤200kHz)	
Control Characteristic	Velocity – bandwidth response	Over 500Hz	
	Speed fluctuation ratio:	<±1.5% (Load 0~100%); <±0.6% (Power -15~+10%) (Value corresponds to the rated speed)	
	Speed ratio	1:30000	
	Input pulse frequency	≤500kHz	
Position Control	Input mode	① Pulse + signal ② CW pulse + CCW pulse ③ Orthogonal Phase AB pulse	
	Electronic gear ratio	1~32767/1~32767	


Item	Specification
Feedback Mode	Feedback by motor shaft encoder
Parameter Setting Mode	① Be set and inputted via keyboard ② RS485 MODBUS communication input
Load Inertia	Lower than 10 times of motor inertia
Brake Mode	Resistance energy braking

2.1.4 Product List

Drive Model	Rated Output Current	Max. Output Current	Brake Resistance	Voltage Grade	
				Main Circuit	Control Circuit
2S (1-phase 220V ±10%, 50/60Hz)					
CDS500-2S016	1.6A	4.8	Standard configuration, built-in	1-phase 220V	1-phase 220V
CDS500-2S030	3.0A	9	Standard configuration, built-in	1-phase 220V	1-phase 220V
CDS500-2S045	4.5A	13.5	Standard configuration, built-in	1-phase 220V	1-phase 220V
CDS500-2S060	6.0A	18	Standard configuration, built-in	1-phase 220V	1-phase 220V
CDS500-2S100	10A	30	Standard configuration, built-in	1-phase 220V	1-phase 220V
2T (3-phase 220V ±10%, 50/60Hz)					
CDS500-2T016	1.6A	4.8	Standard configuration, built-in	3-phase 220V	1-phase 220V
CDS500-2T030	3.0A	9	Standard configuration, built-in	3-phase 220V	1-phase 220V
CDS500-2T045	4.5A	13.5	Standard configuration, built-in	3-phase 220V	1-phase 220V
CDS500-2T060	6.0A	18	Standard configuration, built-in	3-phase 220V	1-phase 220V
CDS500-2T100	10A	30	Standard configuration, built-in	3-phase 220V	1-phase 220V
CDS500-2T140	14A	42	Standard configuration, built-in	3-phase 220V	1-phase 220V
CDS500-2T200	20A	60	Standard configuration, built-in	3-phase 220V	1-phase 220V
4T (3-phase 380V ±10%, 50/60Hz)					
CDS500-4T085	8.5A	25.5	Standard configuration, built-in	3-phase 380V	1-phase 380V
CDS500-4T120	12A	36	Standard configuration, built-in	3-phase 380V	1-phase 380V
CDS500-4T200	20A	60	Standard configuration, built-in	3-phase 380V	1-phase 380V

2.1.5 Appearance & Mounting Dimensions


SIZE-A

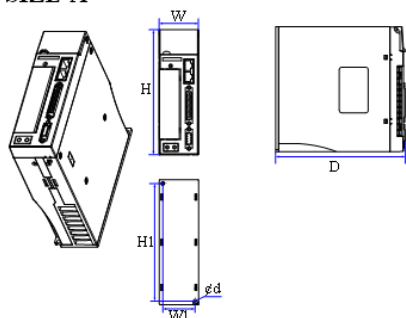

Drive model	W	W1	H	H1	D	∅ d
CDS500-2S016	55	45	166	156	179	5
CDS500-2S030						
CDS500-2S045						
CDS500-2S060						
CDS500-2T016						
CDS500-2T030						
CDS500-2T045						
CDS500-2T060						

Unit: mm


SIZE-B

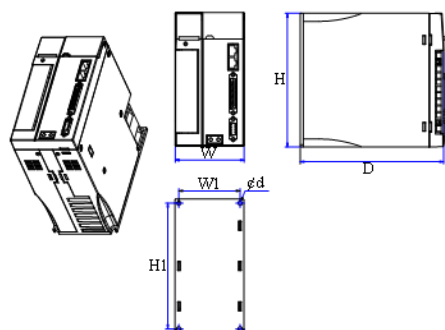

Drive model	W	W1	H	H1	D	∅ d
CDS500-2T100	90	80	166	156	187.1	5.5
CDS500-2T140						
CDS500-4T085						
CDS500-2S100						
CDS500-4T120						

Unit: mm

SIZE-C

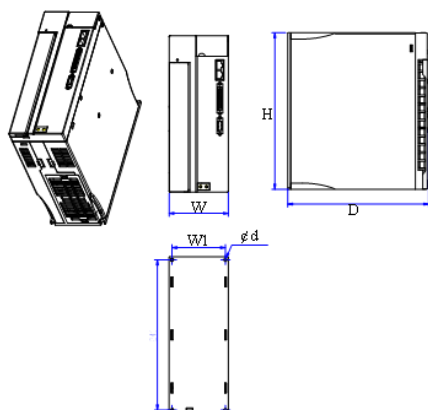

Drive model	W	W1	H	H1	D	∅ d
CDS500-2T200	100	90	251	241	237.7	5.5
CDS500-4T200						

Unit: mm



2.1.6 Specification of Brake Resistor

Model of Servo Drive		Specification of Built-in Brake Resistor		Min. Allowable Resistance (Ω)	Max. Brake Energy (J) Absorbed by Capacitor
		Resistance	Power		
1-phase 220V	CDS500-2S016	50	50	50	9
	CDS500-2S030	50	50	50	18
	CDS500-2S045	50	50	50	24
	CDS500-2S060	50	50	50	32
	CDS500-2S100	25	100	18	50
3-phase 220V	CDS500-2T016	50	50	50	9
	CDS500-2T030	50	50	50	9
	CDS500-2T045	50	50	50	14
	CDS500-2T060	50	50	50	18
	CDS500-2T100	25	100	10	43
	CDS500-2T140	25	100	10	52
	CDS500-2T200	12.5	200	5	85
3-phase 380V	CDS500-4T085	25	100	18	50
	CDS500-4T120	12.5	200	12	50
	CDS500-4T200	12.5	200	10	120

The built-in brake resistor applies to small-inertia and non-frequent braking only. For any high braking torque or repeated braking, the user needs to install the large-power brake resistor and select the brake resistance carefully by referring to the table above. For any query, please call our technicians for solutions.

2.2 About the Servo Motor

2.2.1 Nameplate and Model

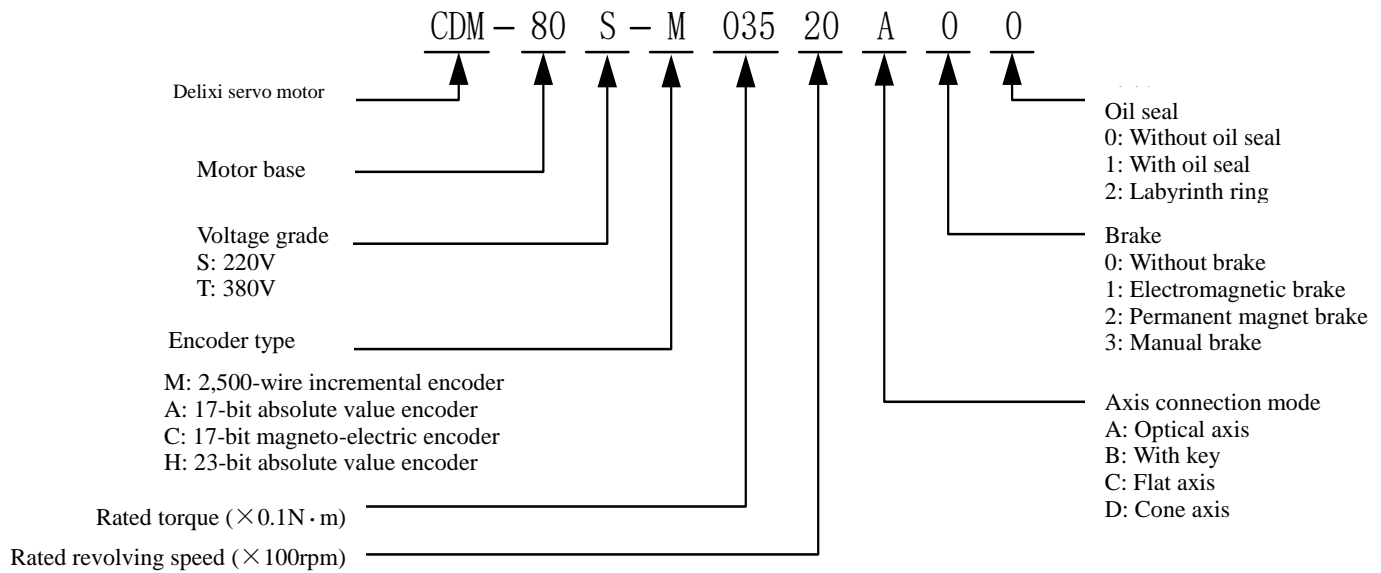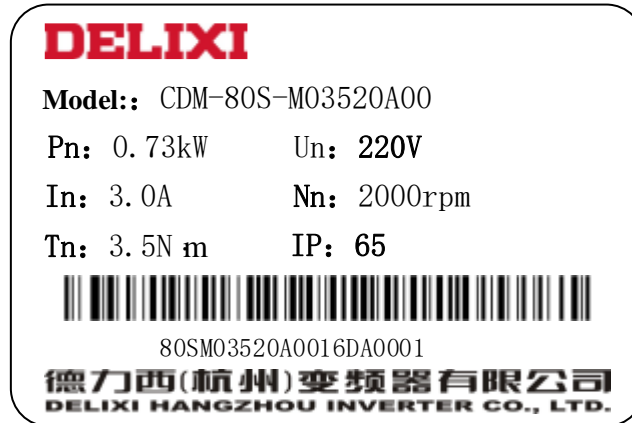

Note: Fill the model of servo motor completely for procurement.

2.2.2 Specification of Servo Motor

1) Mechanical characteristics and parameters of servo motor


Item	Description
Rated Period	Continuous
Vibration Grade	V15
Insulation Grade	Over DC500V, 10MΩ
Ambient Temperature	-20°C~40°C
Excitation Mode	Permanent magnet type
Mounting Type	Flange type
Classification of Electrical Insulation	Class F
Insulation Voltage	AC1500V1 min (Class 200V) AC1800V1 min (Class 400V)
Shell Protection Mode	IP65 (except for axis cut-through part)
Ambient Humidity	<90% (no condensation)
Connection Mode	Direct connection
Revolving Direction	Upon release of forward revolving command, be revolving anticlockwise (CCW) when observed from load side

2) Brake motor

1. Do NOT share the power supply of brake with other electric appliances; otherwise, brake misoperation will occur due to voltage or current reduction due to the operation of other electric appliances.
2. Cables with diameter over 0.5mm² are recommended.


2. 2. 3 Servo motor size specifications

Model 40

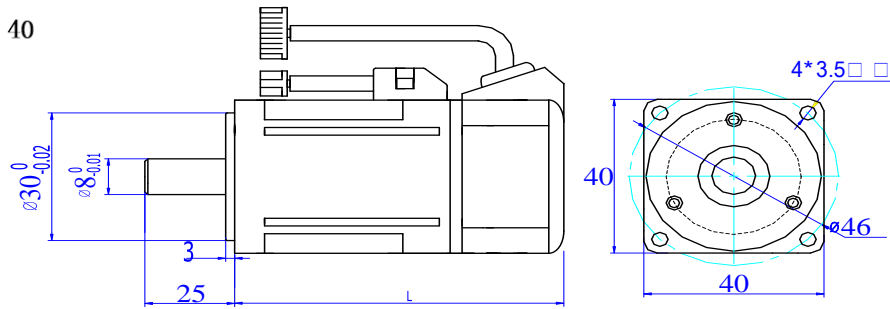


specifications	0.16N.m	0.32N.m
L without brake	75	90
L with permanent magnet brake	109	124

Model 60



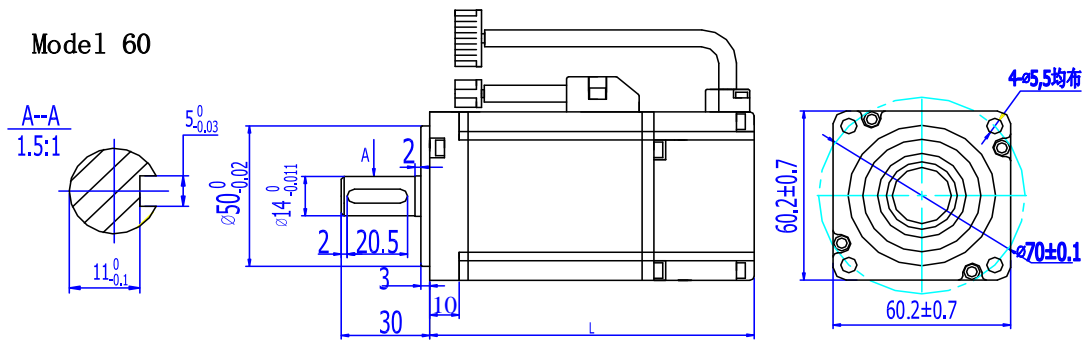



specifications	0.6N.m	1.3N.m	1.9N.m
L without brake	116	141	169
L with permanent magnet brake	164	189	217

Model 80

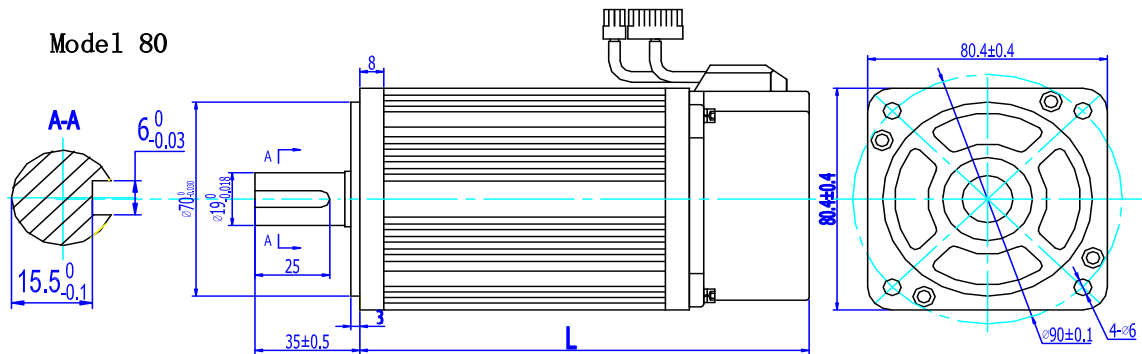


specifications	1.3N.m	2.4N.m	3.5N.m	4N.m
L without brake	124	151	179	191
L with permanent magnet brake	178	205	233	245
L with electromagnetic brake	164	191	219	231

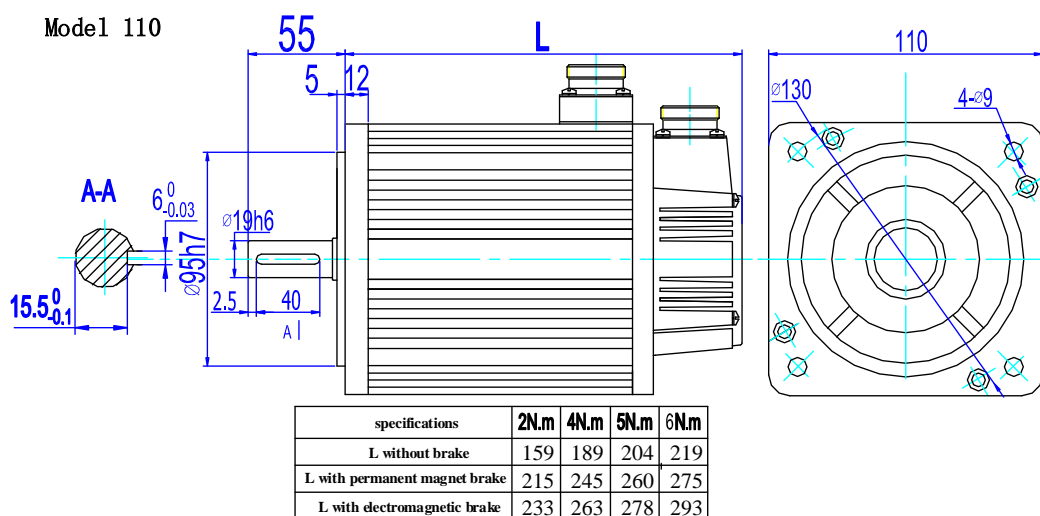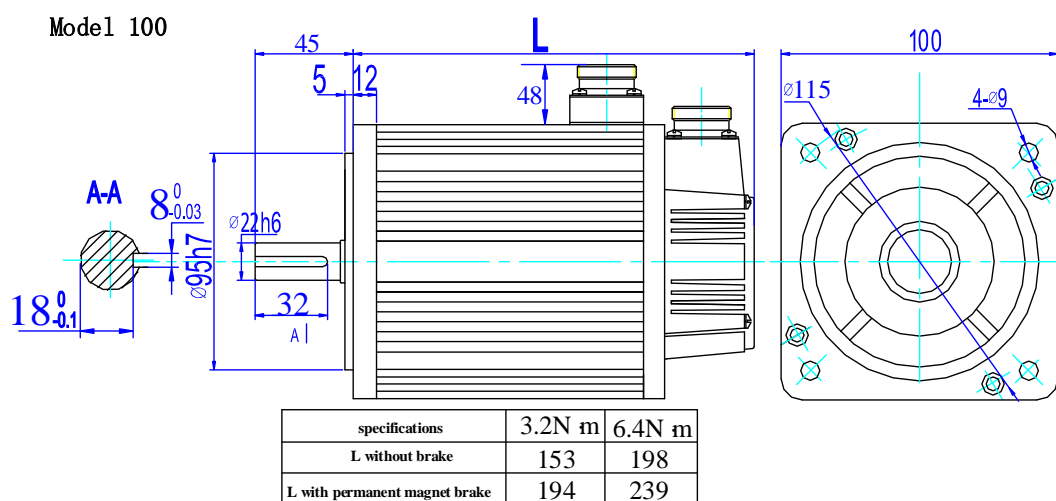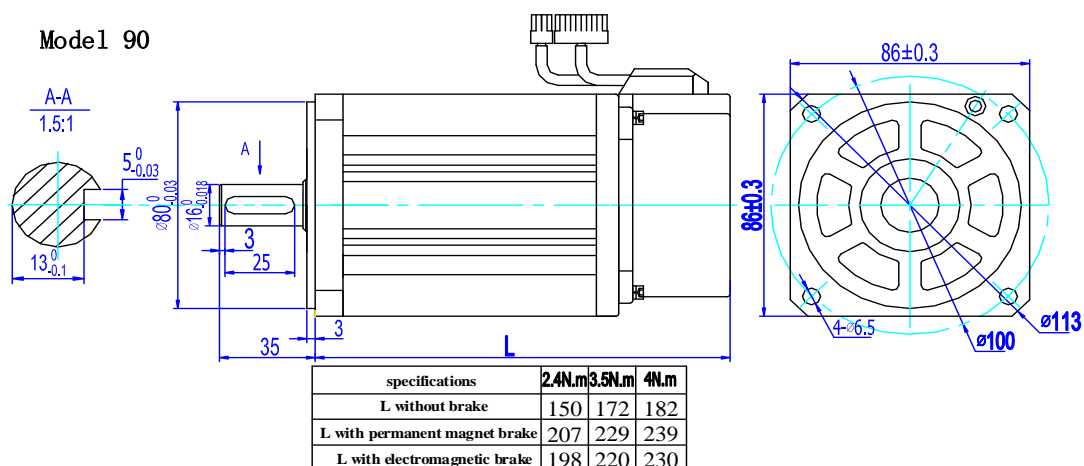


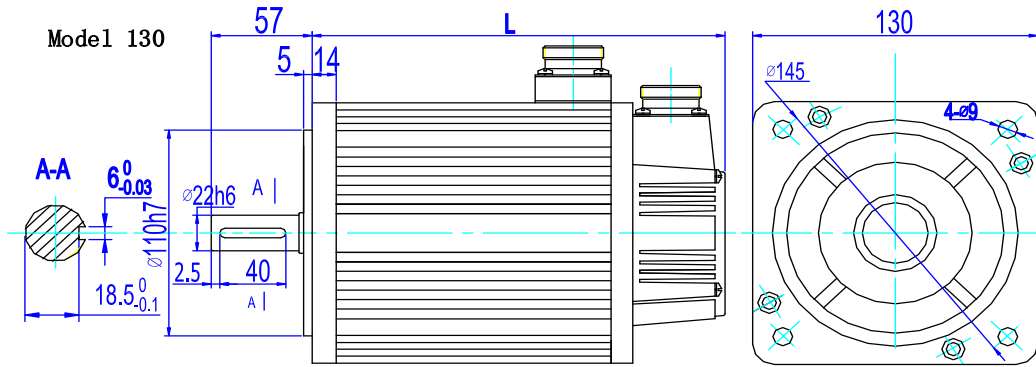

specifications	4N.m	5N.m	6N.m	7.7N.m	10N.m		15N.m	
					1000r	1500r	2500r	1500r
L without brake	166	171	179	192	213	209	241	231
L with permanent magnet brake	236	241	249	262	283	279	311	301
L with electromagnetic brake	223	228	236	249	294	290	322	312

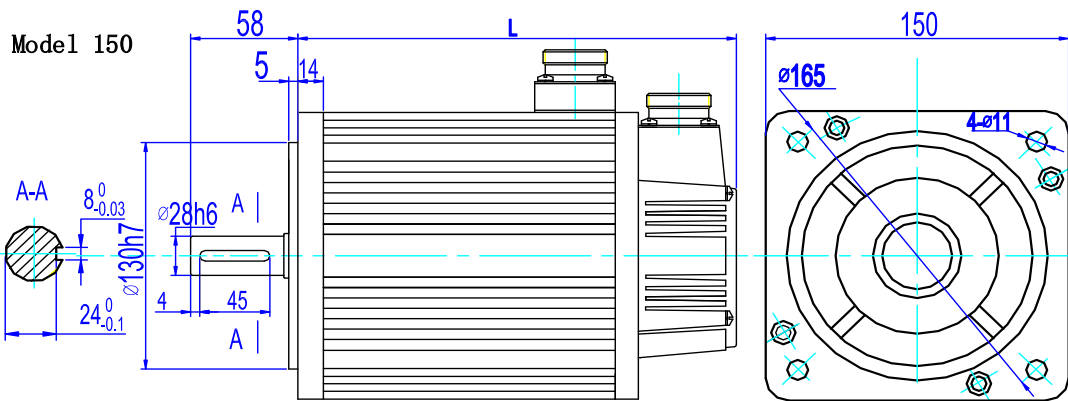


specifications	15N.m		18N.m	23N.m	27N.m
	2000r	2500r			
L without brake	230	230	248	278	302
L with electromagnetic brake	303	303	321	351	375

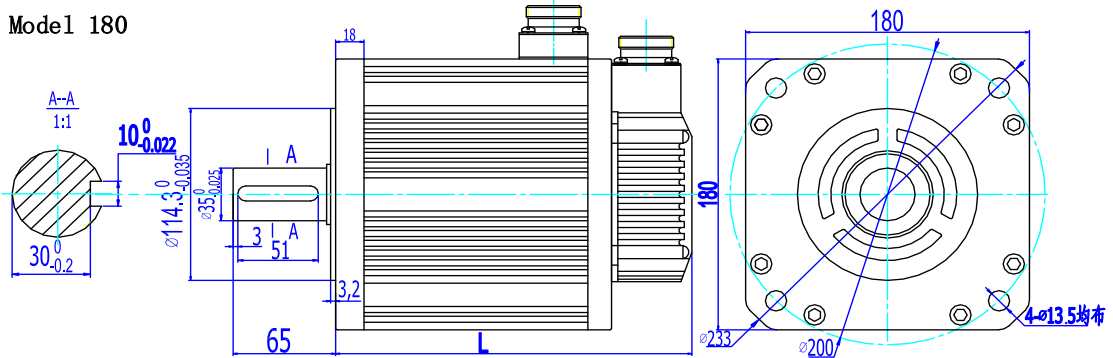


specifications	17.2N.m	19N.m	21.5N.m	27N.m	35N.m	48N.m
L without brake	226	232	243	262	292	346
L with permanent magnet brake	308	314	325	344	382	436
L with electromagnetic brake	298	304	315	334	364	418

2.3 Wiring Diagram of Servo System

2.3.1 Wiring Diagram of 1-phase 220V System

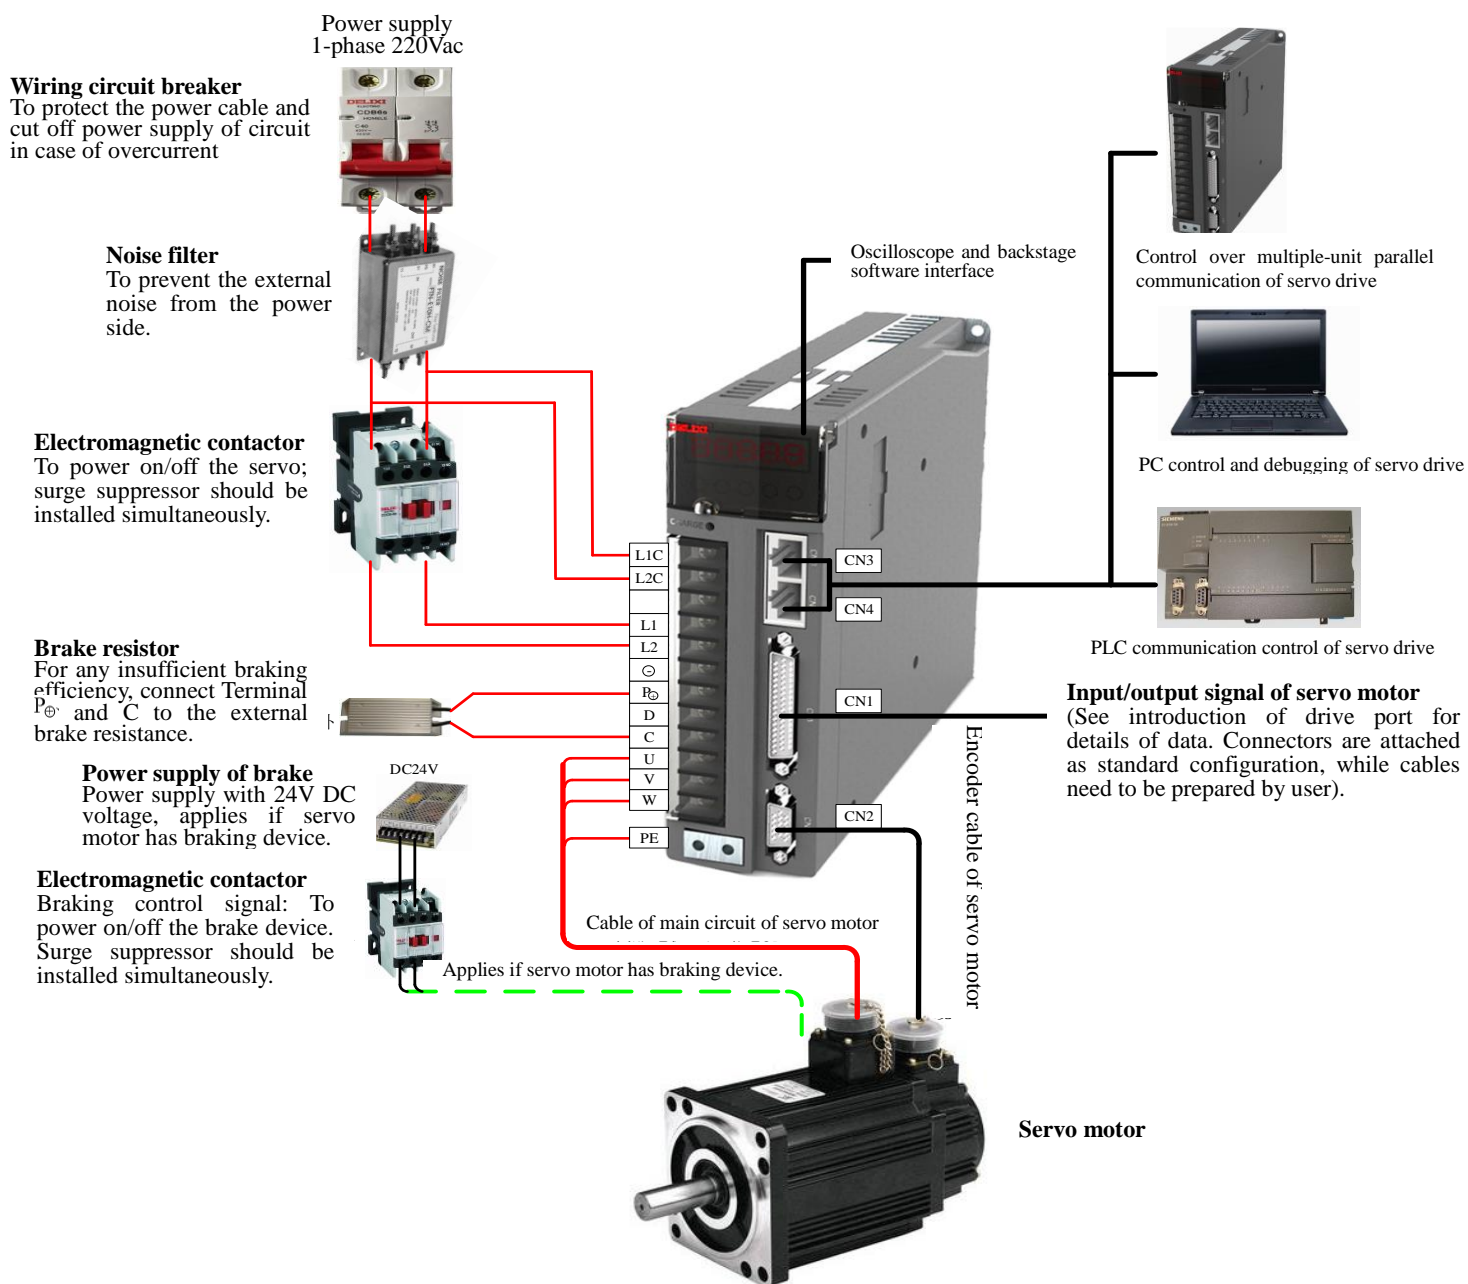

2.3.2 Wiring Diagram of 3-phase 220V/380V System

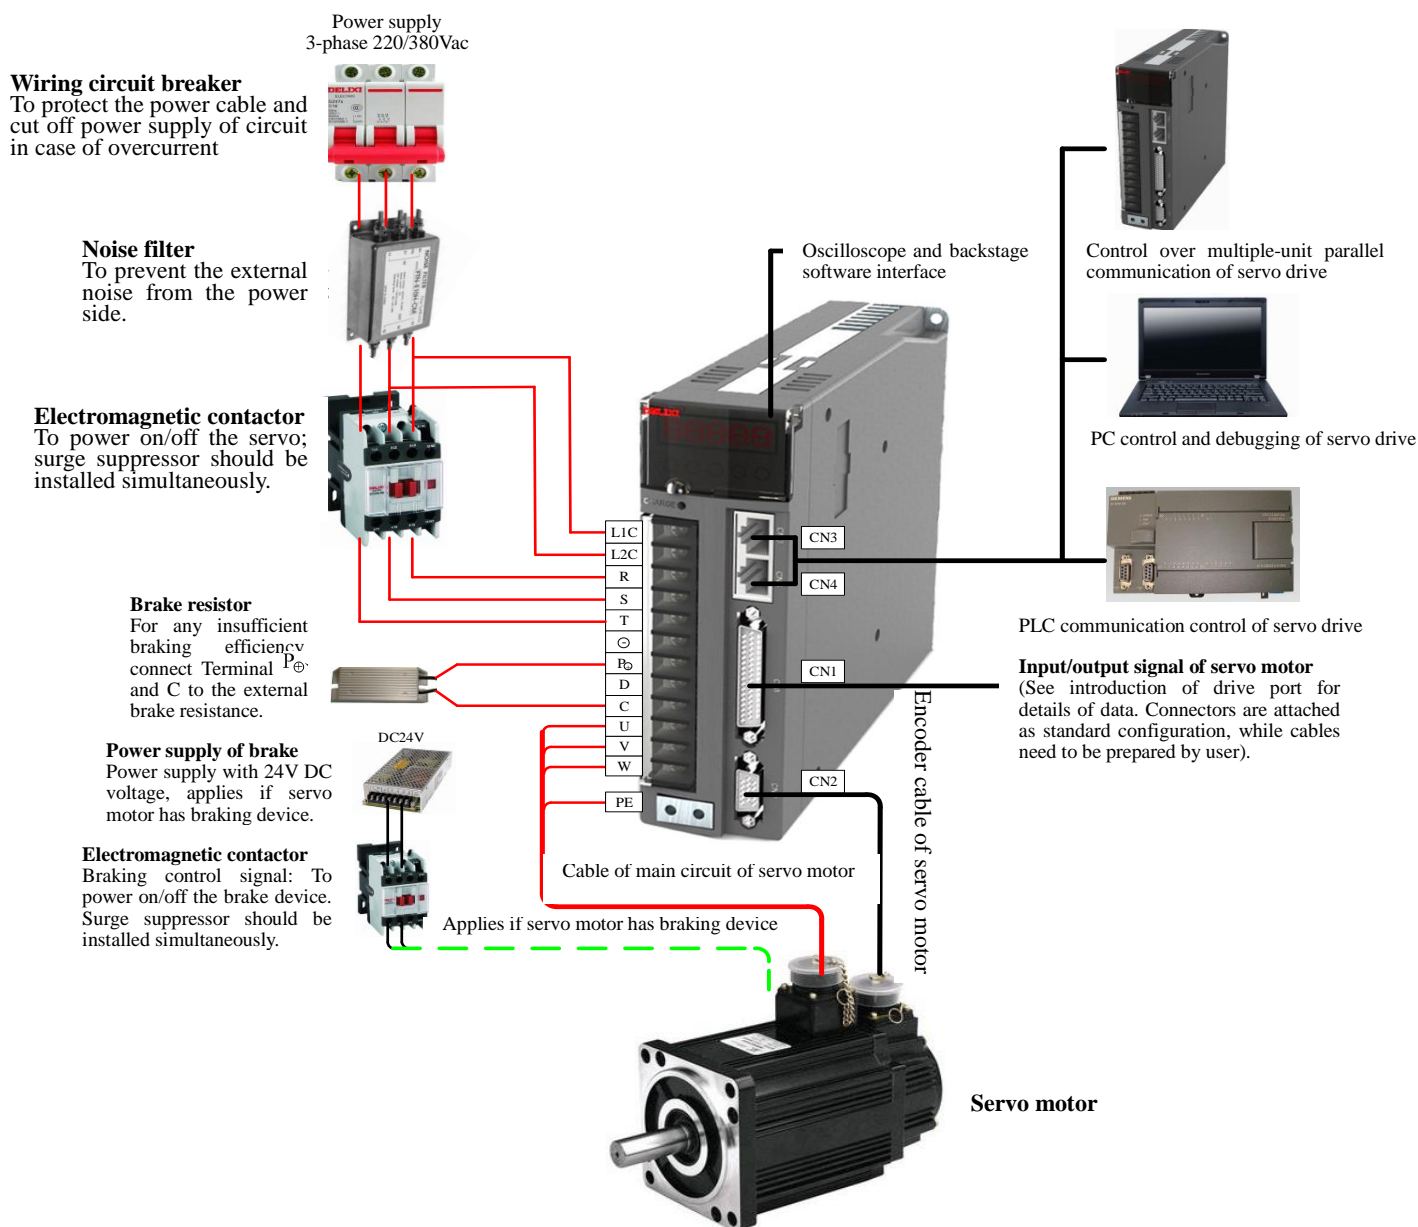

As the Product is directly connected to the industrial power supply without power isolation by those including transformer, please install fuse or wiring circuit breaker on the input power for avoiding cross electric shock accidents of servo system, and please install overload and short-circuit protection RCCB or specific ground wire protection RCCB to ensure higher safety of system, for the Product has no built-in grounding protection circuit.

Do NOT start/stop the motor by using an electromagnetic contactor, for the motor is a high-inductance element and the instantaneous high voltage will breakdown the contactor.

Keep an eye on the capacity of power supply when using external power supply or 24VDC power supply, especially power is supplied to multiple drives or multi-way brake, for insufficient capacity of power supply will lead to insufficient power supply current and final failure of the Product or brake. If 24V DC voltage power supply is adopted for braking, the power should be selected considering the motor model and conforming to the power requirements of brake.

Note: 1. Do not connect the external brake resistor until the short contact tag between the Product's P \oplus and Terminal D is firstly removed. 2. As the consistent communication interface of pin, CN3 and CN4 can be selected freely.

Chapter 3 Mounting & Wiring

3.1 Mounting of Servo Drive

3.1.1 Requirements for Mounting Places and Environment

Item	Description	
Mounting location	Be mounted in cabinets free from direct sunlight or rainfall	
	Do NOT use the Product in places with corrosive substances, such as hydrogen sulfide, chlorine, ammonia, sulfur, chlorinated gas, acid, alkali and salt, as well as flammable gas and combustibles;	
	Do NOT install the Product in places with high temperature, high moisture, dust or metal dust	
	Places without vibration;	
	Pollution grade of mounting location: PD2	
Environment requirements	Ambient temperature	0 ~ +45°C
	Ambient humidity	Below 90%RH (no condensation)
	Vibration	Below 4.9m/s ²
	Impact	Below 19.6m/s ²
	Protection grade	IP10
	Altitude	Below 1,000 m

3.1.2 Mounting Notice

1) Method

Keep installation direction vertical to the wall, cool the Product by using free convection or fan, firmly fix the Product onto the mounting surface through 2~4 mounting holes (number of which varies depending on the capacity).

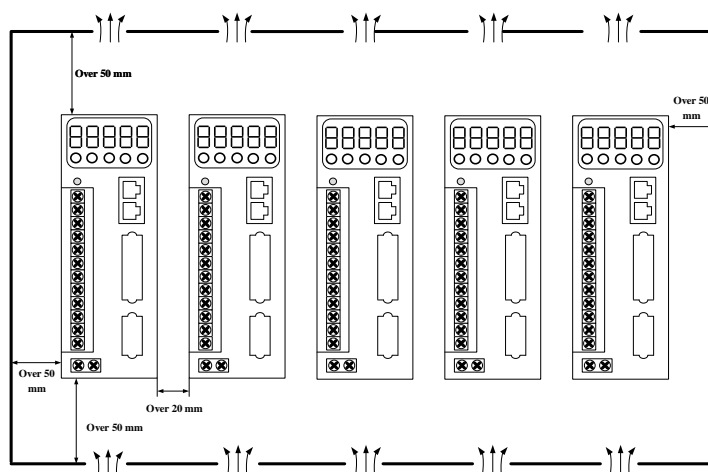


Fig. 3-1 Schematic Diagram for Mounting of Servo Drive

Keep the Product's front side (actual mounting side of operator) towards the operator and vertical to the wall during mounting.

2) Cooling

Leave sufficient space around the Product by referring to the diagram above, in order to fully cool it through fans and free convection. Install a cooling fan above the Product to avoid local overheat and guarantee even temperature in the cabinet.

3) Side-by-side mounting

Once mounted side by side, spacing over 10 mm and 50 mm is recommended at both sides at horizontal direction (spacing at horizontal direction can be avoided due to restriction of mounting space) and longitudinal direction respectively.

4) Grounding

Grounding terminal must be grounded; otherwise, electric shock or misoperation due to disturbance will occur.

3.2 Mounting of Servo Motor

3.2.1 Mounting Location

1. Do NOT use the Product in places with corrosive substances, such as hydrogen sulfide, chlorine, ammonia, sulfur, chlorinated gas, acid, alkali and salt, as well as flammable gas and combustibles;
2. The Product should be equipped with oil seal before mounted in places with grinding fluid, oil mist, iron powder and cutting fluid.
3. Be away from places with heat sources such as furnace.
4. Do NOT use the motor in confined space; otherwise, motor's service life will be shortened due to overheat.

3.2.2 Ambient Conditions



Item	Description
Ambient Temperature	-20°C~40°C (no freezing)
Ambient Humidity	20%~90%RH (no condensation)
Storage Temperature	-20°C~60°C (max. storage temperature: 80°C for 72 h)
Storage Humidity	20%~90%RH (no condensation)
Vibration	Below 49m/s ²
Impact	Below 490m/s ²
Protection Grade	IP65 (axis cut-through part, except for the position where motor connector connects the terminal)
Altitude	Below 1,000 m; degraded if used over 1,000 m

3.2.3 Mounting Notice

Item	Description
Derusting	Firstly remove the "antirust agent" at axis stretch end of servo motor and carry out derusting treatment before installation.
Encoder	<ul style="list-style-type: none"> ◆ Do NOT collide the axis stretch end during installation; otherwise, the internal encoder will crack. ◆ Install the pulley on the servo motor shaft with keyslot by using screw holes at the axis end. Firstly insert the double-headed nails into the screw holes, put gasket onto the surface of coupling end and gradually lock-in the nuts into the pulley. ◆ Servo motor shaft with keyslot should be mounted screw holes at shaft end; while shaft without keyslot should be mounted via friction coupling or similar methods.
Centering	Keep the axis of servo motor at the same straight line of mechanical axis. The servo motor should conform to the centering precision requirements in the left diagram during installation. Insufficient centering may lead to vibration and even damage of bearing and encoder.
Installation Direction	◆ The servo motor should be mounted at the horizontal or vertical direction.
Countermeasures to Oil and Water	<p>The servo motor should be used based on the protection grade in the places with water drops; or the servo motor with oil seal should be used if oil will be dropped onto the axis cut-through part, i.e. the clearance of stretching-out part of axis from motor end surface.</p> <p>Work conditions for servo motors with oil seals on transmission shaft:</p> <ul style="list-style-type: none"> ◆ Make sure oil level is lower than the mouth of oil seal during use. ◆ Make sure oil seal can be well used when splashed with oil. ◆ Avoid oil accumulation at the mouth of oil seal when installing the servo motor upwards and vertically.
Cable Stress	◆ Do NOT "bend" the wire or apply "tension" to it, especially the 0.2 mm or 0.3 mm core wire of signal cable. Do NOT apply too tight tension to the wiring (during operation).
Handling of Connector	<p>Notice of connector:</p> <ul style="list-style-type: none"> ◆ Make sure the connector has no foreign matters such as waste or metal sheets before connection. ◆ Connect the connector to the servo motor from the main circuit cable side of servo motor firstly and make sure grounding wire of main cable is connected reliably; Otherwise, the encoder will become faulty due to the potential difference between PE if the cable at encoder side is connected firstly. ◆ Make sure pins are arranged correctly during wiring. ◆ Do not apply impacts on the connector that is made of resin; Otherwise, it will be damaged. ◆ Make sure to hold the body of servo motor when handling the connected cables; Otherwise, the connector or cable will be damaged. ◆ Do NOT apply stress to the connector during wiring if bent cable is used; Otherwise, the connector will be damaged.

3.3 Wiring

3.3.1 Mounting Notice

 <p>Danger</p>	<ul style="list-style-type: none"> ★ Wiring MUST be carried out by professional technicians and well protected. ★ Do NOT dismantle the Product unless the Product is powered off for over 5 min and the voltage between P\oplus and \ominus is measured when power indicator is off; Otherwise, electric shock will occur! ★ Do NOT start wiring unless the Product and servo motor are mounted; Otherwise, electric shock will occur! ★ Make sure to protect the cable. Do NOT apply excessive pulling force, suspend heavy objects or squeeze the cable; otherwise, electric shock will occur!
 <p>Attention</p>	<ul style="list-style-type: none"> ★ Make sure to protect the connection position of power terminal; Otherwise, electric shock or short circuit will occur! ★ Specification and mounting mode of external wiring should conform to the requirements of local laws and regulations. ★ Make sure to use the cables as specified. Yellow and green cable should be used as grounding wire. ★ Make sure to carry out safety protection measures during installation, debugging and inspection; for example, hang inspection mark and arrange specific person for monitoring.

3.3.2 Wiring


1. Wiring materials should conform to the cable specification (next section)
 2. Do NOT connect input power wire to output terminal U, V or W; otherwise, the Product will be damaged!
 3. Output terminal U, V and W of motor MUST correspond to the Product's terminals; otherwise, rotation failure or speed loss will occur!
 4. It MUST be grounded reliably through single point.
 5. Make sure to use the ground wire with the same section area of main circuit wire. Please use 2.0mm² ground wire if section area of main circuit wire is below 1.6 mm².
 6. The absorption diode of relay at output signal section MUST be connected at the correct direction; otherwise, fault signals may fail to be outputted!
 7. Please install devices such as insulating transformer and noise filter on the power supply to avoid misoperation due to noise.
- Please install non-fuse circuit breaker to timely cut off the external power supply in case the Product becomes faulty.
8. Make sure the bending radius of cable is over 10 times of outer diameter of cable; otherwise, the internal cores of cable will crack due to long-term bending.
 9. Please use the cables resistant to voltage over AC600v and rated temperature over 75°C; the allowable current density of cable conductor should not exceed 8A/mm² at 30°C, normal cooling conditions and total current below 50A, or not exceed 5A/mm² when total current is over 50A.
 10. Do NOT cross the power wire and signal wire in the same pipe nor bound them together! Instead, keep power wire and signal wire separated for at least 30 cm during wiring to avoid disturbance!
 11. Do NOT touch the power terminal within 5 min after the Product is powered off, for it may have residual high voltage internally.

12. Do NOT power on when screws or cables of terminal block are loose; otherwise, fire hazard will occur!

3.3.3 Wire Specification

Terminal Block	Symbol	Wire Specification
Main circuit power supply	R, S, T or L1, L2	0.75~10mm ²
Control power supply	L1C, L2C	0.75~1.0mm ²
Motor connection terminal	U, V, W	0.75~1.0mm ²
Ground terminal	⊕	0.75~4mm ²
Control terminal	CN1	≥0.14mm ² (AWG26), including shielded wire
Encoder signal terminal	CN2	≥0.14mm ² (AWG26), including shielded wire
Brake resistance terminal	P _Φ , C	1.5~4mm ²


3.3.4 Layout of Drive Terminal Pins

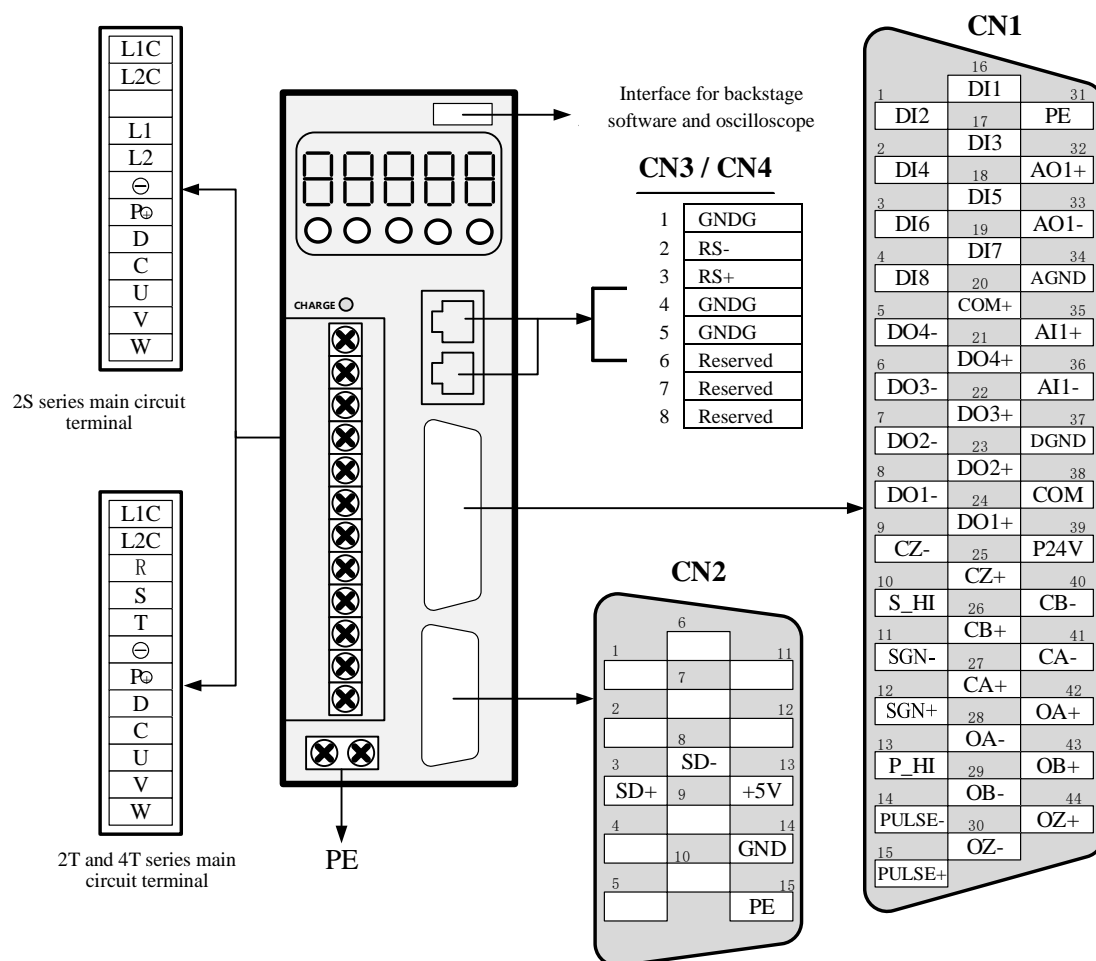


The diagram above shows the arrangement of pins of the Product's terminals

3.3.5 About the Main Circuit Terminal

1. Please use cable resistant to voltage over 600V as the main circuit.
2. Please consider the allowed current attenuation coefficient of cable when binding cables and put them into the hard PVC pipe or metal casing.
3. Please use heat-resistant cable at high temperature (cabinet temperature), for general PVC cable will be aged quickly and fail to be reused within short period.

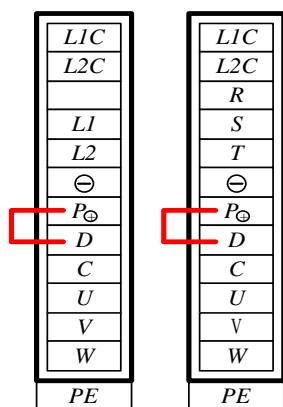


Layout of SIZE-A and SIZE-B
Main Circuit Terminal

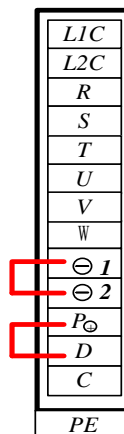

Layout of SIZE-C Main
Circuit Terminal

Terminal Symbol	Terminal Name	Description
L1, L2	Power input terminal of main circuit	1-phase 220V power input terminal of main circuit, applies to 2S series servo drive
R, S, T		3-phase 220V, 380V power input terminal of main circuit, applies to 2T and 4T series servo drive
L1C, L2C	Control power input terminal	Control circuit power input; 1-phase 220V for 2S and 2T series servo drive, or 1-phase 380V for 4T series servo drive
P \oplus , D, C	External brake resistance connection terminal	Carry out short connection between P \oplus and D as default. Please dismantle the short contact tag and connect external brake resistor between P \oplus and C if there's insufficient braking capability. The external brake resistor should be ordered separately as required.
P \oplus , \ominus or P \oplus , 1/2	Shared DC busbar terminal	The DC busbar terminal of servo can be connected to shared busbar under parallel connection of multiple machines
1, 2	External reactor connection terminal	Connect short contact tag between 1 and 2 as default; remove the short contact tag and connect DC reactor between 1 and 2 if higher harmonic of power supply needs to be restrained.
U, V, W	Servo motor connection terminal	Connect the connection terminal of servo motor to terminal U, V and W of motor.
PE	Grounding	Connect the two grounding terminals to the power grounding terminal and motor grounding terminal. Make sure to carry out grounding of the entire system.

3.3.6 Wiring of Brake Resistor

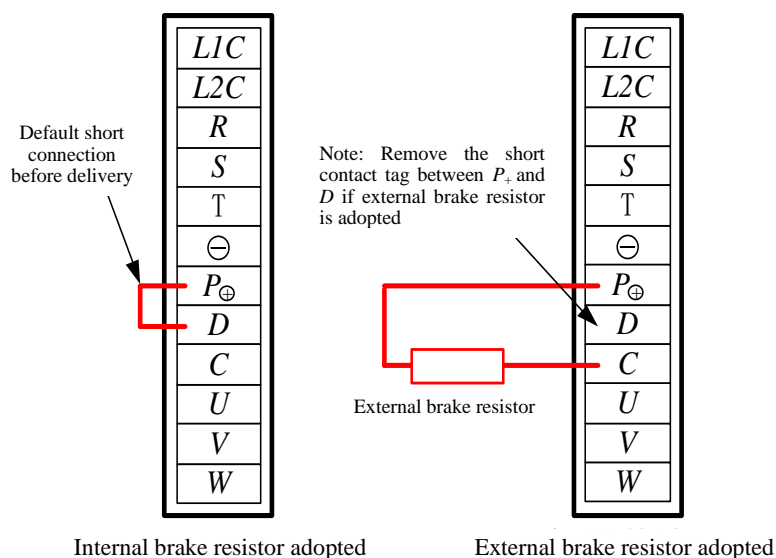


Refer to Chapter 2.1.6 for the type selection and use of brake resistor.

Wiring Notice of Brake Resistor:


1. Do NOT connect the external brake resistor onto the positive/negative anode P_{\oplus}/\ominus directly; otherwise, explosion and fire will occur!
2. Make sure to remove the short contact tag between Drive P_{\oplus} and D if external resistor is used; otherwise, brake pipe will be damaged due to overcurrent!
3. Please mount the external brake resistor on incombustibles, such as metal.
4. Make sure parameters of brake resistor are set properly before use of servo.
5. Do NOT run the Product under the min. allowable resistance; otherwise, the Product will give out alarm or be damaged!

3.3.7 Cases of Power Supply Wiring


1) 1-phase 220VAC:

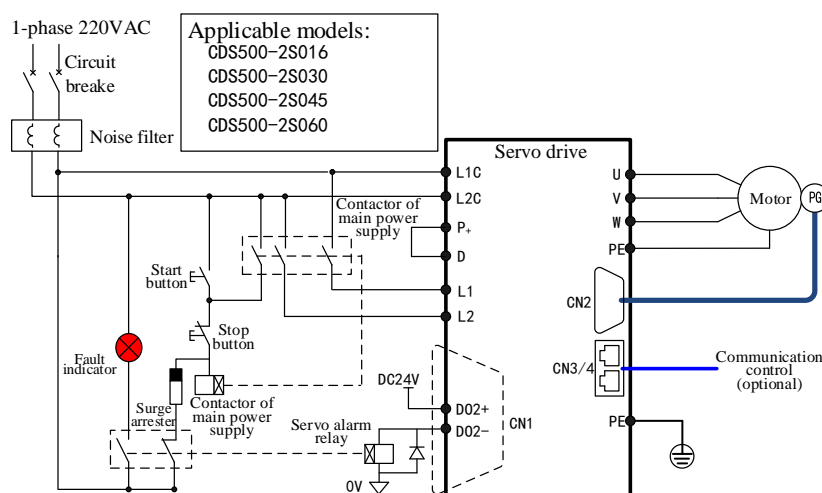

2) 3-phase 220VAC:

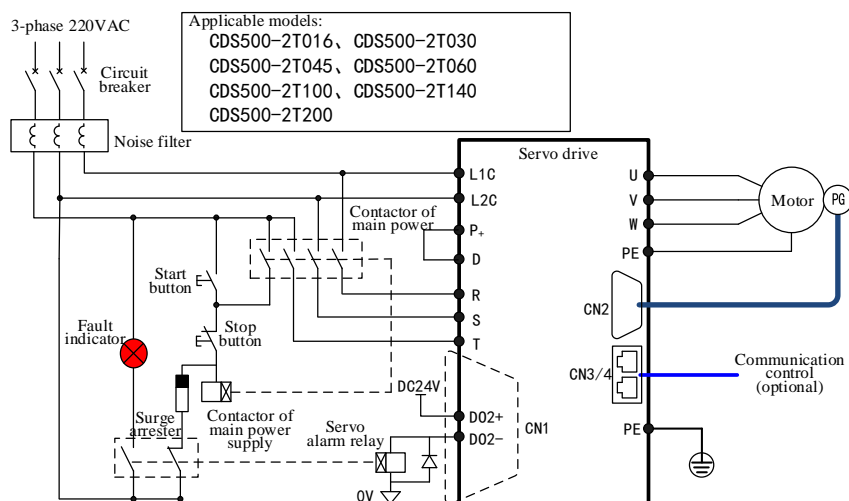


3) 3-phase 380VAC:

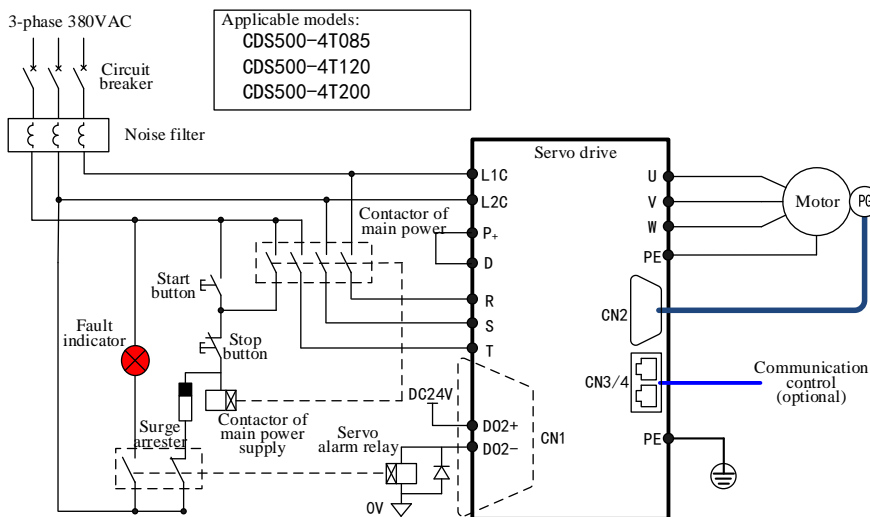

3.3.8 Connection of Power Line between Servo Drive and Servo Motor

Connector at servo motor side of power cable



Name	Layout of Plug Pin	Applicable Motors										
Common plug of motor power line		<table border="1"> <thead> <tr> <th>Pin</th> <th>Name</th> </tr> </thead> <tbody> <tr> <td>1</td> <td>U</td> </tr> <tr> <td>2</td> <td>V</td> </tr> <tr> <td>3</td> <td>W</td> </tr> <tr> <td>4</td> <td>PE</td> </tr> </tbody> </table>	Pin	Name	1	U	2	V	3	W	4	PE
		Pin	Name									
		1	U									
		2	V									
		3	W									
4	PE											
40												
60												
80												
90												
Common plug of motor brake coil		<table border="1"> <thead> <tr> <th>Pin</th> <th>Name</th> </tr> </thead> <tbody> <tr> <td>1</td> <td>+</td> </tr> <tr> <td>2</td> <td>-</td> </tr> </tbody> </table>	Pin	Name	1	+	2	-				
		Pin	Name									
		1	+									
2	-											
Motor with brake												

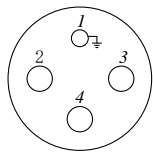Name	Layout of Plug Pin	Applicable Motors										
Aviation plug of motor power line		<table border="1"> <thead> <tr> <th>Pin</th> <th>Name</th> </tr> </thead> <tbody> <tr> <td>1</td> <td>PE</td> </tr> <tr> <td>2</td> <td>U</td> </tr> <tr> <td>3</td> <td>V</td> </tr> <tr> <td>4</td> <td>W</td> </tr> </tbody> </table>	Pin	Name	1	PE	2	U	3	V	4	W
		Pin	Name									
		1	PE									
		2	U									
		3	V									
4	W											
100												
110												
130												
150												
180												
<p>Note: The power cable color should be subject to the real objects. Colors of cables in the Instructions should be subject to Delixi cables.</p>												



3.3.9 Connection of Encoder Line between Servo Drive and Servo Motor

(1) 2,500-wire incremental encoder

Connector at servo motor side of encoder cable

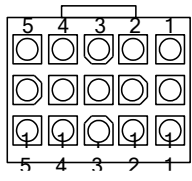
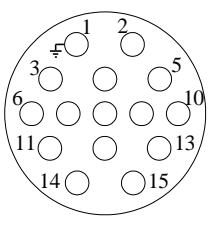
Name	Layout of Plug Pin	Applicable Motor Flanges																																				
Common plug of encoder		<table border="1"> <thead> <tr> <th>Pin</th> <th>Name</th> <th>Pin</th> <th>Name</th> </tr> </thead> <tbody> <tr> <td>1</td> <td>PE</td> <td>9</td> <td>A+</td> </tr> <tr> <td>2</td> <td>+5V</td> <td>10</td> <td>V+</td> </tr> <tr> <td>3</td> <td>GND</td> <td>11</td> <td>W+</td> </tr> <tr> <td>4</td> <td>B+</td> <td>12</td> <td>V-</td> </tr> <tr> <td>5</td> <td>Z-</td> <td>13</td> <td>A-</td> </tr> <tr> <td>6</td> <td>U+</td> <td>14</td> <td>B-</td> </tr> <tr> <td>7</td> <td>Z+</td> <td>15</td> <td>W-</td> </tr> <tr> <td>8</td> <td>U-</td> <td></td> <td></td> </tr> </tbody> </table>	Pin	Name	Pin	Name	1	PE	9	A+	2	+5V	10	V+	3	GND	11	W+	4	B+	12	V-	5	Z-	13	A-	6	U+	14	B-	7	Z+	15	W-	8	U-		
		Pin	Name	Pin	Name																																	
		1	PE	9	A+																																	
		2	+5V	10	V+																																	
		3	GND	11	W+																																	
		4	B+	12	V-																																	
		5	Z-	13	A-																																	
		6	U+	14	B-																																	
		7	Z+	15	W-																																	
8	U-																																					
40																																						
60																																						
80																																						
90																																						
Aviation plug of encoder		<table border="1"> <thead> <tr> <th>Pin</th> <th>Name</th> <th>Pin</th> <th>Name</th> </tr> </thead> <tbody> <tr> <td>1</td> <td>PE</td> <td>9</td> <td>Z-</td> </tr> <tr> <td>2</td> <td>+5V</td> <td>10</td> <td>U+</td> </tr> <tr> <td>3</td> <td>GND</td> <td>11</td> <td>V+</td> </tr> <tr> <td>4</td> <td>B+</td> <td>12</td> <td>W+</td> </tr> <tr> <td>5</td> <td>A+</td> <td>13</td> <td>U-</td> </tr> <tr> <td>6</td> <td>Z+</td> <td>14</td> <td>V-</td> </tr> <tr> <td>7</td> <td>B-</td> <td>15</td> <td>W-</td> </tr> <tr> <td>8</td> <td>A-</td> <td></td> <td></td> </tr> </tbody> </table>	Pin	Name	Pin	Name	1	PE	9	Z-	2	+5V	10	U+	3	GND	11	V+	4	B+	12	W+	5	A+	13	U-	6	Z+	14	V-	7	B-	15	W-	8	A-		
		Pin	Name	Pin	Name																																	
		1	PE	9	Z-																																	
		2	+5V	10	U+																																	
		3	GND	11	V+																																	
		4	B+	12	W+																																	
		5	A+	13	U-																																	
		6	Z+	14	V-																																	
		7	B-	15	W-																																	
8	A-																																					
100																																						
110																																						
130																																						
150																																						
180																																						

Connector at servo drive side of encoder cable

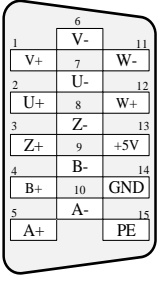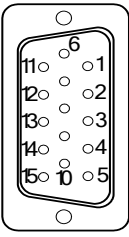Encoder	 <p style="text-align: center;">CN2</p>	 <table border="1" style="margin-left: auto; margin-right: auto;"> <thead> <tr> <th>Pin</th> <th>Name</th> <th>Pin</th> <th>Name</th> </tr> </thead> <tbody> <tr><td>1</td><td>V+</td><td>9</td><td>B-</td></tr> <tr><td>2</td><td>U+</td><td>10</td><td>A-</td></tr> <tr><td>3</td><td>Z+</td><td>11</td><td>W-</td></tr> <tr><td>4</td><td>B+</td><td>12</td><td>W+</td></tr> <tr><td>5</td><td>A+</td><td>13</td><td>+5V</td></tr> <tr><td>6</td><td>V-</td><td>14</td><td>GND</td></tr> <tr><td>7</td><td>U-</td><td>15</td><td>PE</td></tr> <tr><td>8</td><td>Z-</td><td></td><td></td></tr> </tbody> </table>	Pin	Name	Pin	Name	1	V+	9	B-	2	U+	10	A-	3	Z+	11	W-	4	B+	12	W+	5	A+	13	+5V	6	V-	14	GND	7	U-	15	PE	8	Z-		
Pin	Name	Pin	Name																																			
1	V+	9	B-																																			
2	U+	10	A-																																			
3	Z+	11	W-																																			
4	B+	12	W+																																			
5	A+	13	+5V																																			
6	V-	14	GND																																			
7	U-	15	PE																																			
8	Z-																																					

(2) Absolute value encoder wire

Connector at servo motor side of encoder cable

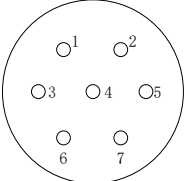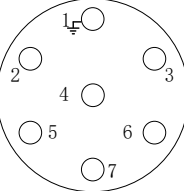Name	Layout of Plug Pin	Applicable Motors																				
Warren plug of absolute value encoder		<table border="1" style="margin-left: auto; margin-right: auto;"> <thead> <tr style="background-color: #00FFFF;"> <th>Pin</th> <th>Name</th> <th>Pin</th> <th>Name</th> </tr> </thead> <tbody> <tr><td>1</td><td>PE</td><td>5</td><td>GND</td></tr> <tr><td>2</td><td>E-</td><td>6</td><td>SD+</td></tr> <tr><td>3</td><td>E+</td><td>7</td><td>+5V</td></tr> <tr><td>4</td><td>SD-</td><td></td><td></td></tr> </tbody> </table>	Pin	Name	Pin	Name	1	PE	5	GND	2	E-	6	SD+	3	E+	7	+5V	4	SD-		
Pin	Name	Pin	Name																			
1	PE	5	GND																			
2	E-	6	SD+																			
3	E+	7	+5V																			
4	SD-																					
Aviation plug of absolute value encoder		<table border="1" style="margin-left: auto; margin-right: auto;"> <thead> <tr style="background-color: #00FFFF;"> <th>Pin</th> <th>Name</th> <th>Pin</th> <th>Name</th> </tr> </thead> <tbody> <tr><td>1</td><td>PE</td><td>5</td><td>GND</td></tr> <tr><td>2</td><td>E-</td><td>6</td><td>SD+</td></tr> <tr><td>3</td><td>E+</td><td>7</td><td>+5V</td></tr> <tr><td>4</td><td>SD-</td><td></td><td></td></tr> </tbody> </table>	Pin	Name	Pin	Name	1	PE	5	GND	2	E-	6	SD+	3	E+	7	+5V	4	SD-		
Pin	Name	Pin	Name																			
1	PE	5	GND																			
2	E-	6	SD+																			
3	E+	7	+5V																			
4	SD-																					

Connector at servo drive side of encoder cable

Absolute value encoder																																				
			<table border="1"> <thead> <tr> <th>Pin</th> <th>Name</th> <th>Pin</th> <th>Name</th> </tr> </thead> <tbody> <tr> <td>1</td> <td>-</td> <td>9</td> <td>-</td> </tr> <tr> <td>2</td> <td>-</td> <td>10</td> <td>-</td> </tr> <tr> <td>3</td> <td>SD+</td> <td>11</td> <td>-</td> </tr> <tr> <td>4</td> <td>-</td> <td>12</td> <td>-</td> </tr> <tr> <td>5</td> <td>-</td> <td>13</td> <td>+5V</td> </tr> <tr> <td>6</td> <td>-</td> <td>14</td> <td>GND</td> </tr> <tr> <td>7</td> <td>-</td> <td>15</td> <td>PE</td> </tr> <tr> <td>8</td> <td>SD-</td> <td></td> <td></td> </tr> </tbody> </table>	Pin	Name	Pin	Name	1	-	9	-	2	-	10	-	3	SD+	11	-	4	-	12	-	5	-	13	+5V	6	-	14	GND	7	-	15	PE	8
Pin	Name	Pin	Name																																	
1	-	9	-																																	
2	-	10	-																																	
3	SD+	11	-																																	
4	-	12	-																																	
5	-	13	+5V																																	
6	-	14	GND																																	
7	-	15	PE																																	
8	SD-																																			

Wiring Notice of Encoder Signal Cable:


1. The shielded network layer at drive and motor side **MUST** be grounded reliably; otherwise, the Product will give false alarm!
2. The 0.13~0.52 mm² twisted shielded pair cable with length within 20 m is recommended.
3. The length of encoder cable should be determined by fully considering the voltage drop due to cable resistance and signal attenuation due to the distributed capacitance; the twisted pair shielded cable within 10 m and over 0.13 mm² is recommended; cable diameter should be increased properly along with the increase of length; see table below for details:

Wire Diameter (mm ²)	Resistivity (Ω/km)	Allowed Cable Length (m)
0.13(26AWG)	143	10
0.15(25AWG)	89.4	16
0.21(24AWG)	79.6	18
0.26(23AWG)	68.5	20
0.32(22AWG)	54.3	26
0.41(21AWG)	42.7	33
0.52(20AWG)	33.9	41

4. Shielded layer of encoder cable should be grounded reliably; the differential signals can be sent to certain pair of twisted line of cable.
5. The length of signal wire should be determined by fully considering the voltage drop due to cable resistance; pay attention to the capacity of power supply during power distribution, to make sure the Product's requirements are satisfied when signal and power reaches the Product's input side. It is recommended to use the twisted shielded pair cable with diameter of and over 0.13 mm².

6. Encoder cable should be separated from high-voltage cable with clearance over 30 cm.
7. The shielded layer should be connected and grounded reliably when connecting the encoder cable.

3.4 Connection of Control Signal Terminal CN1 of Servo Drive

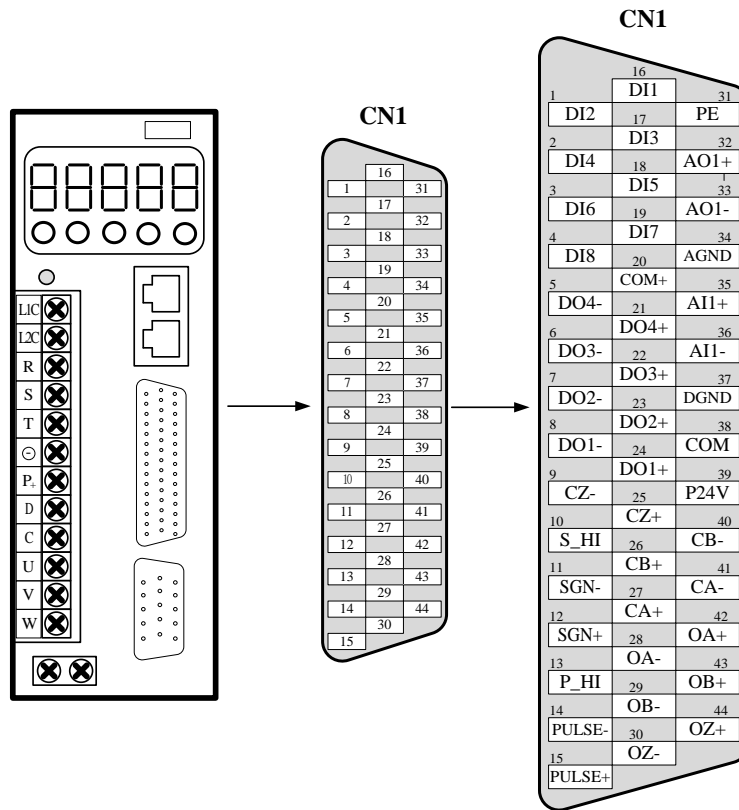

3.4.1 Input Signal

Signal Name		Pin No.	Function	
Pulse input	PULSE+	15	Input mode of pulse command: <ul style="list-style-type: none"> ●Differential drive input ●Open circuit of collector 	Form of input pulse: <ul style="list-style-type: none"> ●Direction + pulse ●Phase A and B of orthogonal pulse ●Pulse sequence CW/CCW
	PULSE-	14		
	SGN+	12		
	SGN-	11		


Signal Name		Pin No.	Function
External power supply	P_HI	13	External power input interface of command pulse
	S_HI	10	
Signal ground	DGND	37	Digital signal ground

The command pulse at upper compute side and symbol output circuit can be selected from the differential drive output or open circuit of collector. The max. input frequency and the min. pulse width are shown in table below:

Pulse Mode	Max. Frequency	Min. Pulse Width (us)
Difference	500K	1
Open collector	200K	2.5

Note: Pulse receiving error will occur in the Product if the output pulse width of upper device is lower than the min. pulse width.

a) Under differential mode

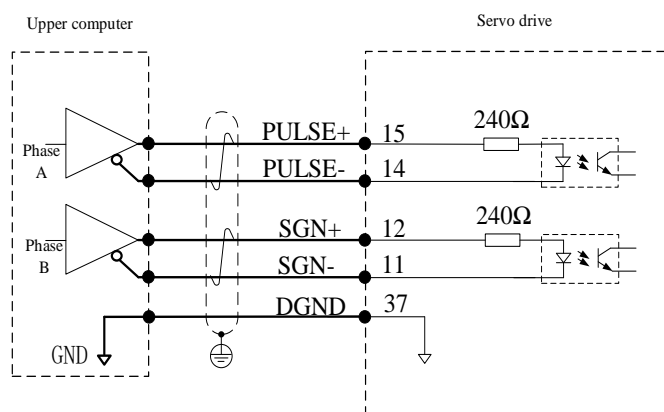


b) Under open circuit of collector

① Internal 24V power supply in servo drive is adopted

◆ Common cathode


◆ Common anode

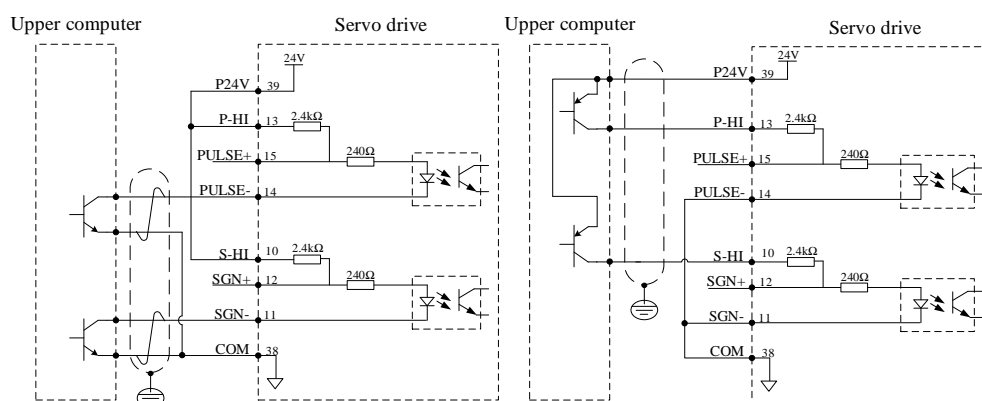


② External 24V power supply is adopted

I. Internal resistor adopted (recommended)

◆ Common cathode

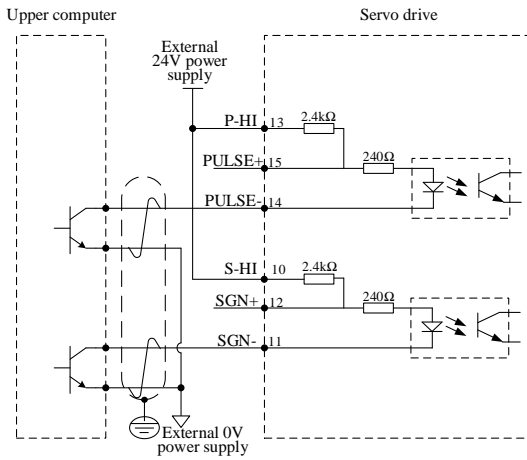


◆ Common anode

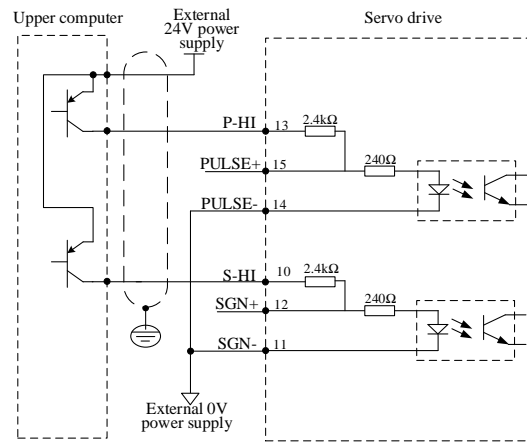


II. External resistor adopted

◆ Common cathode

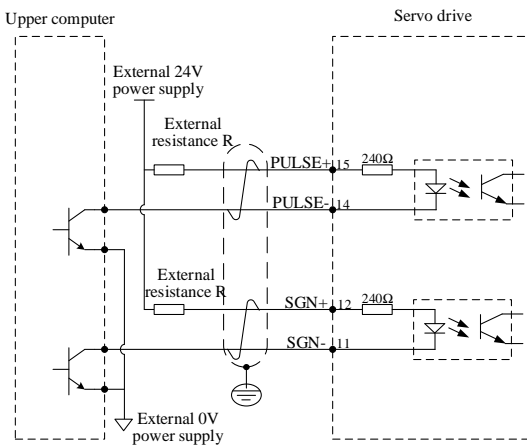

◆ Common anode

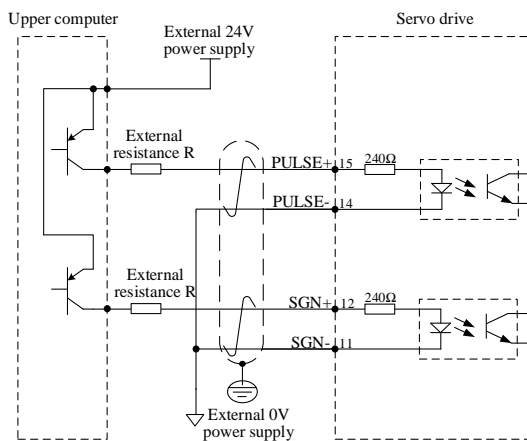

Resistance R should be selected according to the formula:

$$\frac{V_{CC}-1.5}{R+200} = 10\text{mA}$$

Voltage Vcc	Resistance R	Power R
24V	2.4kΩ	0.5W
12V	1.5kΩ	0.5W


Introduction to Pulse Input Wiring:

1. If external resistor wiring method is adopted, select current-limiting resistor, its resistance and power correctly; otherwise, the terminal will be burnt.
2. If multiple terminals are used, allocate independent current-limiting resistor to each terminal instead of sharing it; otherwise, pulse receiving error will occur!
3. Each signal current circuit should include positive/negative anode of power supply, current-limiting resistance, signal sending and receiving; otherwise, it will damage the terminal or lead to pulse receiving error.
4. Please use twisted shielded pair wire as the pulse input/output wire. Both ends of the shielded layer MUST be connected to PE, GND and upper computer signal ground reliably.

3.4.2 Input Signal of Analog Quantity


Signal Name	Pin No.	Description
AI1+	35	Input signal of analog quantity Voltage input range: -10V~10V; resolution: 12-bit Input impedance: About 9kΩ
AI1-	36	
AGND	34	Signal ground of analog quantity

AI1+ and AI1- are input terminals for analog signals of speed and torque. Voltage commands are set through F2.1 group.

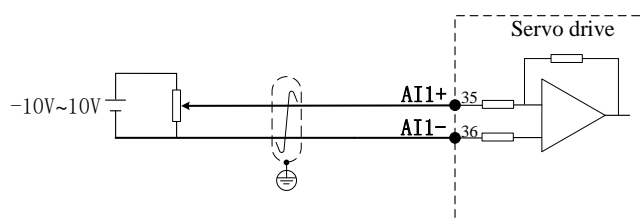**3.4.3 Output Signal of Analog Quantity**

Signal Name	Pin No.	Description
AO1+	32	Output signal of analog quantity Voltage output range: -10V~10V Max. output current: 1mA
AO1-	33	
AGND	34	Signal ground of analog quantity

AO1+ and AO1- are signal output terminal of the Product's analog quantity. The outputted monitoring contents are set through F2.1 group.

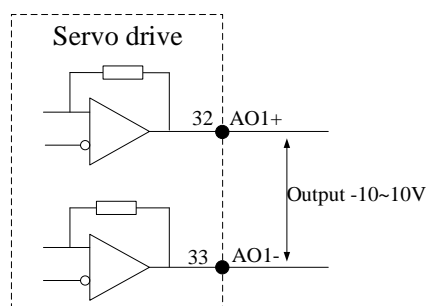

Note: Please use twisted shielded pair for wiring of AI/AO circuit. Both ends of shielded layer MUST be connected to PE.


3.4.4 Digital Input/output Signal

Signal Name	Pin No.	Function Introduction
P24V	39	Internal 24V power supply; voltage range: +20~28V; max. output current: 200mA.
COM	38	
COM+	20	Common terminal of Signal DI input (12V~24V)
DI1	16	Signal DI1 input terminal, set SON servo function as default
DI2	1	Signal DI2 input terminal, set emergency stop of EMGS servo as default
DI3	17	Signal DI3 input terminal, set CCWL forward rotation limit as default
DI4	2	Signal DI4 input terminal, set CWL reverse rotation limit as default
DI5	18	Signal DI5 input terminal, set CCLR and clear pulse counter as default
DI6	3	Signal DI6 input terminal, set command ban of INHP position as default
DI7	19	Signal DI7 input terminal, set TRLM forward rotation torque limit as default
DI8	4	Signal DI8 input terminal, set TLLM reverse rotation torque limit as default
DO1+	24	Signal DO1 signal output + terminal, set SDRY servo preparation + as default
DO1-	8	Signal DO1 output – terminal, set SDRY servo preparation – as default
DO2+	23	Signal DO2 output + terminal, set ALRM servo alarm + as default
DO2-	7	Signal DO2 output – terminal, set ALRM servo alarm – as default
DO3+	22	Signal DO3 output + terminal, set TTQR servo torque arrival + as default
DO3-	6	Signal DO3 output – terminal, set TTQR servo torque arrival – as default
DO4+	21	Signal DO4 output + terminal, set BRK servo brake output + as default
DO4-	5	Signal DO4 output – terminal, set BRK servo brake output – as default

1) Input Circuit of Digital Quantity


Take DI1 as example, the circuits of Interface DI1-DI8 are the same

a) If passive switch is adopted by the upper device:

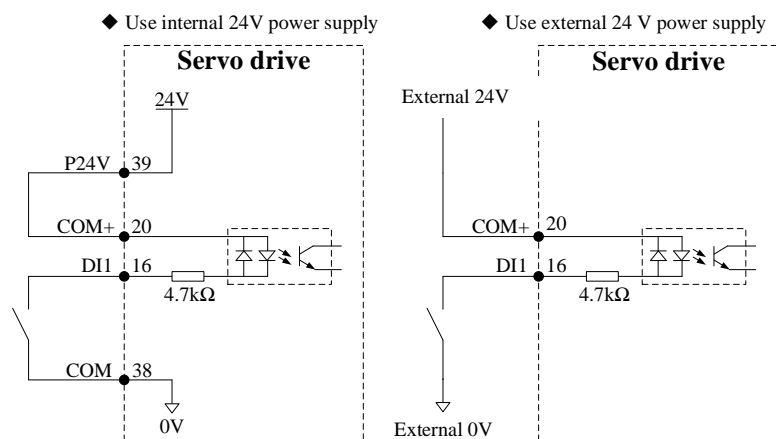


b) If open collector is adopted in upper device:

① When internal 24V power supply is adopted in servo drive:

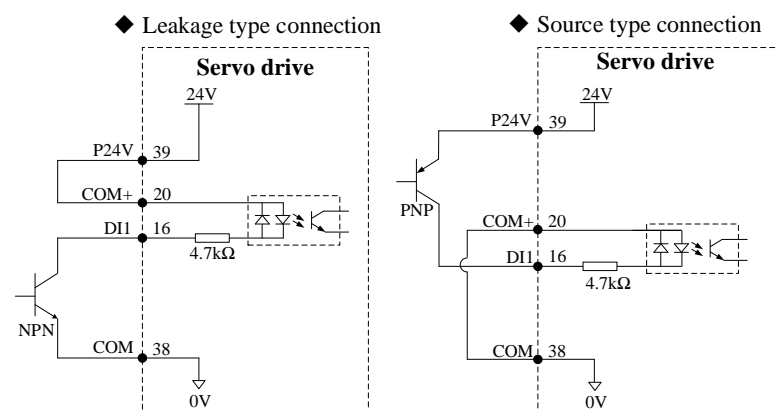

② If external power supply is adopted:

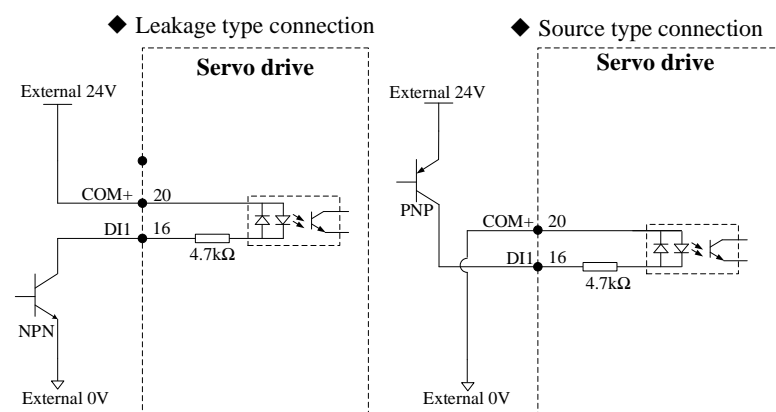


Note: Mixed use of PNP and NPN input is not supported.


2) Output Circuit of Digital Quantity

Take DO1 as example, the circuits of Interface DO1~DO4 are the same

◆ When relay is driven

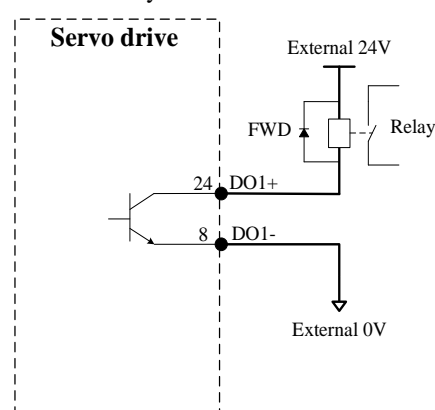

◆ When optical coupler is driven

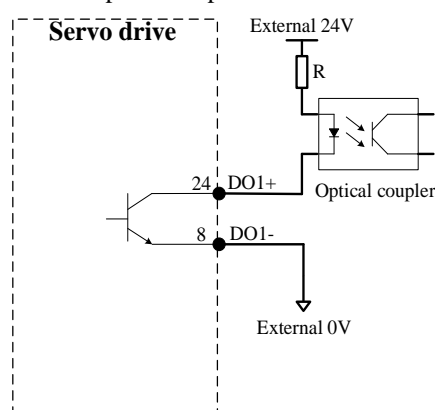


- Note:** 1. As a passive output, DO must be supplemented with power supply for driving the loads. Power range of Terminal DO: 5V~24V; the max. allowed current is DC50mA.
2. Make sure to connect the FWD at the correct direction when driving the relay; otherwise, the Terminal DO can be damaged.
3. Make sure to connect proper current-limiting resistor when driving the optical coupler; otherwise, Terminal DO can be damaged.

3.4.5 Frequency Division Output Signals of Encoder


Signal Name	Pin No.	Function Description	
CA+	27	Phase A frequency division output (collector signal)	Output signal of orthogonal frequency division of Phase A and B
CA-	41		
OA+	42	Phase A frequency division output (differential signal)	
OA-	28		
CB+	26	Phase B frequency division output (collector signal)	
CB-	40		
OB+	43	Phase B frequency division output (differential signal)	Output signal of orthogonal frequency division of Phase A and B
OB-	29		
CZ+	25	Phase Z frequency division output (collector signal)	Output signal of original pulse
CZ-	9		
OZ+	44	Phase Z frequency division output (differential signal)	
OZ-	30		
PE	Shell	Shielded ground	

The frequency division output circuit of encoder outputs through differential signal (collector). Generally, feedback signal will be provided if position control system is composed of upper device. The max. output current of differential output is 20mA. The max. output current is 20mA for differential output, or 50mA for the open circuit of collector. **Note: It is recommended to use twisted shielded pair as output cable. Both ends of shielded layer must be connected to PE.**

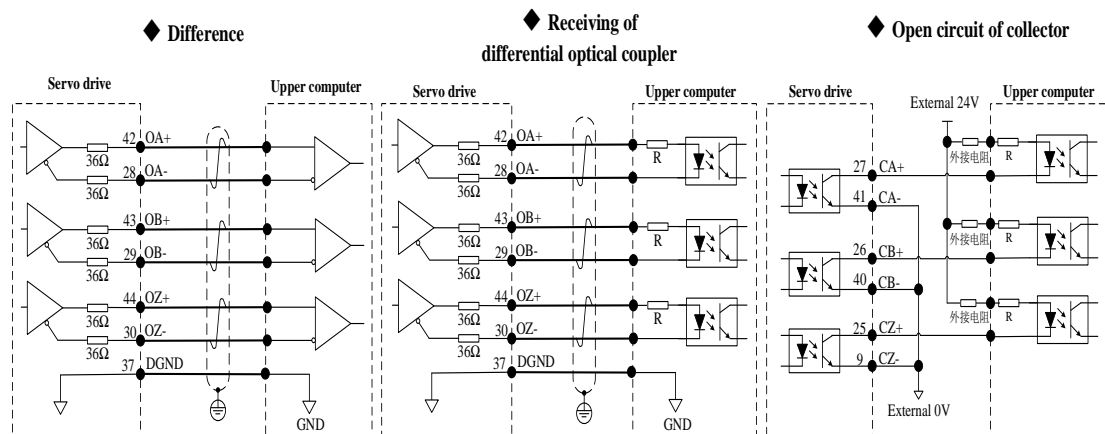


3.4.6 Brake Output

The brake is designed for preventing movement of motor shaft, locking the motor position and preventing shifting of mechanical moving parts due to weight or external forces when the Product is not running.

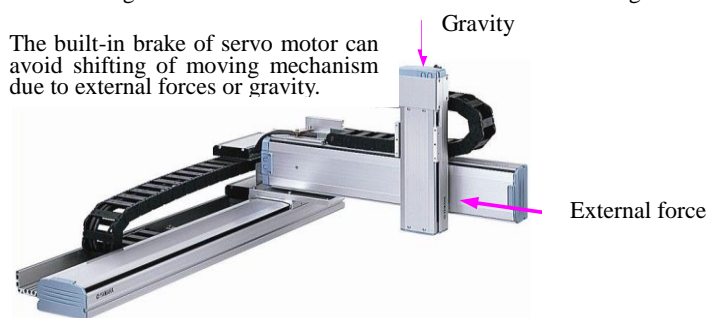


Note:

1. As a non-energized acting mechanism for fixing purpose, the built-in brake of servo motor is designed for keeping the servo motor stopped, instead of braking.
2. The built-in brake may have “click” sounds when its motor is rotating and it has no influences on the functions.
3. Flux leakage may occur at the shaft end when brake coil is powered on (brake is open). Be careful when using instruments such as magnetic sensor near the motor.
5. 24V power supply should be prepared by user for there’s polarity in the connection of brake input signal of brake wiring.
6. Examples of brake signal BRK and standard wiring of brake power supply are shown below:

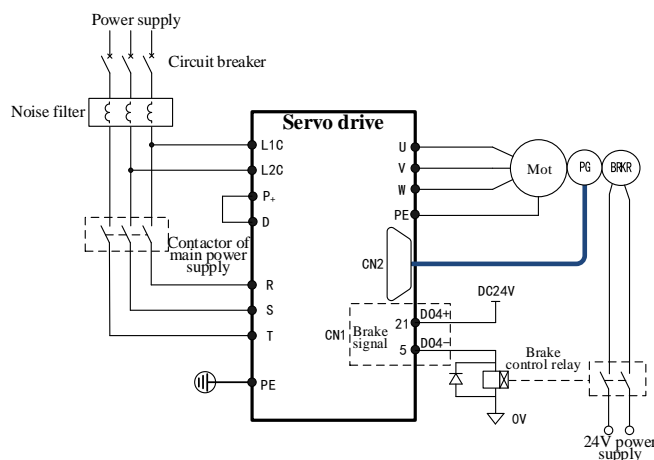

- 7. The length of motor brake cable should be determined by fully considering the voltage drop due to cable resistance. The brake should ensure input voltage of 21.6V at least.
- 8. Do NOT share the power supply of brake with other electrical appliances; for other appliances may reduce the working voltage or current and lead to misoperation of brake.
- 9. Cable with diameter over 0.5mm².


3.5 CN3/CN4 Wiring of RS-485 Communication

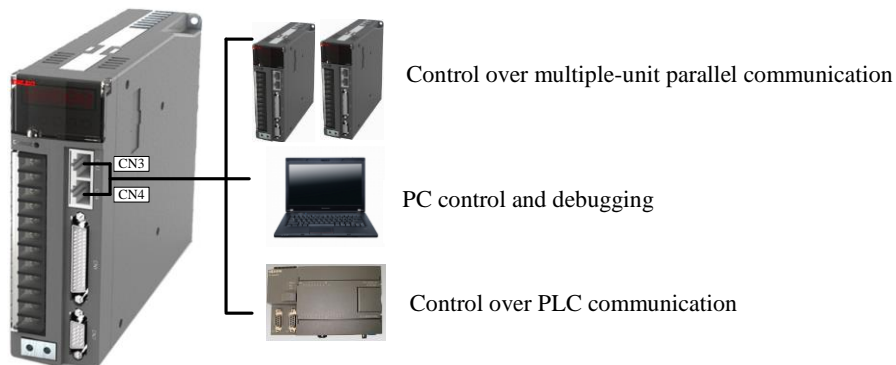

Communication interface (CN3 and CN4) means two communication signal connectors of the same type and with internal parallel connection. Terminal definition is as follows:


Pin No.	Definition	Description	Layout of Terminal Pin (Drive)
1	GNDG	Ground	
2	RS-	RS-485 communication terminal	
3	RS+		
4~5	GNDG	Ground	
6~8	Reserved	-	
Shell	PE	Shielded	

Serial port can be connected to USB wire for conversion if upper computer has no serial port as follows:

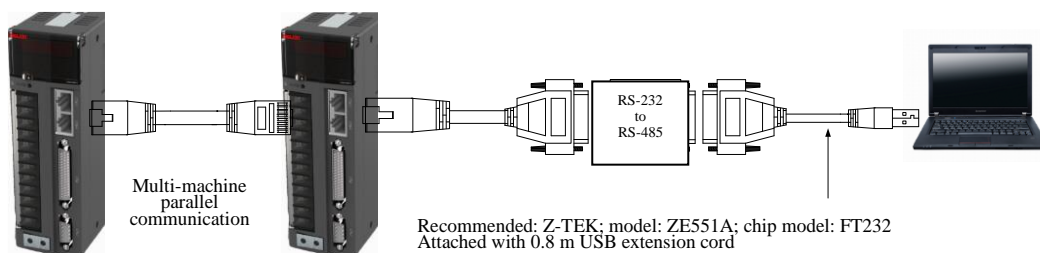


3.6 Wiring under Three Control Modes


3.6.1 Wiring Diagram of Speed Control Mode

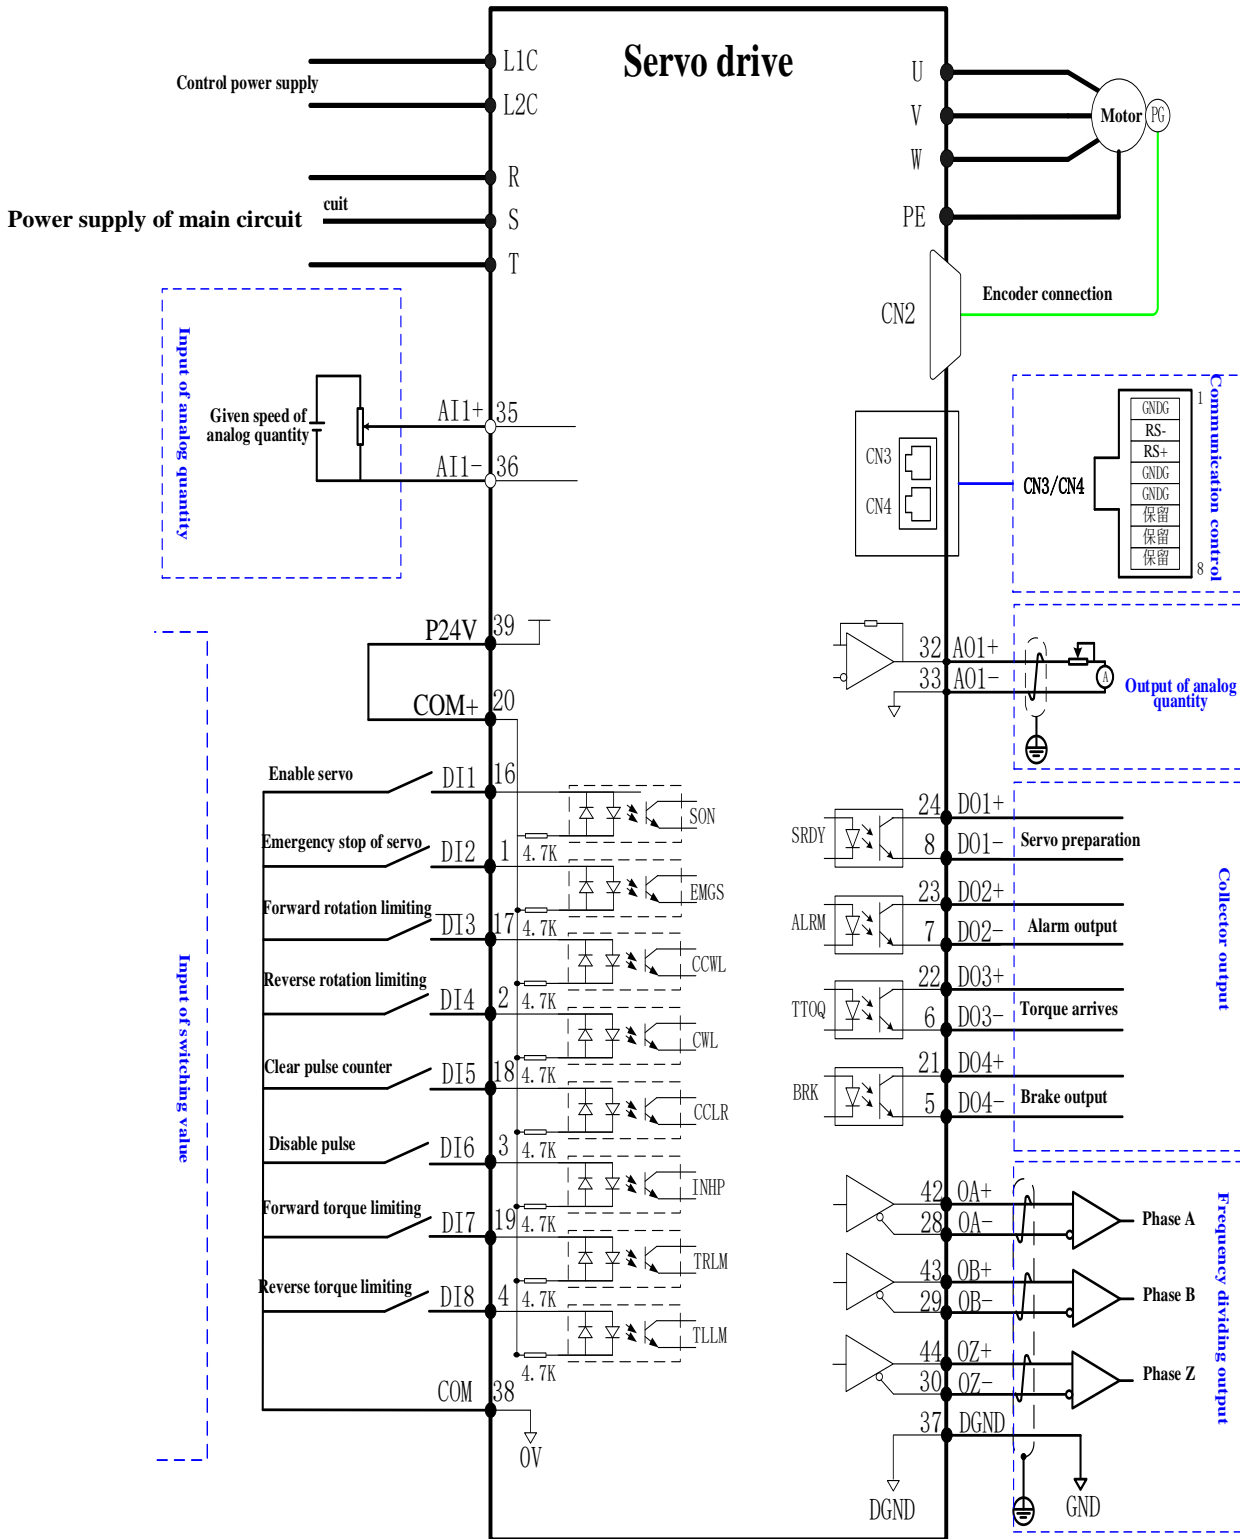

3.6.2 Wiring Diagram of Torque Control Mode

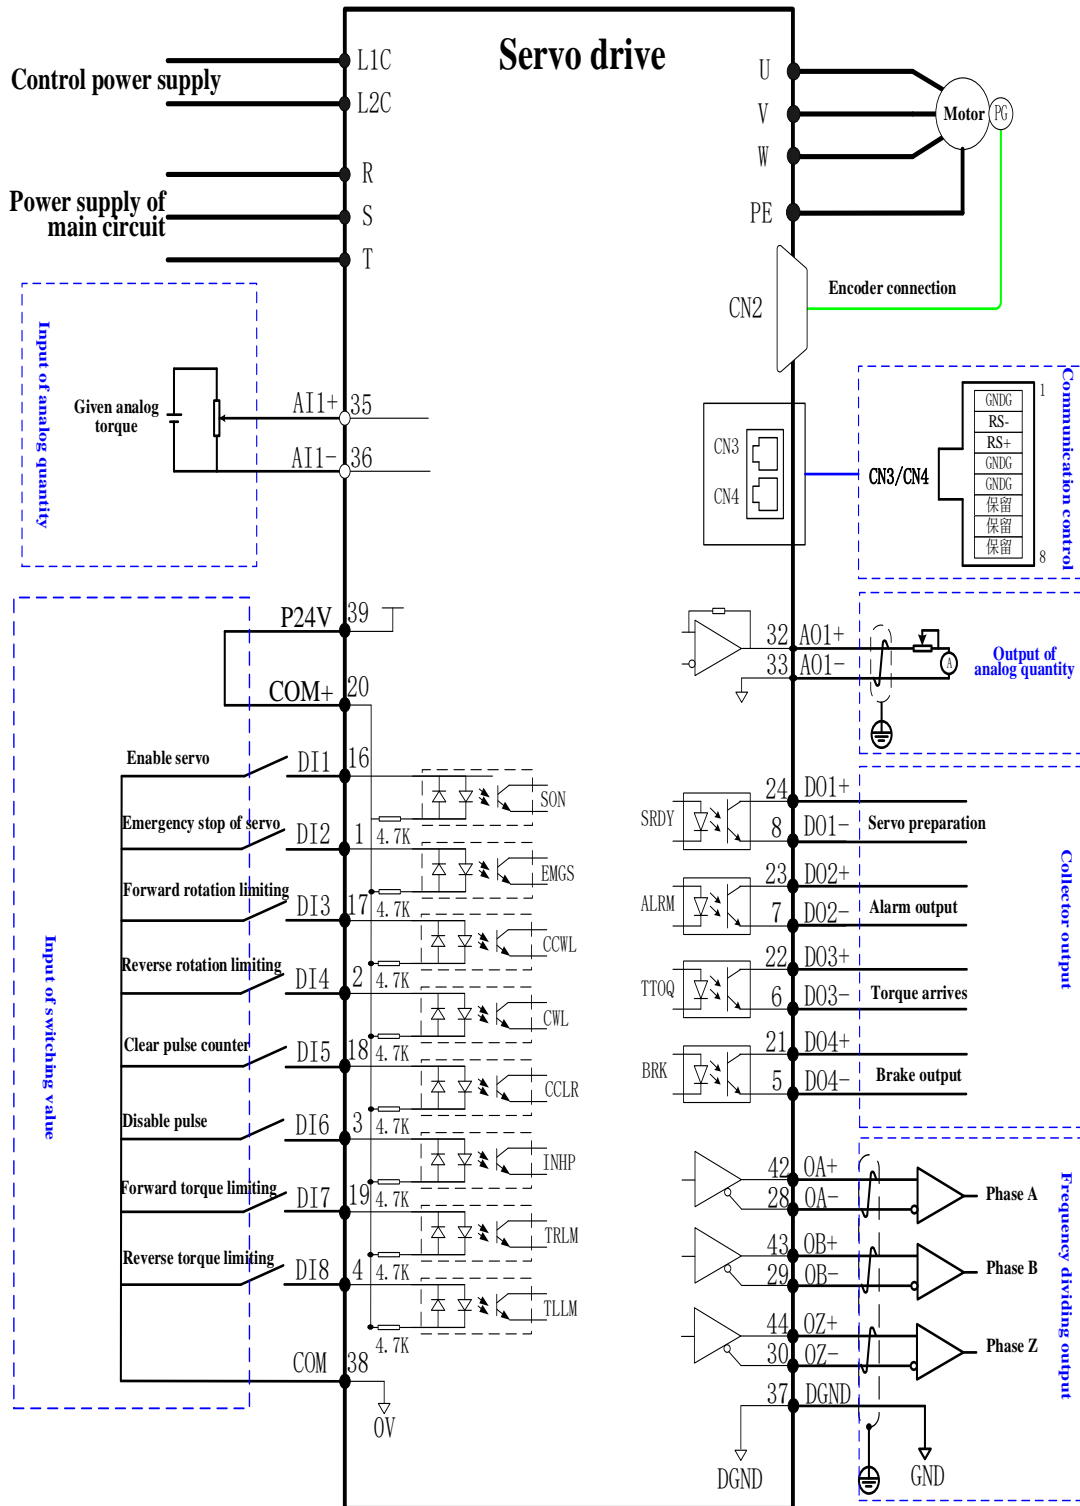


3.6.3 Wiring Diagram of Position Control Mode

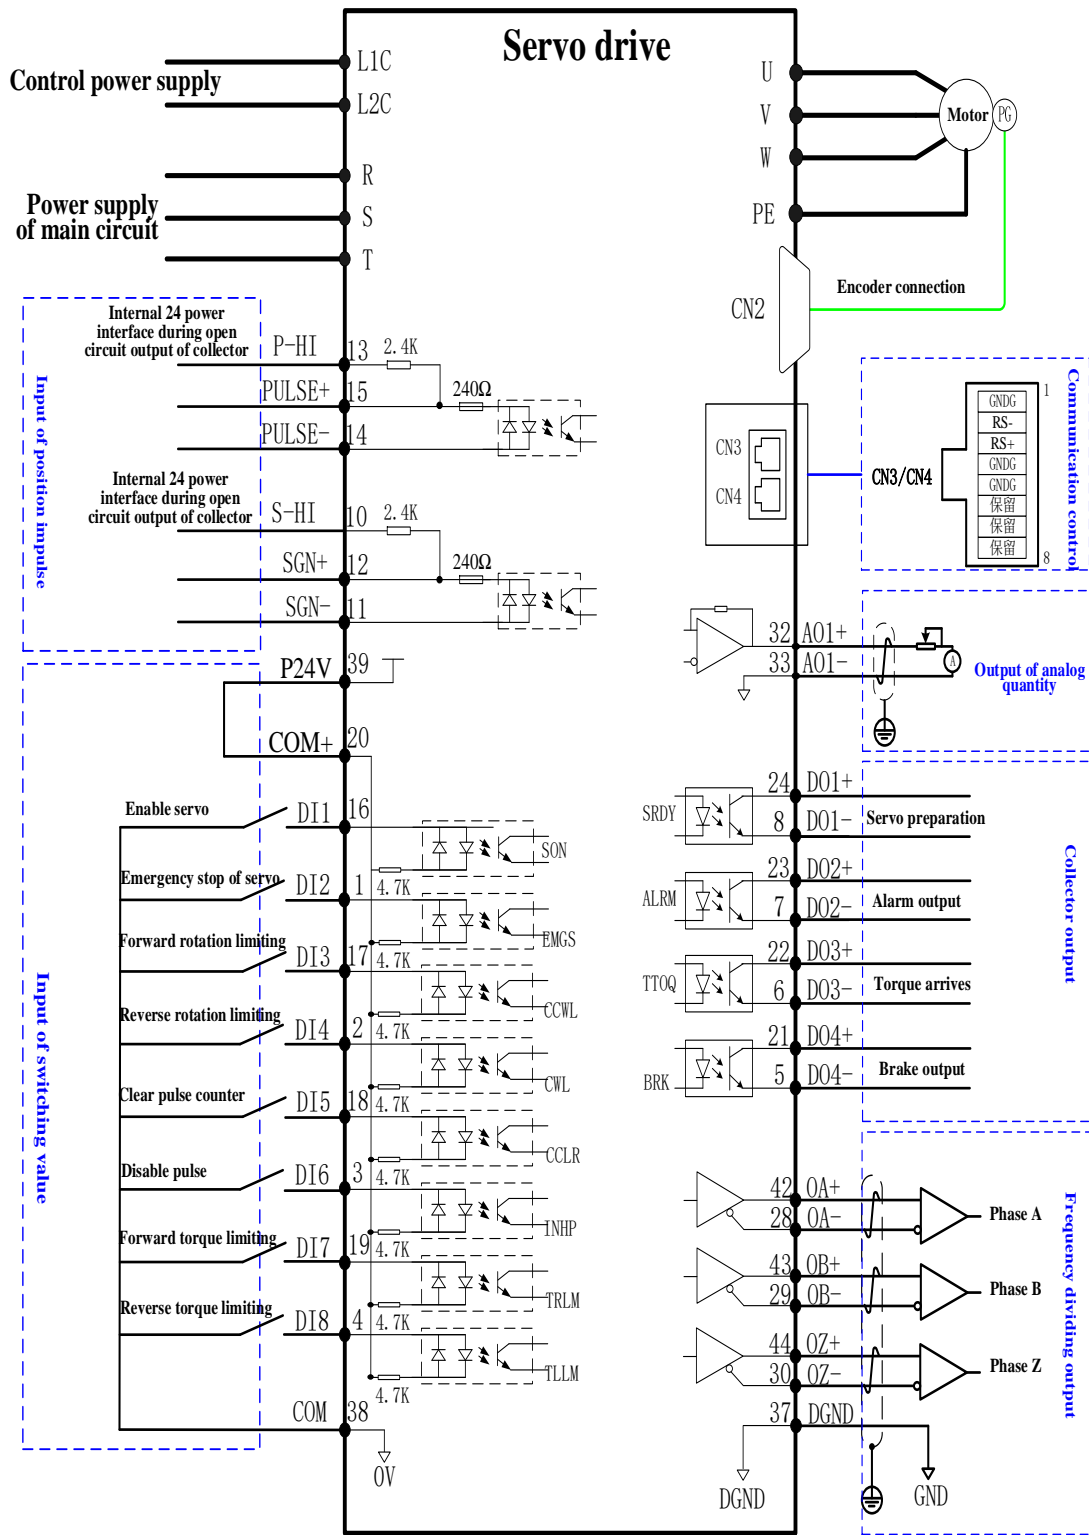

Chapter 4 Panel Display and Operation

4.1 Composition of Panel

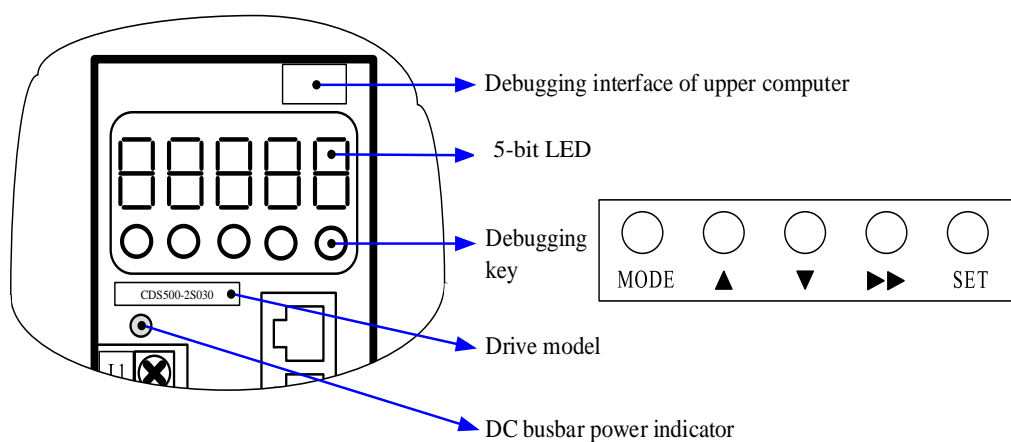

Schematic Diagram for Panel Appearance

Composed of display (5-bit 7-section LED) and keys, the Product's panel is designed for displaying, parameter and password setting and execution of general functions. Take parameter setting as example, the common functions of keys are as follows:


Name	Functions
MODE key	Menu key: Switch modes and return to the upper menu
▲ key	Up key: Increase the LED number in flickering
▼ key	Down key: Decrease the LED number in flickering
►► key	Shift key: Select and set parameter, move data modification bit; switch the display of data in other bits when viewing the data with over 5 bits
SET key	Confirmation key: Enter the next menu and execute storage of parameter setting

4.2 Panel Display

While the Product is running, the display can show the status, parameter, fault and monitoring status of servo.

- Monitoring layer: Display the real-time data and status of servo, such as motor speed, running mode and fault status;
- Parameter layer: Display the servo parameter and set value.
- Menu layer: Display the code and set value of servo parameter;

4.2.1 Switching of Panel Display

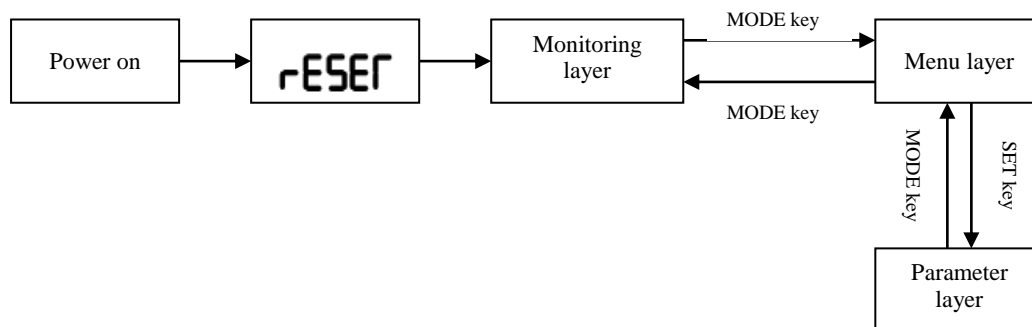

Schematic Diagram for Switching of Panel Displays


- Power on, the display shows “reset” for short period before entering the display layer.
- Press “MODE” key to switch display modes based on the switch conditions in diagram above.
- For any fault, switch to fault display mode (monitoring layer) immediately and 5-bit LED will flicker simultaneously. Press “MODE” key again to switch to parameter display mode.

4.2.2 Monitoring Layer

Once powered on and initialized, the panel will enter the monitoring layer automatically and display the contents of running status by default (d-STo). If menu layer is entered, press MODE key to return to the monitoring layer. When monitoring layer is entered, the panel will display the monitoring code “d-###” for about 1-2s before displaying the designated monitoring contents. The user may click ▲/▼ to change the monitoring contents (No backup data for power failure). The detailed description is shown in table below:

Display	Name	Monitoring Value 1	Reflection Parameter
d-STo	Servo status	0	F9.0.32
d-Err	Fault code	1	F6.1.09
d-SPd	Motor speed	2	F9.0.00
d-Pos	Motor feedback pulse number	3	F9.0.07
d-Pos	Motor feedback coil	4	F9.0.08
d-CP	Total number of common pulse L	5	F9.0.09
d-CP	Total number of command pulse H (*10000)	6	F9.0.10
d-EPo	Difference between command pulse and feedback pulse	7	F9.0.12
d-Trq	Output torque [% rated]	8	F9.0.03
d-I	Effective current	9	F9.0.22
d-UdC	Busbar voltage	10	F9.0.15
d-Frq	Frequency of command pulse	11	F9.0.11
d-ω	Speed command	12	F9.0.01
d-τ	Given torque [% rated]	13	F9.0.04
d-di	Status of input terminal	14	F9.0.19
d-do	Status of output terminal	15	F9.0.20
d-AI n	AI1 voltage value	16	F9.0.17
d-AFD	Module temperature	17	F9.0.16

4.2.3 Servo Status (F9.0.32)

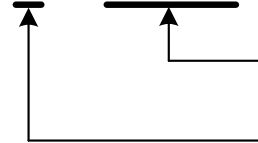

The last three bits represent the status of servo drive
Refer to table of drive status for status introduction

The previous bit represents the running mode of drive

H: Reset

S: Speed mode

P: Position mode


T: Torque mode

Table of Drive Status

Display	Name	Display Scenario	Meaning
	Servo initialization	When servo is powered on	The Product is initialized or reset. Once initialized or reset, it will be switched to other status automatically. The servo maintains at this status if the main circuit is not powered on.
	rdy Servo ready	Drive is ready	The Product is under ready status and waits for the servo enabling signal from the upper computer.
	run Servo running	Servo enabling signal is effective (SON is ON)	The Product is running.

4.2.4 Parameter Display

The Product can be divided into F0.0~F9.0 groups of function codes depending on the parameter functions. The position of function code can be located quickly according to function code group as follows:

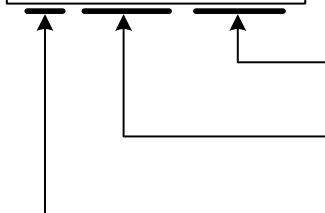

Function code group No.
(00-90)

Display mode:

F: Basic mode

u: User mode

c: Calibration mode

For example, function code F1.2.21 is displayed as follows:


Display	Name	Contents
F 1.2.21	Function code F1.2.21	F1.2: Function code group No. 21: Function code group No.

1) Display of Different Length Data and Negative Numbers


a) Signed number of and below 4 bits or unsigned number of and below 5 bits

Be displayed on single page (5-bit LED). For signed number, the top bit of data “-” means the negative sign.

 For example: -1234 is displayed as follows:



 For example: 36789 is displayed as follows:




b) Signed number over 4 bits or unsigned number over 5 bits

Be displayed in pages from low to high bits. Display method: Low 4-bit value + high 2-bit value + high 4-bit value, as shown in diagram below; press “▶▶” key to switch the present page.


For example: -0123456789 are displayed as follows:

▶▶ key

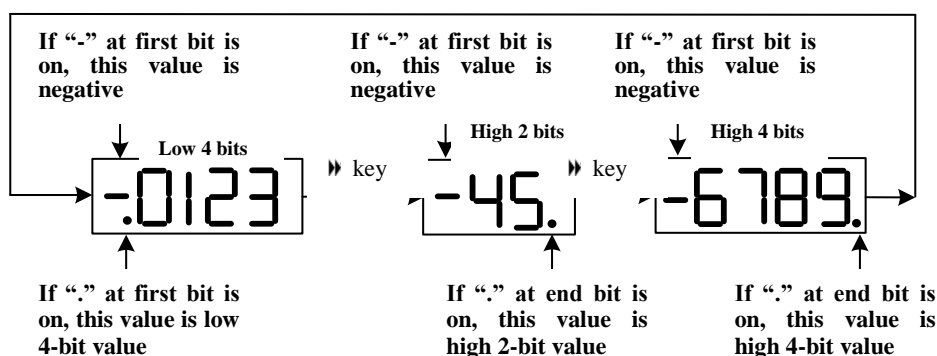


For example, 23456789 are displayed as follows:

▶▶ key

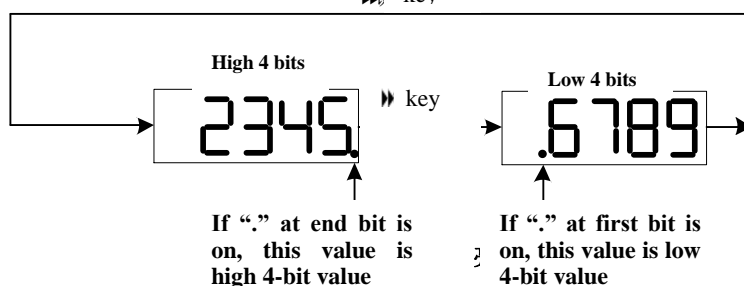

2) Display of Decimal Points

 The “.” of nixie tube of units digit data means decimal point and “.” of units digit is not flickering. For example, 6.789 is displayed as:



4.4 Jog Running


1) Associated function code

Function Code	Name	Range	Set Value	Unit
F1.0.00	Control mode (10: Jog mode)	0~10	10	1
F1.2.03	Speed keyboard setting (as Jog speed)	-3500~3500	100	rpm
F2.0.08	DI1 logic function selection (0: Logic or virtual input VDI1)	0~5	0	1
F2.0.18	Virtual input VDI1 status (equivalent to forced running)	0~1	1	1

Note: Setting of F2.0.08 and F2.0.18 not required if external terminal is used.

2) Operation method

Set F1.0.00 = 10, F2.0.08 = 0 and F2.0.18 = 1 and do jogging according to the diagram below:

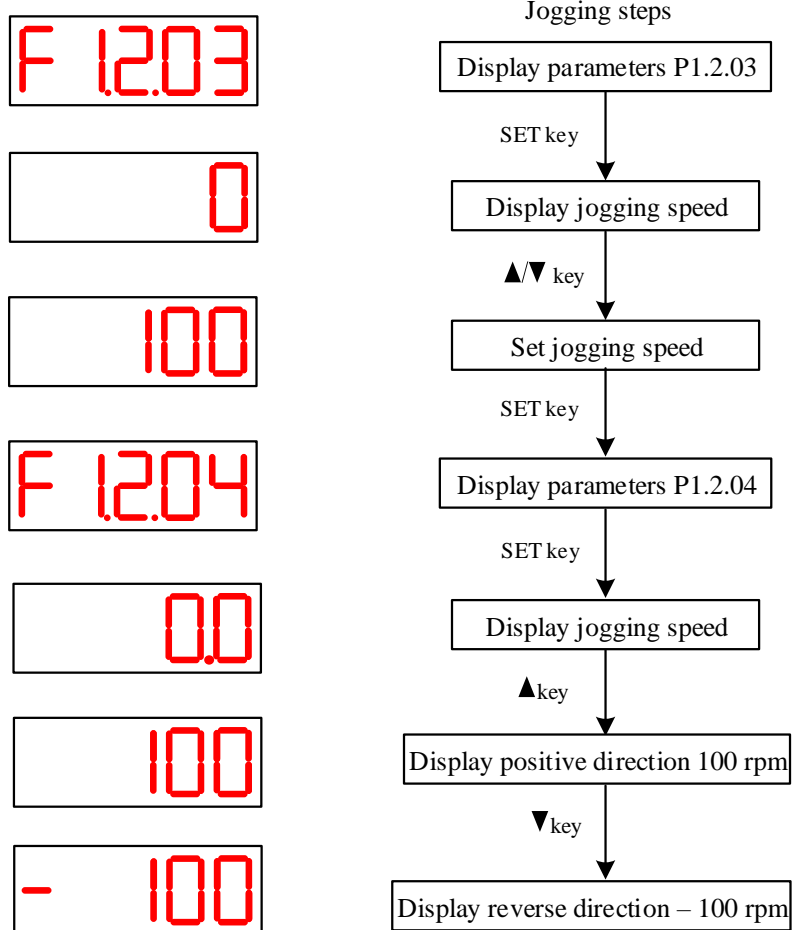

1. Press “▲” or “▼” key to control the motor’s revolving direction; release the key to stop motor revolving.
2. Function code F1.2.03: The set revolving speed of JOG under JOG mode. User can set it as required.
3. Make sure stroke is not exceeding the mechanical limit points if motor is mounted on the Product.

4.5 Test Run of Sr



1) Associated function code

Function Code	Name	Range	Set Value	Unit
F1.0.00	Control mode (0: Sr trial run mode)	0~10	9	1
F2.0.08	DII logic function selection (0: Logic or virtual input VDI1)	0~5	0	1
F2.0.18	Virtual input VDI1 status (equivalent to forced running)	0~1	1	1

Note: Setting of F2.0.08 and F2.0.18 not required if external terminal is used.

2) Operation method

Set F1.0.00 = 9, F2.0.08 = 0 and F2.0.18 = 1 and carry out jogging according to the following diagram:

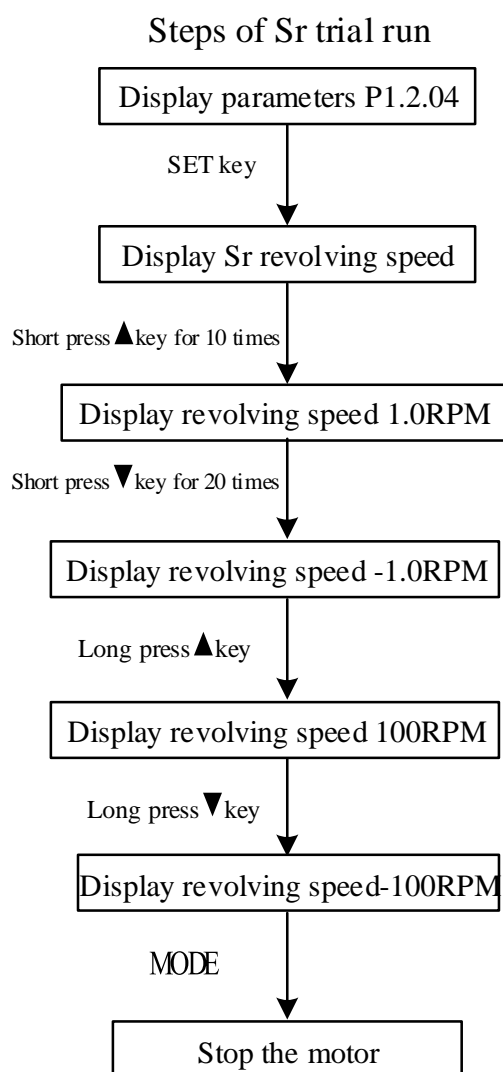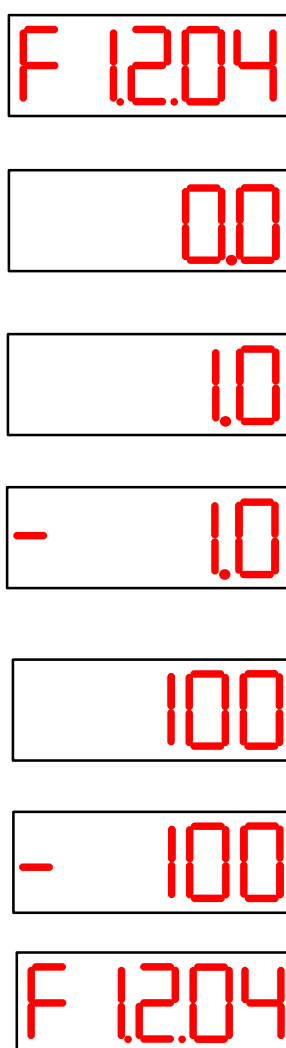


1. Press “▲” or “▼” key to set the revolving speed of motor; release the key and motor will keep revolving at the displayed speed.
2. Function code F1.2.04: The set revolving speed of Sr under Sr mode. User can set it as required.
3. Sr function is not recommended and stroke should not exceed the mechanical limit position if motor is mounted on the Product.

4.6 User Password

Once user password (P6.0.08) function is enabled, the user is authorized to set parameters, while other operators can view the parameters only and unable to modify them.

1) Setting of user password

Setting process and display of user password are shown in diagram below. For example, set password as “12345”.

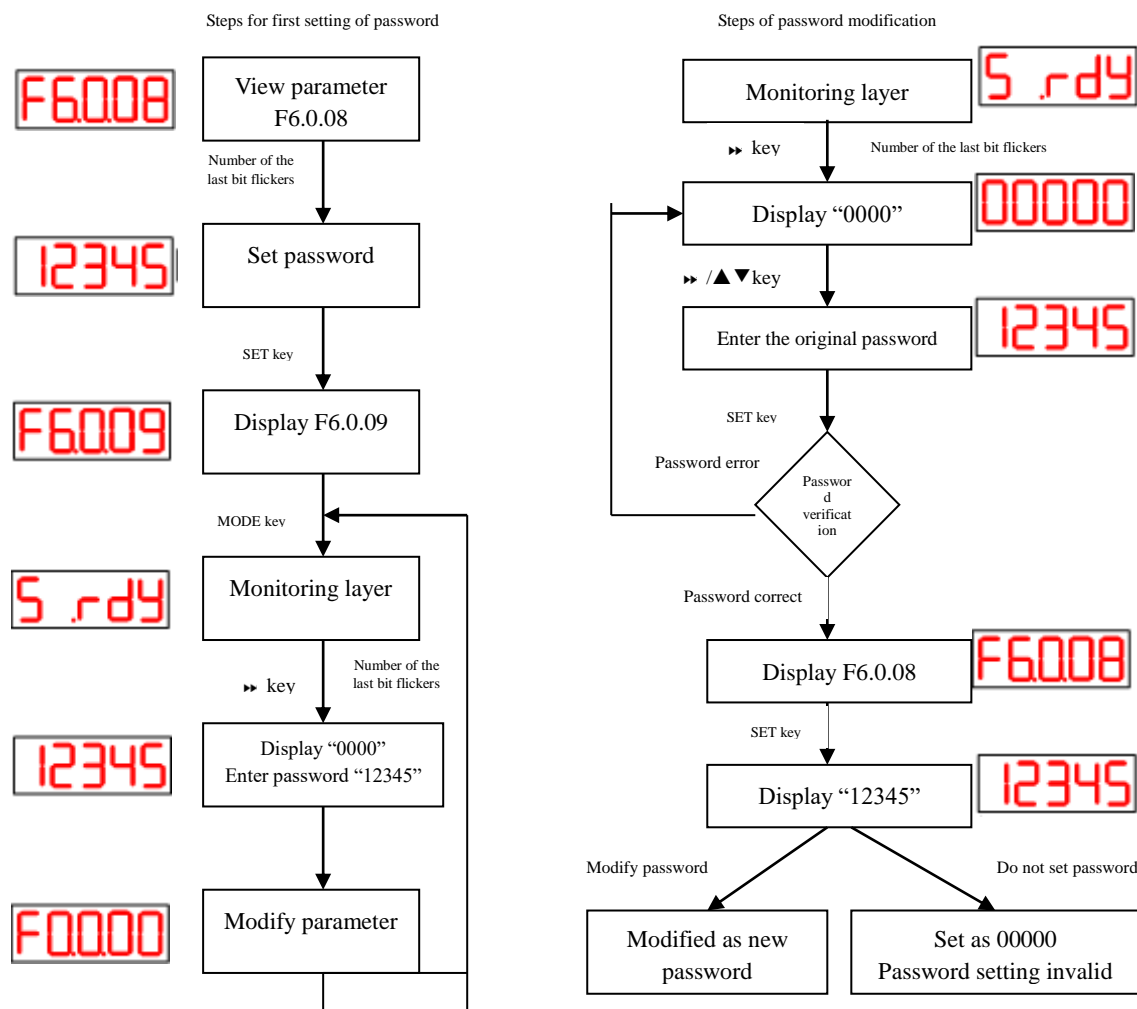

1. Press ►► key under the status or parameter monitoring status and it displays “00000”, which means password protection status is entered; Once password is entered, it means password is wrong if it shows “FAIL”, or password is correct if it shows “done”.
2. First present the present password to enable the parameter setting authority before modifying the user password. Enter F6.0.08 again to set the new password according to the method shown in diagram above.

2) Disable user password

The user needs to firstly enter the user password and set parameter F6.0.08 as “00000” to disable the password.

Chapter 5 Parameter Introduction

Function Group	Group Name
Group F0.0	Motor parameter
Group F1.0	Basic control parameter
Group F1.1	Position control parameter
Group F1.2	Speed control parameter
Group F1.3	Torque control parameter
Group F2.0	Input/output terminal parameter
Group F2.1	Analog quantity parameter
Group F2.2	Calibration parameter
Group F3.0	Internal position control parameter
Group F3.1	Internal speed control parameter
Group F4.0	Gain parameter
Group F4.1	Self-adaption parameter
Group F5.0	Failure protection and handling
Group F5.1	Fault record
Group F6.0	Display control
Group F6.1	Drive information
Group F7.0	User function customization
Group F8.0	Communication parameter
Group F9.0	Basic monitoring

Introduction to Effective Modes:

P: Position control mode

S: Speed control mode

T: Torque control mode

Introduction to Change Limitation:

★ : Read-only register

☆ : Communication modifiable

▲ : Run read-only

● : Re-power enabled

■ : No backup data for power failure

◇ : Unlimited

Introduction to Default Settings:

Motor: Default settings are associated with setting of F0.0.00 only

Model: Default settings are associated with default calibration of drive manufacturer only

5.1 Motor Parameter F0.0

Function Code	Name	Range	Default Value	Unit	Change Limitation	Effective Mode
F0.0.00	Motor No.	H.0000~H.FFFF	*	1	★	PST
F0.0.01	Motor rated power	1~655.35	Motor	kw	★	PST
F0.0.02	Motor rated voltage	1~2000	Motor	V	★	PST
F0.0.03	Motor rated current	1~655.35	Motor	A	★	PST
F0.0.04	Motor rated torque	1~655.35	Motor	N.m	★	PST
F0.0.05	Motor max. torque	1~655.35	Motor	N.m	★	PST
F0.0.06	Motor rated speed	1~9000	Motor	rpm	★	PST
F0.0.18	Enabling of motor parameter setting 0: Disable 1: Enable	0~1	0	1	■	PST

5.2 Basic Control Parameter F1.0

Function Code	Name	Range	Default Value	Unit	Change Limitation	Effective Mode
F1.0.00	Control mode 0: Position mode (PT) 1: Position mode (PR) 2: Speed mode (S) 3: Torque mode (T) 4: Position mode (PT) ↔Speed mode (S) 5: Position mode (PT) ↔Torque mode (T) 6~8: Reserved 9: Sr trial run mode 10: Jog mode	0~10	0	1	▲	PST
F1.0.01	How to determine positive direction 0: Anticlockwise from direction of motor shaft 1: Clockwise from direction of motor shaft	0~1	0	1	▲	PST
F1.0.02	Frequency division output control H.0 0 0 0 A B C D [A] Expansion width of Pulse Z 0: Original width 1~F: A * 6.4us [B] Polarity of Pulse Z 0: Positive polarity 1: Negative polarity [C] Frequency division source 0: Encoder 1: External pulse [D] Frequency division direction 0: Positive 1: Reverse	H.0000~H.9111	H.0000	1	▲	PST
F1.0.03	Pulse count per coil of frequency division output	32~32768	10000	pulse	▲	PST

Function Code	Name	Range	Default Value	Unit	Change Limitation	Effective Mode
F1.0.04	Shutdown mode H.0 0 0 0 A B C D [A] Shutdown under Class 2 fault 0: Free shutdown, free status 0: Zero-speed shutdown, free status [B] Over-travel shutdown mode 0: Zero-speed shutdown, position lock 1: Free shutdown, free status 2: Zero-speed shutdown, free status [C] EMGS emergency shutdown mode 0: Free shutdown, free status 1: Zero-speed shutdown, free status [D] SON(OFF) shutdown mode 0: Free shutdown, free status 1: Zero-speed shutdown, free status	H.000~H.1211	H.0000	1	▲	PST
F1.0.05	SON brake ON delay (brake release delay)	1~1000	1	ms	▲	PST
F1.0.06	Delay of brake output ON to command receiving	1~1000	250	ms	▲	PST
F1.0.07	Static status, delay of brake OFF to motor power-off	1~1000	150	rpm	▲	PST
F1.0.08	Revolving status, revolving speed threshold when brake is OFF	1~3000	30	ms	▲	PST
F1.0.09	Revolving status, delay of brake OFF	1~1000	500	ms	▲	PST
F1.0.10	Revolving status, delay of brake OFF to motor power-off	1~1000	50	%	▲	PST
F1.0.11	Reserved	-	-	-	▲	PST
F1.0.12	Fan control 0: Revolving when running 1: Always on 2: Always off 3: Be revolving based on temperature	0~3	0	1	◇	PST
F1.0.13	Type of absolute type encoder 0: Single-coil absolute encoder 0: Multiple-coil absolute encoder	0~1	0	1	▲●	PST
F1.0.14	The allowed min. brake resistance of drive	1~1000	Model	Ω	▲	PST
F1.0.15	Power of built-in brake resistor	1~65535	Model	W	▲	PST
F1.0.16	Resistance of built-in brake resistor	1~1000	Model	Ω	▲	PST
F1.0.17	Brake resistor selection 0: Enable built-in brake resistor 1: Enable external brake resistor (natural cooling) 2: Enable external brake resistor (strong wind cooling) 3: Disable brake resistor, be fully absorbed by capacitor	0~3	0	1	▲	PST
F1.0.18	Power of external brake resistor	1~65535	Model	W	▲	PST
F1.0.19	Resistance of external brake resistor	F1.0.14~1000	Model	Ω	▲	PST
F1.0.20	Brake enabling rate	0~200	100	%	▲	PST
F1.0.21	Coefficient of heat dispersion of resistor	1~1000	100	%	▲	PST

5.3 Position Control Parameter F1.1

Function Code	Name	Range	Default Value	Unit	Change Limitation	Effective Mode
F1.1.01	Pulse command input mode H.0 0 A B [A] Pulse direction 0: Positive 1: Reverse [B] Pulse mode 0: Pulse + direction 1: Positive pulse sequence CW/CCW 2: orthogonal pulse AB	H.00~H.12	H.00	1	▲●	P
F1.1.02	When pulse count per coil of pulse command is F1.1.02 > 0, the electronic gear from F1.1.04 to F1.1.07 is invalid.	0~107374182 4	0	pulse	●	P
F1.1.04	Numerator 1 of electronic gear ratio	1~32767	1	1	●	P
F1.1.05	Denominator 1 of electronic gear ratio	1~32767	1	1	●	P
F1.1.06	Numerator 2 of electronic gear ratio	1~32767	1	1	●	P
F1.1.07	Denominator 2 of electronic gear ratio	1~32767	1	1	●	P
F1.1.08	Reserved	-	-	-	-	-
F1.1.09	Reserved	-	-	-	-	-
F1.1.10	Low-pass filter coefficient of pulse command	0~2000	0	1	▲	P
F1.1.11	Mean filter coefficient of pulse command	0~2000	0	1	▲	P
F1.1.12	Signal filter coefficient of pulse command	0~1000	10	10ns	●▲	P
F1.1.13	Reserved	-	-	-	-	-
F1.1.14	Clearing of position error 0: Clear position error if servo is OFF and faulty 1: Reserved 2: Reserved	0~2	0	1	▲	P
F1.1.15	Output condition of location completion (COIN) 0: Absolute value of position error is below F1.1.16 1: Absolute value of position error is below F1.1.16 and filtered position command is 0. 2: Absolute value of position error is below F1.1.16 and outputs when position command is 0.	0~2	0	1	▲	P
F1.1.16	Amplitude of location completion	1~65535	10	pulse	▲	P
F1.1.17	Amplitude of location approaching	1~65535	1000	pulse	▲	P
F1.1.18	Switching control of electronic gear ratio (signal GEARSEL) 0: Position pulse command is 0 and lasts for 2.5 ms 1: Real-time switching	0~1	0	1	▲	P

Function Code	Name	Range	Default Value	Unit	Change Limitation	Effective Mode
F1.1.19	Reserved	-	-	-	-	-
F1.1.20	Control over original point return mode H.0000 A B C D [A] Original point stop mode: 0: Upon finishing original point testing, motor is slowed down to the original point 1: Upon finishing original point testing, motor is slowed down towards the moving direction until it is stopped. [B] Original point trigger mode: 0: Disable original point reset function 1: Execute original point reset automatically when powered on 2: Original point reset triggered by SHOM signal input [C] Short-distance motion to reach the original point: 0: Search Pulse Z during original point reset 1: Not returned during original point reset, search Pulse Z 2: Be located at original point of detector or Pulse Z during original point reset (only if X=2,3,4). [D] Type of original point detector and searching direction: 0: Original point reset at positive direction, CCWL as original point 1: Original point reset at reverse direction, CWL as original point 2: Original point reset at positive direction, ORGP as original point 3: Original point reset at reverse direction, ORGP as original point 4: Direct searching of Pulse Z as the original point 5: Reverse revolving and direct searching of Pulse Z as the original point	H.0000~H.1225	H.0000	1	▲	P
F1.1.21	Speed of original pint reset at high speed	0~2000	1000	rpm	▲	P
F1.1.22	Speed of original pint reset at low speed	0~500	50	rpm	▲	P
F1.1.23	Original point offset position (32-bit)	-9999999~9999999	1000	pulse	▲	P

5.4 Speed Control Parameter F1.2

Function Code	Name	Range	Default Value	Unit	Change Limitation	Effective Mode
F1.2.00	Speed source selection 0: Digital quantity (F1.2.03) 1: AL1 2: Reserved 3: Multistage speed	0~4	0		▲	S
F1.2.01	Reserved	-	-	-	-	-
F1.2.02	Reserved	-	-	-	-	-
F1.2.03	Speed keyboard setting	-3500~3500	0	rpm	◇■	S
F1.2.04	Auxiliary speed setting (see 4.4 Jog for details)	-3500.0~3500.0	0	rpm	★☆	S

Function Code	Name	Range	Default Value	Unit	Change Limitation	Effective Mode
F1.2.05	Acceleration period 0	0~30000	25	ms	◇	PST
F1.2.06	Deceleration period 0	0~30000	25	ms	◇	PST
F1.2.07	S smooth acceleration 0	0~10000	0	ms	◇	PST
F1.2.08	S smooth deceleration 0	0~10000	0	ms	◇	PST
F1.2.09	Acceleration period 1	0~30000	50	ms	◇	PST
F1.2.10	Deceleration period 1	0~30000	50	ms	◇	PST
F1.2.11	S smooth acceleration 1	0~10000	0	ms	◇	PST
F1.2.12	S smooth deceleration 1	0~10000	0	ms	◇	PST
F1.2.13	Acceleration period 2	0~30000	100	ms	◇	PST
F1.2.14	Deceleration period 2	0~30000	100	ms	◇	PST
F1.2.15	S smooth acceleration 2	0~10000	0	ms	◇	PST
F1.2.16	S smooth deceleration 2	0~10000	0	ms	◇	PST
F1.2.17	Acceleration period 3	0~30000	150	ms	◇	PST
F1.2.18	Deceleration period 3	0~30000	150	ms	◇	PST
F1.2.19	S smooth acceleration 3	0~10000	0	ms	◇	PST
F1.2.20	S smooth deceleration 3	0~10000	0	ms	◇	PST
F1.2.21	Reserved	-	-	-	-	-
F1.2.22	Max. positive revolving speed	0~6000	3500	rpm	◇	PST
F1.2.23	Max. reverse revolving speed	0~6000	3500	rpm	◇	PST
F1.2.24	Speed limitation source 0: Digital quantity (F1.2.22 and F1.2.23) 1: AL1 (determined by the min. value of F1.2.22 and F1.2.23 at different directions) 2: Reserved 3: Choose F1.2.22 or F1.2.23 as the positive/reserve speed limitation through DI	0~3	0	1	▲	ST
F1.2.25	Reserved	-	-	-	-	-
F1.2.26	Range of fixed-speed revolving at zero	0~6000	10	rpm	◇	S
F1.2.27	Range of motor revolving	0~1000	20	rpm	◇	S
F1.2.28	Speed deviation	0~100	10	rpm	◇	S
F1.2.29	Speed detection threshold	0~6000	1000	rpm	◇	S
F1.2.30	Zero speed detection range	0~6000	10	rpm	◇	S

5.5 Torque Control Parameter F1.3

Function Code	Name	Range	Default Value	Unit	Change Limitation	Effective Mode
F1.3.00	Torque source selection 0: Digital quantity 0 (F1.3.02) 1: Digital quantity 1 (F1.3.03) 2: All 3: Reserved	0~3	1	1	◇	T
F1.3.02	Digital torque set as 0 (No backup data for power failure)	-300.0~300.0	300.0	%	■	T
F1.3.03	Digital torque set as 1 (backup data for power failure)	-300.0~300.0	300.0	%	◇	T
F1.3.04	Limitation of internal torque at positive direction	0~300.0	300.0	%	◇	PST
F1.3.05	Limitation of internal torque at reverse direction	0~300.0	300.0	%	◇	PST
F1.3.06	Limitation of external torque at positive direction	0~300.0	300.0	%	◇	PST
F1.3.07	Limitation of external torque at reverse direction	0~300.0	300.0	%	◇	PST
F1.3.08	Torque limitation source 0: Limitation of internal positive/negative torque 1: Limitation of external positive/negative torque 2: All as limitation of positive/negative torque 3: Reserved 4: Choose limitation of external positive/negative torque and the min. value of AL1 as torque limitation (through TLLM and TRLM) 5: Reserved 6: Choose limitation of internal positive/negative torque and AL1 as torque limitation (through TLLM and TRLM) 7: Reserved	0~7	0	1	◇	PST
F1.3.10	Set torque type 0: 2-way limitation 1: Limitation at positive direction 2: Limitation at negative direction	0~2	0	1	◇	T
F1.3.11	Filtering of feedback current display	0~3000	10	ms	◇	PST
F1.3.12	Limitation of positive revolving speed	0~3000	0	rpm	◇	T
F1.3.13	Limitation of reverse revolving speed	0~3000	0	rpm	◇	T
F1.3.14	Torque reaches the reference value	0.0~300.0	0	%	◇	T
F1.3.15	Torque reaches the valid value	0.0~300.0	20.0	%	◇	T
F1.3.16	Torque reaches the invalid value	0.0~300.0	10.0	%	◇	T
F1.3.17	Control over torque reaching (TTOQ) 0: Basic torque hysteresis F1.3.14~F1.3.16 1: Auto shutdown delay, terminal SON (OFF) reset 2~3: Reserved	0~3	0	1	◇	T
F1.3.18	Torque reaches shutdown delay	0~30000	0	ms	◇	T
F1.3.19	Torque reaches start-up revolving speed	0~4000	10	rpm	◇	T
F1.3.20	Torque reaches revolving stop speed	0~100	1	rpm	◇	T

5.6 Parameters of Input/output Terminal F2.0

Function Code	Name	Range	Default Value	Unit	Change Limitation	Effective Mode
F2.0.00	DI1 function selection (SON) 0: NON no function) 1: SON servo enabling 2: ARST fault reset 3~4: Reserved 5: CMDSWT Multi-stage speed switching of revolving direction 6: CMD1 multi-stage command switching 1 7: CMD2 multi-stage command switching 2 8: CMD3 multi-stage command switching 3 9: CMD4 multi-stage command switching 4 10: M1SWT mode switching 1 11: M2SWT mode switching 2 12: ZCLAMP zero position fixing 13: INHP position command disabling 14: TLLM torque limitation of reverse rotation 15: TRLM torque limitation of positive rotation 16: JOGD jog reverse rotation 17: JOGU jog positive rotation 18: Reserved 19: GEARSEL electronic gear selection 20: TOQDIR torque command direction 21: SPDDIR speed command direction 22: POSDIR position command direction 23: MULPOS internal position command enabling (rising edge) 24: ORGP original point detection 25: SHOM enable original point reset 26: CWL reverse rotation limitation bit 27: CCWL positive rotation limitation bit 28: CLRPE clear position deviation 29: CCLR clear register of pulse counter 30: EMGS emergency stop 31: Reserved 32: HOLD pause the internal position control command 33: SPDLRS switch speed limitation source	0~33	1	1	▲	PST
F2.0.01	DI2 function selection (EMGS)	0~33	30	1	▲	PST
F2.0.02	DI3 function selection (CCWL)	0~33	27	1	▲	PST
F2.0.03	DI4 function selection (CWL)	0~33	26	1	▲	PST
F2.0.04	DI5 function selection (CCLR)	0~33	29	1	▲	PST
F2.0.05	DI6 function selection (INHP)	0~33	13	1	▲	PST
F2.0.06	DI7 function selection (TRLM)	0~33	15	1	▲	PST
F2.0.07	DI8 function selection (TLLM)	0~33	14	1	▲	PST

Function Code	Name	Range	Default Value	Unit	Change Limitation	Effective Mode
F2.0.08	DI1 logic function selection 0: Logic or virtual input VDI1 (F2.0.18) 1: Logic or virtual input VDI1 (F2.0.18) 2: Logic XOR virtual input VDI1 (F2.0.18) 3: Logic or virtual input DI3 (DI3 function selection NON) 4: Logic and input DI3 (DI3 function selection NON) 5: Logic XOR virtual input DI3 (DI3 function selection NON)	0~5	0	1	▲	PST
F2.0.09	DI2 logic function selection 0: Logic or virtual input VDI2 (F2.0.19) 1: Logic and virtual input F2.0.19 (F2.0.19) 2: Logic XOR virtual input VI2 (F2.0.19) 3: Logic or input DI4 (DI4 function selection NON) 4: Logic and input DI4 (DI4 function selection NON) 5: Logic XOR input DI4 (DI4 function selection NON)	0~5	0	1	▲	PST
F2.0.10	DI1 function property H.0 0 0 A B C [A] Filtering time selection 0~3: Filtering time 0~3 (F2.0.20~F2.0.23) [B] Delay time selection 0~3: Delay time 0~3(F2.0.24~F2.0.27) [C] Terminal logic 0: Positive logic 1: Negative logic	H.000~H.331	H.000	1	◇	PST
F2.0.11	DI2 function property	H.000~H.331	H.000	1	◇	PST
F2.0.12	DI3 function property	H.000~H.331	H.000	1	◇	PST
F2.0.13	DI4 function property	H.000~H.331	H.000	1	◇	PST
F2.0.14	DI5 function property	H.000~H.331	H.000	1	◇	PST
F2.0.15	DI6 function property	H.000~H.331	H.000	1	◇	PST
F2.0.16	DI7 function property	H.000~H.331	H.000	1	◇	PST
F2.0.17	DI7 function property	H.000~H.331	H.000	1	◇	PST
F2.0.18	Virtual input of VDI1 status	0~1	0	1	■	PST
F2.0.19	Virtual input of VDI2 status	0~1	0	1	■	PST
F2.0.20	DI filtering time 0	0~1000	10	ms	◇	PST
F2.0.21	DI filtering time 1	0~1000	10	ms	◇	PST
F2.0.22	DI filtering time 2	0~1000	10	ms	◇	PST
F2.0.23	DI filtering time 3	0~1000	10	ms	◇	PST
F2.0.24	DI delay time 0	0~10000	5	ms	◇	PST
F2.0.25	DI delay time 1	0~10000	5	ms	◇	PST

Function Code	Name	Range	Default Value	Unit	Change Limitation	Effective Mode
F2.0.26	DI delay time 2	0~10000	5	ms	◇	PST
F2.0.27	DI delay time 3	0~10000	5	ms	◇	PST
F2.0.28	DO1 function selection (SRDY) 0: NON no function 1: SRDY servo preparation 2: SVON servo enabling 3: ZSPD zero speed detection 4: VCMP speed consistency output 5: COIN location completion output 6: NEAR location approaching output 7: TQL torque limitation output 8: VLT speed limitation output 9: BRK servo brake output 10: ALRM servo alarm output 11: WARN servo alarm output 12: HOME output of original point reset completion 13: TSPD speed reaching output 14: TTOQ torque reaching output 15: ANG initial angle identification completion 16: TGON motor revolving output 17: VARR speed detection 18: ZPHD zero positioning fixing output 19: MOD0 current running mode 0 of servo 20: MOD1 current running mode 1 of servo 21: MOD2 current running mode 2 of servo 22: MOD3 current running mode 3 of servo	0~22	1	1	▲	PST
F2.0.29	DO2 function selection (ALRM)	0~22	10	1	▲	PST
F2.0.30	DO3 function selection (TTOQ)	0~22	14	1	▲	PST
F2.0.31	DO4 function selection (BRK)	0~22	9	1	▲	PST
F2.0.33	DO1 property configuration H.0 0 A B [A] Delay time selection 0~3: Delay time 0~3 (F2.0.38~F2.0.41) [B] Terminal logic 0: Positive logic 1: Negative logic	H.00~H.31	H.00	1	◇	PST
F2.0.34	DO2 property configuration	H.00~H.31	H.00	1	◇	PST
F2.0.35	DO3 property configuration	H.00~H.31	H.00	1	◇	PST
F2.0.36	DO4 property configuration	H.00~H.31	H.00	1	◇	PST
F2.0.38	DO delay time 0	0~10000	5	ms	◇	PST
F2.0.39	DO delay time 1	0~10000	5	ms	◇	PST
F2.0.40	DO delay time 2	0~10000	5	ms	◇	PST
F2.0.41	DO delay time 3	0~10000	5	ms	◇	PST

5.7 Analog Quantity Parameter F2.1

Function Code	Name	Range	Default Value	Unit	Change Limitation	Effective Mode
F2.1.00	AI1 offset	-5.000~5.000	0	V	◇	PST
F2.1.01	AI1 filter coefficient	0~2000.0	2.0	ms	◇	PST
F2.1.02	AI1 dead zone + (positive)	0~5.000	0.006	V	◇	PST
F2.1.03	AI1 dead zone - (negative)	-5.000~0	-0.006	V	◇	PST
F2.1.04	AI1 zero drift voltage	-5.000~5.000	0	V	◇	PST
F2.1.05	Zero drift function selection H.0 0 A B [A] Function mode 0: Mode 0 1: Mode 1 [B] Startup mode 0: No calibration 1: Single keyboard/communication 2: Power-on delay 1 (delay 0.5s) 3: Power-on delay 2 (delay 1.0s) 4: Power-on delay 3 (delay 1.5s) 5: Power-on delay 4 (delay 2.0s)	H.00~H.15	H.00	1	▲●	PST
F2.1.06	Speed corresponds to 10V analog input	-6000~6000	3000	rpm	◇	PST
F2.1.07	Torque corresponds to 10V analog input	-500.0~500.0	100.0	%	◇	PST
F2.1.08	Setting of AO1 analog output 0: Motor revolving speed (1V: 1,000 rpm) 1: Speed command (1V: 1,000 rpm) 2: Torque command (1V: 100% rated) 3: Position deviation (0.05V: 1 pulse) 4: Pulse command frequency (0.01V: 1kHz) 5: AI1 voltage 6: Reserved 7: Output current (0.01V: 1A) 8: Busbar voltage (1V: 100V) 9: AO1 number setting (F2.1.09)	0~10	0	1	◇	PST
F2.1.09	AO1 number setting	-9.999~9.999	0.000	V	■	PST
F2.1.10	AO1 output offset	-10.00~10.00	0.00	V	◇	PST
F2.1.11	AO1 output gain	-10.00~10.00	1.00	Times	◇	PST

5.8 Calibration Parameter F2.2

Function Code	Name	Range	Default Value	Unit	Change Limitation	Effective Mode
F2.2.00	AI1 measured value 1	-9.999~9.999	-8.000	V	◇	PST
F2.2.01	AI1 displayed value 1	-9.999~9.999	-8.000	V	◇	PST
F2.2.02	AI1 measured value 2	-9.999~9.999	8.000	V	◇	PST
F2.2.03	AI1 displayed value 2	-9.999~9.999	8.000	V	◇	PST
F2.2.04	AO1 measured value 1	-9.999~9.999	0.000	V	◇	PST
F2.2.05	AO1 target value 1	-9.999~9.999	0.000	V	◇	PST
F2.2.06	AO1 measured value 2	-9.999~9.999	8.000	V	◇	PST
F2.2.07	AO1 target value 2	-9.999~9.999	8.000	V	◇	PST

5.9 Internal Position Control Parameter F3.0

Function Code	Name	Range	Default Value	Unit	Change Limitation	Effective Mode
F3.0.00	Internal position control mode 0: Shut down at completion of single running 1: Maintain at completion of single running 2: Constant circulating (reset position enabling 0) 3: Maintain N times of circulating 4: Switch DI terminal	0~4	1	1	▲	P
F3.0.01	Circulation times under circulating mode	1~65535	1	1	▲	P
F3.0.02	Number of valid segments	1~8	1	1	▲	P
F3.0.03	Number of initial segments since the first round	1~8	1	1	▲	P
F3.0.04	Internal position control word H.0 0 0 A B C [A] Maintenance unit of completion time 0: ms 1: s [B] Position disconnection and restart 0: Continue running of unfinished segment 1: Restart [C] Position command type 0: Relative position 1: Absolute position (SON enabling at zero position)	H.000~H.111	H.000	1	▲	P
F3.0.05	Pulse at zero position (effective at absolute position)	0~65535	0	pulse	▲	P
F3.0.06	Number of turns at zero position (effective at absolute position)	0~65535	0	turn	▲	P
Total number (of pulse) at the absolute position of zero point = (F3.0.06×F1.1.02) + F3.0.05;						
F3.0.07	Pulse in the 1 st segment	0~65535	0	pulse	◇	P
F3.0.08	Number of turns in the 1 st segment	0~65535	0	turn	◇	P
Total number (of pulse) in the 1 st segment = (F3.0.08×F1.1.02) + F3.0.07;						
F3.0.09	Running speed of the 1 st segment	-3500~3500	0	rpm	◇	P
F3.0.10	Selection of curve in the 1 st segment 0: Curve 0, from F1.2.05~F1.2.08 1: Curve 1, from F1.2.09~F1.2.12 2: Curve 2, from F1.2.13~F1.2.16 3: Curve 3, from F1.2.17~F1.2.20	0~3	0	0	◇	P
F3.0.11	Maintenance period at the completion of the 1 st segment (F3.0.04 [A])	0~65535	10	ms/s	◇	P
F3.0.12	Pulse in the 2 nd segment	0~65535	0	pulse	◇	P
F3.0.13	Number of coil in the 2 nd segment	0~65535	0	turn	◇	P
F3.0.14	Running speed of the 2 nd segment	-3500~3500	0	rpm	◇	P
F3.0.15	Selection of curve in the 2 nd segment	0~3	0	0	◇	P
F3.0.16	Maintenance period at the completion of the 2 nd segment	0~65535	10	ms/s	◇	P
F3.0.17	Pulse in the 3 rd segment	0~65535	0	pulse	◇	P
F3.0.18	Number of turns in the 3 rd segment	0~65535	0	turn	◇	P

Function Code	Name	Range	Default Value	Unit	Change Limitation	Effective Mode
F3.0.19	Running speed of the 3 rd segment	-3500~3500	0	rpm	◇	P
F3.0.20	Selection of curve in the 3 rd segment	0~3	0	0	◇	P
F3.0.21	Maintenance period at the completion of the 3 rd segment	0~65535	10	ms/s	◇	P
F3.0.22	Pulse in the 4 th segment	0~65535	0	pulse	◇	P
F3.0.23	Number of turns in the 4 th segment	0~65535	0	turn	◇	P
F3.0.24	Running speed of the 4 th segment	-3500~3500	0	rpm	◇	P
F3.0.25	Selection of curve in the 4 th segment	0~3	0	0	◇	P
F3.0.26	Maintenance period at the completion of the 4 th segment	0~65535	10	ms/s	◇	P
F3.0.27	Pulse in the 5 th segment	0~65535	0	pulse	◇	P
F3.0.28	Number of turns in the 5 th segment	0~65535	0	turn	◇	P
F3.0.29	Running speed of the 5 th segment	-3500~3500	0	rpm	◇	P
F3.0.30	Selection of curve in the 5 th segment	0~3	0	0	◇	P
F3.0.31	Maintenance period at the completion of the 5 th segment	0~65535	10	ms/s	◇	P
F3.0.32	Pulse in the 6 th segment	0~65535	0	pulse	◇	P
F3.0.33	Number of turns in the 6 th segment	0~65535	0	turn	◇	P
F3.0.34	Running speed of the 6 th segment	-3500~3500	0	rpm	◇	P
F3.0.35	Selection of curve in the 6 th segment	0~3	0	0	◇	P
F3.0.36	Maintenance period at the completion of the 6 th segment	0~65535	10	ms/s	◇	P
F3.0.37	Pulse in the 7 th segment	0~65535	0	pulse	◇	P
F3.0.38	Number of turns in the 7 th segment	0~65535	0	turn	◇	P
F3.0.39	Running speed of the 7 th segment	-3500~3500	0	rpm	◇	P
F3.0.40	Selection of curve in the 7 th segment	0~3	0	0	◇	P
F3.0.41	Maintenance period at the completion of the 7 th segment	0~65535	10	ms/s	◇	P
F3.0.42	Pulse in the 8 th segment	0~65535	0	pulse	◇	P
F3.0.43	Number of turns in the 8 th segment	0~65535	0	turn	◇	P
F3.0.44	Running speed of the 8 th segment	-3500~3500	0	rpm	◇	P
F3.0.45	Selection of curve in the 8 th segment	0~3	0	0	◇	P
F3.0.46	Maintenance period at the completion of the 8 th segment	0~65535	10	ms/s	◇	P

5.10 Internal Speed Control Parameter F3.1

Function Code	Name	Range	Default Value	Unit	Change Limitation	Effective Mode
F3.1.00	Speed control mode 0: Shut down at completion of single running 1: Maintain at completion of single running 2: Constant circulating N times of circulating 4: Switch DI terminal	0~4	1	1	▲	S
F3.1.01	Circulation times (valid when F3.1.00 is 3)	1~65535	1	1	▲	S
F3.1.02	Unit of speed and running period 0: 0.1 s 1: 0.1 min	0~1	0	1	▲	S
F3.1.04	Speed command of the 1 st segment	-3500~3500	0	rpm	◇	S

Function Code	Name	Range	Default Value	Unit	Change Limitation	Effective Mode
F3.1.05	Running period of the 1 st segment Time unit is determined by (F3.1.02)	0~6553.5	0	s/min	◇	S
F3.1.06	Selection of curve in the 1 st segment 0: Curve 0, from F1.2.05~F1.2.08 1: Curve 1, from F1.2.09~F1.2.12 2: Curve 2, from F1.2.13~F1.2.16 3: Curve 3, from F1.2.17~F1.2.20	0~3	0	1	◇	S
F3.1.07	Speed command of the 2 nd segment	-3500~3500	0	rpm	◇	S
F3.1.08	Running time of the 2 nd segment	0~6553.5	0	s/min	◇	S
F3.1.09	Selection of curve in the 2 nd segment	0~3	0	1	◇	S
F3.1.10	Speed command of the 3 rd segment	-3500~3500	0	rpm	◇	S
F3.1.11	Running time of the 3 rd segment	0~6553.5	0	s/min	◇	S
F3.1.12	Selection of curve in the 3 rd segment	0~3	0	1	◇	S
F3.1.13	Speed command of the 4 th segment	-3500~3500	0	rpm	◇	S
F3.1.14	Running time of the 4 th segment	0~6553.5	0	s/min	◇	S
F3.1.15	Selection of curve in the 4 th segment	0~3	0	1	◇	S
F3.1.16	Speed command of the 5 th segment	-3500~3500	0	rpm	◇	S
F3.1.17	Running time of the 5 th segment	0~6553.5	0	s/min	◇	S
F3.1.18	Selection of curve in the 5 th segment	0~3	0	1	◇	S
F3.1.19	Speed command of the 6 th segment	-3500~3500	0	rpm	◇	S
F3.1.20	Running time of the 6 th segment	0~6553.5	0	s/min	◇	S
F3.1.21	Selection of curve in the 6 th segment	0~3	0	1	◇	S
F3.1.22	Speed command of the 7 th segment	-3500~3500	0	rpm	◇	S
F3.1.23	Running time of the 7 th segment	0~6553.5	0	s/min	◇	S
F3.1.24	Selection of curve in the 7 th segment	0~3	0	1	◇	S
F3.1.25	Speed command of the 8 th segment	-3500~3500	0	rpm	◇	S
F3.1.26	Running time of the 8 th segment	0~6553.5	0	s/min	◇	S
F3.1.27	Selection of curve in the 8 th segment	0~3	0	1	◇	S

5.11 Gain Parameter F4.0

Function Code	Name	Range	Default Value	Unit	Change Limitation	Effective Mode
F4.0.00	Position loop gain 1 Increase positional responsiveness and reduce position control error when position gain increases. However, excessive gain may lead to vibration and noise.	0~3000	30	1/s	◇	P
F4.0.01	Speed gain 1 Increase speed responsiveness when position gain increases. However, excessive gain may lead to vibration and noise.	0~3000	50	Hz	◇	PST
F4.0.02	Speed integral 1 Increase speed responsiveness when speed integral increases. However, low speed integral may lead to vibration and noise.	20~10000	1500	0.01ms	◇	PST
F4.0.03	Torque command filtering 1	0~5000	20	0.01ms	◇	PST
F4.0.04	Position loop gain 2	0~3000	30	1/s	◇	P
F4.0.05	Speed integral 2	0~3000	50	Hz	◇	PST
F4.0.06	Speed integral 2	20~10000	2000	0.01ms	◇	PST

Function Code	Name	Range	Default Value	Unit	Change Limitation	Effective Mode
F4.0.07	Torque command filtering 2	0~5000	40	0.01ms	◇	PST
F4.0.08	Reserved	-	-	-	-	-
F4.0.09	Enabling of speed feedforward 0: Disabled 1: Enabled	0~1	0	1	◇	P
F4.0.10	Filtering period of speed feedforward	0~65535	50	0.01ms	◇	P
F4.0.11	Speed feedforward gain For any smooth variation of control command, increase gain to improve the speed following error. For any unsmooth variation of speed control command, decrease the gain to reduce the vibration of mechanism running.	0~200	0	%	◇	P
F4.0.12	Enabling of torque feedforward	0~1	0	1	◇	PST
F4.0.13	Filtering time of torque feedforward	0~65535	50	0.01ms	◇	PST
F4.0.14	Torque feedforward gain	0~200	0	%	◇	PST
F4.0.15	Speed command filtering	0~5000	20	0.01ms	◇	PST
F4.0.16	Speed feedback filtering	0~5000	0	0.01ms	◇	PST
F4.0.17	Reserved	-	-	-	-	-
F4.0.18	Torque feedback filtering	0~5000	0	0.01ms	◇	PST
F4.0.19	Feedback filtering of speed source 1	0~65535	50	0.01ms	◇	PST
F4.0.20	Gain switching control 0: No switching, from the first gain 1: High/low speed switching 2: Speed threshold	0~5	0	1	◇	PST
F4.0.21	Gain switching level	0~65535	40	1	◇	PST
F4.0.22	Gain switching difference	0~65535	20	1	◇	PST
F4.0.23	Delay time of gain switching	0~65535	5	ms	▲	PST
F4.0.24	Lasting time of gain switching	0~65535	3	ms	▲	PST
F4.0.25	Control coefficient of pseudo differential feedforward	0.0~100.0	100.0	%	◇	PS

5.12 Self-adaption Parameter F4.1

Function Code	Name	Range	Default Value	Unit	Change Limitation	Effective Mode
F4.1.00	Reserved	-	-	-	-	-
F4.1.01	Reserved	-	-	-	-	-
F4.1.02	Reserved	-	-	-	-	-
F4.1.03	Enabling of offline inertia identification mode 0: Disabling 1: Enabling	0~1	0	1	0	PST
F4.1.04	Number of motor coils at completion of single identification	0~1000.0	1.5	turn	◇	PST
F4.1.05	Max. speed of inertia identification	300~2000	600	rpm	◇	PST
F4.1.06	Interval of offline inertia identification	0~65535	1000	ms	◇	PST

Function Code	Name	Range	Default Value	Unit	Change Limitation	Effective Mode
F4.1.07	Acceleration/deceleration time of offline inertia identification	50~65535	150	ms	◇	PST
F4.1.08	Reserved	-	-	-	-	-
F4.1.09	Reserved	-	-	-	-	-
F4.1.10	Reserved	-	-	-	-	-
F4.1.11	Inertia ratio	0~655.35	1.0	1	1	PST
F4.1.12	Enabling of position identification (0: Disabled, 1: Enabled)	0~1	0	1	1	PST

5.13 Fault Protection and Troubleshooting F5.0

Function Code	Name	Range	Default Value	Unit	Change Limitation	Effective Mode
F5.0.00	Enabling of motor overload protection (0: Disabled, 1: Enabled)	0~1	1	1	▲●	PST
F5.0.01	Motor overload protection coefficient	0~200	100	%	▲●	PST
F5.0.02	Motor overload alarm coefficient	50~100	80	%	▲●	PST
F5.0.03	Motor overspeed level	0~200	120	%	▲●	PST
F5.0.04	Motor overspeed time	0~6000	20	ms	▲●	PST
F5.0.05	Enabling of out-of-tolerance position (0: Disabled; 1: Enabled)	0~1	1	1	▲●	PST
F5.0.06	Out-of-tolerance level of position Number of pulse per revolution of motor ×F5.0.06 (number of turns)	0~655.35	4.00	turn	▲●	PST
F5.0.07	Out-of-tolerance level of revolving speed	1~20000	6000	rpm	▲●	PST
F5.0.08	Out-of-tolerance detection time of revolving speed	0~6000	20	ms	▲●	PST
F5.0.09	Open-phase protection of input (0: Disabled; 1: Enabled)	0~1	Machine type	1	▲●	PST
F5.0.10	Open-phase protection of output (0: Disabled; 1: Enabled)	0~1	0	1	▲●	PST
F5.0.11	Overvoltage coefficient	0~200	100	%	▲●	PST
F5.0.12	Overvoltage time	1~65535	1	ms	▲●	PST
F5.0.13	Undervoltage coefficient	0~200	100	%	▲●	PST
F5.0.14	Undervoltage time	1~65535	100	ms	▲●	PST
F5.0.15	Brake on coefficient	0~200	118	%	▲●	PST
F5.0.16	Brake off coefficient	0~200	113	%	▲●	PST
F5.0.17	Speed loop and protection time	0~65535	10000	ms	▲●	PST
F5.0.18	Brake protection time	0~65535	1.6	s	▲●	PST

5.14 Fault Records F5.1

Function Code	Name	Range	Default Value	Unit	Change Limitation	Effective Mode
F5.1.00	Code of the 1 st fault	-	Err--	1	★	-
F5.1.01	Code of the 2 nd fault	-	Err--	1	★	-
F5.1.02	Code of the 3 rd fault	-	Err--	1	★	-
F5.1.03	Speed 1 at faulty condition	-9000~9000	-	rpm	★	-
F5.1.04	Current 1 at faulty condition	0~655.35	-	A	★	-
F5.1.05	Busbar voltage 1 at faulty condition	0~2000	-	V	★	-
F5.1.06	DI input status 1 at faulty condition (display is the same with F9.0.19)	-	-	1	★	-
F5.1.07	DO output status 1 at faulty condition (display is the same with F9.0.20)	-	-	1	★	-

Function Code	Name	Range	Default Value	Unit	Change Limitation	Effective Mode
F5.1.09	Power-on time 1 at faulty condition	0~65535	-	h	★	-
F5.1.10	Running time 1 at faulty condition	0~65535	-	h	★	-
F5.1.11	Speed 2 at faulty condition	-9000~9000	-	rpm	★	-
F5.1.12	Current 2 at faulty condition	0~655.35	-	A	★	-
F5.1.13	Busbar voltage 2 at faulty condition	0~2000	-	V	★	-
F5.1.14	DI input status 2 at faulty condition (display is the same with F9.0.19)	-	-	1	★	-
F5.1.15	DO output status 2 at faulty condition (display is the same with F9.0.20)	-	-	1	★	-
F5.1.17	Power-on time 2 at faulty condition	0~65535	-	h	★	-
F5.1.18	Running time 2 at faulty condition	0~65535	-	h	★	-
F5.1.19	Speed 3 at faulty condition	-9000~9000	-	rpm	★	-
F5.1.20	Current 3 at faulty condition	0~655.35	-	A	★	-
F5.1.21	Busbar voltage 3 at faulty condition	0~2000	-	V	★	-
F5.1.22	DI input status 3 at faulty condition (display is the same with F9.0.19)	-	-	1	★	-
F5.1.23	DO output status 3 at faulty condition (display is the same with F9.0.20)	-	-	1	★	-
F5.1.25	Power-on time 3 at faulty condition	0~65535	-	h	★	-
F5.1.26	Running time 3 at faulty condition	0~65535	-	h	★	-

5.15 Display Control Parameter F6.0

Function Code	Name	Range	Default Value	Unit	Change Limitation	Effective Mode
F6.0.00	Display mode 0: Basic mode (FX.X.XX) 1: User mode (uX.X.XX) 2: Calibration mode (cX.X.XX)	0~2	0	1	◇	PST
F6.0.01	Selection of parameter group display H. 0 0 0 A B C [A] Calibration group 0: Display calibration group parameter 1: Display calibration group parameter [B] User Group F7 0: Do not display Group F7 1: Display Group F7 [C] Password group 0: Do not display password group 1: Display password group	H.000~H.111	H.000	1	◇	PST
F6.0.02	Monitoring value 1 (see 4.2.2)	0~17	0	1	●	PST

Function Code	Name	Range	Default Value	Unit	Change Limitation	Effective Mode
F6.0.06	Parameter initialization 9: Recover the default setting, except for password group, motor group, calibration group, fault information group, display control group and drive information group. 19: Recover the default setting, except for password group, motor group and equipment information group (this code is not recommended for customer). Enter the values above, display “rdy”, “-----” for several seconds and followed by “done”, which means recovery is done.	0~999	0	1	▲	PST
F6.0.07	Limitation of parameter change 0: Modifiable 1: Unmodifiable	0~1	0	1	◇	PST
F6.0.08	User password	0~65535	0	1	◇	PST

5.16 Drive Information F6.1

Function Code	Name	Range	Default Value	Unit	Change Limitation	Effective Mode
F6.1.00	Accumulative running time	0~65535	0	h	★	PST
F6.1.01	Accumulative power-on time	0~65535	0	h	★	PST
F6.1.02	Reserved	0~65535	-	-	★	PST
F6.1.03	Version No.	-	-	1	★	PST
F6.1.04	Supplementation of version No.	-	-	1	★	PST
F6.1.05	FPAG version No.	-	-	1	★	PST
F6.1.06	Version No. of expansion board	-	-	1	★	PST
F6.1.07	Version No. of user	-	-	1	★	PST
F6.1.08	Reserved	-	-	-	★	PST
F6.1.09	Fault code	Err---Err99	Err--	1	★	PST

5.17 User Function Customization F7.0



Function Code	Name	Range	Default Value	Unit	Change Limitation	Effective Mode
F7.0.00	User function 0	u0.0.00~u9.7.99	u6.0.00	1	★	PST
F7.0.01	User function 1	u0.0.00~u9.7.99	u1.0.00	1	◇	PST
F7.0.02	User function 2	u0.0.00~u9.7.99	u2.0.00	1	◇	PST
F7.0.03	User function 3	u0.0.00~u9.7.99	uF.F.FF	1	◇	PST
F7.0.04	User function 4	u0.0.00~u9.7.99	uF.F.FF	1	◇	PST
F7.0.05	User function 5	u0.0.00~u9.7.99	uF.F.FF	1	◇	PST
F7.0.06	User function 6	u0.0.00~u9.7.99	uF.F.FF	1	◇	PST
F7.0.07	User function 7	u0.0.00~u9.7.99	uF.F.FF	1	◇	PST
F7.0.08	User function 8	u0.0.00~u9.7.99	uF.F.FF	1	◇	PST
F7.0.09	User function 9	u0.0.00~u9.7.99	uF.F.FF	1	◇	PST
F7.0.10	User function 10	u0.0.00~u9.7.99	uF.F.FF	1	◇	PST
F7.0.11	User function 11	u0.0.00~u9.7.99	uF.F.FF	1	◇	PST
F7.0.12	User function 12	u0.0.00~u9.7.99	uF.F.FF	1	◇	PST
F7.0.13	User function 13	u0.0.00~u9.7.99	uF.F.FF	1	◇	PST
F7.0.14	User function 14	u0.0.00~u9.7.99	uF.F.FF	1	◇	PST
F7.0.15	User function 15	u0.0.00~u9.7.99	uF.F.FF	1	◇	PST

Function Code	Name	Range	Default Value	Unit	Change Limitation	Effective Mode
F7.0.16	User function 16	u0.0.00~u9.7.99	uF.F.FFF	1	◇	PST
F7.0.17	User function 17	u0.0.00~u9.7.99	uF.F.FFF	1	◇	PST
F7.0.18	User function 18	u0.0.00~u9.7.99	uF.F.FFF	1	◇	PST
F7.0.19	User function 19	u0.0.00~u9.7.99	uF.F.FFF	1	◇	PST
F7.0.20	User function 20	u0.0.00~u9.7.99	uF.F.FFF	1	◇	PST
F7.0.21	User function 21	u0.0.00~u9.7.99	uF.F.FFF	1	◇	PST
F7.0.22	User function 22	u0.0.00~u9.7.99	uF.F.FFF	1	◇	PST
F7.0.23	User function 23	u0.0.00~u9.7.99	uF.F.FFF	1	◇	PST
F7.0.24	User function 24	u0.0.00~u9.7.99	uF.F.FFF	1	◇	PST
F7.0.25	User function 25	u0.0.00~u9.7.99	uF.F.FFF	1	◇	PST
F7.0.26	User function 26	u0.0.00~u9.7.99	uF.F.FFF	1	◇	PST
F7.0.27	User function 27	u0.0.00~u9.7.99	uF.F.FFF	1	◇	PST
F7.0.28	User function 28	u0.0.00~u9.7.99	uF.F.FFF	1	◇	PST
F7.0.29	User function 29	u0.0.00~u9.7.99	uF.F.FFF	1	◇	PST

5.18 Communication Parameter F8.0

Function Code	Name	Range	Default Value	Unit	Change Limitation	Effective Mode
F8.0.00	Communication selection 0: RS-485 1~3: Reserved	0~3	0	1	◇	PST
F8.0.01	RS-485 baud rate 0: 2400bps 1: 4800bps 2: 9600bps 3: 19200bps 4: 38400bps 5: 57600bps	0~5	2	1	◇	PST
F8.0.02	RS-485 data format 0: No calibration (8-N-2) 1: Even parity check (8-E-1) 2: Odd parity check (8-O-1) 3: No calibration (8-N-1)	0~3	0	1	◇	PST
F8.0.03	RS-485 local address (0: Broadcast address)	0~249	1	1	◇	PST
F8.0.04	RS-485 response delay	0~20	1	ms	◇	PST
F8.0.05	RS-485 communication timeout	0~60.0	0	s	◇	PST
F8.0.06	RS-485 selection of communication data transmission format 0: RTU mode 1: Reserved	0~1	0	1	◇	PST
F8.0.07	RS-485 disabling of command reply 0: Reply enabled 1: Reply disabled	0~1	0	1	◇	PST

5.19 Monitoring Parameter F9.0

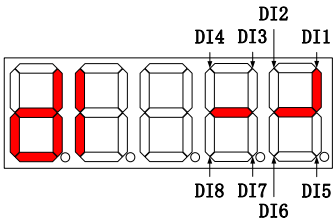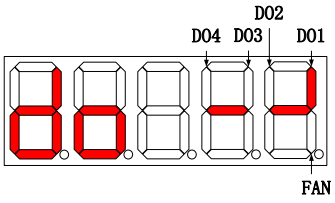
Function Code	Name	Range	Default Value	Unit	Change Limitation	Effective Mode
F9.0.00	Motor revolving speed	-	-	rpm	★	PST
F9.0.01	Revolving speed command	-	-	rpm	★	PST
F9.0.02	Set revolving speed	-	-	rpm	★	PST
F9.0.03	Output torque [% rated]	-	-	%	★	PST
F9.0.04	Set torque [% rated]	-	-	%	★	PST
F9.0.07	Number of motor feedback pulse	-	-	pulse	★	PST
F9.0.08	Number of motor feedback turns	-	-	turn	★	PST
F9.0.09	Total number of command pulse L	-	-	pulse	★	PST
F9.0.10	Total number of command pulse H (*10000)	-	-	pulse	★	PST
F9.0.11	Common pulse frequency	-	-	hz	★	PST
F9.0.12	Difference between command pulse and feedback pulse	-	-	pulse	★	PST
F9.0.13	Mean torque [% rated]	-	-	%	★	PST
F9.0.14	Peak torque [% rated]	-	-	%	★	PST
F9.0.15	Busbar voltage	-	-	V	★	PST
F9.0.16	Module temperature	-	-	°C	★	PST
F9.0.17	AI1 voltage	-	-	V	★	PST
F9.0.19	Input terminal status 	-	-	-	★	PST
Relationship between terminal status and 16-bit binary system: DI8 DI7 DI6 DI5 DI4 DI3 DI2 DI1 Low 8-bit B7 B6 B5 B4 B3 B2 B1 B0 DI8 DI7 DI6 DI5 DI4 DI3 DI2 DI1 High 8-bit B15 B14 B13 B12 B11 B10 B9 B8 When input of Terminal DI and high 8-bit are valid, the corresponding binary system is "1"; otherwise, it is "0"; the corresponding bits of low 8-bit value are reverse to that of high 8-bit value.						
F9.0.20	Output terminal status (FAN-fan) 	-	-	-	★	PST

Function Code	Name	Range	Default Value	Unit	Change Limitation	Effective Mode
Relationship between terminal status and 16-bit binary system:						
FAN D04 D03 D02 D01 Low 8-bit B7 B6 B5 B4 B3 B2 B1 B0 FAN D04 D03 D02 D01 High 8-bit B15 B14 B13 B12 B11 B10 B9 B8						
When output of Terminal DO and high 8-bit are valid, the corresponding binary system is “1”; otherwise, it is “0”; the corresponding bits of low 8-bit value are reverse to that of high 8-bit value.						
F9.0.22	Effective current	-	-	A	★	PST
F9.0.23	Voltage before A11 calibration	-	-	V	★	PST
F9.0.24	Brake protection time	-	-	1	★	PST
F9.0.25	Motor revolving speed (unfiltered)	-	-	rpm	★	PST
F9.0.26	Revolving speed command (post-treatment)	-	-	rpm	★	PST
F9.0.27	Command pulse and revolving speed (with electronic gear ratio)	-	-	rpm	★	PST
F9.0.28	Low motor position (absolute encoder)	-	-	pulse	★	PST
F9.0.29	High motor position (absolute encoder)	-	-	pulse	★	PST
Absolute position of 17-bit encoder = F9029×2 + F9028 % 2; Absolute position of 23-bit encoder = F9029×128 + F9028 % 128;(%: Except for remainder)						
F9.0.30	Revolution times of motor (absolute encoder)	-	-	turn	★	PST
F9.0.31	Reserved	-	-	1	★	PST
F9.0.32	Servo status (see 4.2.2 for details)	-	-	1	★	PST
F9.0.33	Load inertia	-	-	1	★	PST
F9.0.34	Command pulse	-	-	pulse	★	P
F9.0.35	Command pulse filtering value	-	-	pulse	★	P
F9.0.36	A11 register value	-	-	1	★	PST
F9.0.40	Absolute position of motor encoder (32-bit)	-	-	1	★	PST
F9.0.41						
F9.0.42~F9.0.59	Reserved	-	-	-	-	-

Chapter 6 Introduction to RS-485 Communication

6.1 About RS-485 Communication Interface

With RS-232 and RS-485 communication being supported, the Product can realize functions such as parameter modification, parameter query and status monitoring of servo drive with the help of upper computer. RS-485 communication protocol, which supports single-master multi-slave communication mode and networking of multiple servo drives, does not support the networking of multiple servo drives however. Two communication signal connectors (CN3 and CN4) which are the same and provided with internal parallel-connection are adopted.

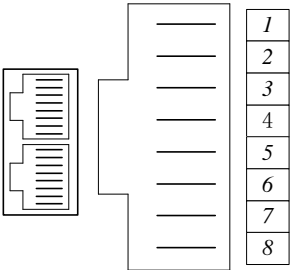Pin No.	Definition	Description	Layout of Terminal Pin (Drive)
1	GNDG	Ground	
2	RS-	RS485 communication port	
3	RS+		
4	GNDG	Ground	
5	GNDG	Ground	
6	Reserved		
7	Reserved		
8	Reserved		
Shell	PE	Shielded	

6.2 Introduction to RS-485 Communication Parameter

Firstly set the “Select communication mode”, “Baud rate”, “Data format” and “Local address” and other communication parameters of the Product before use of communication.

Function Code	Name	Range	Default Value	Unit
F8.0.00	Communication selection 0: RS-485 1~3: Reserved	0~3	0	1
F8.0.01	RS-485 Baud rate 0: 2400bps 1: 4800bps 2: 9600bps 3: 19200bps 4: 38400bps 5: 57600bps	0~5	2	1
F8.0.02	RS-485 data format 0: No calibration (8-N-2) 1: Even parity check (8-E-1) 2: Odd parity check (8-O-1) 3: No calibration (8-N-1)	0~3	0	1

6.3.2 MODBUS RTU Communication Data Structure

Read 16-bit and 32-bit function codes by using command code: read/write 16-bit and 32-bit function code by using the following command codes:

ADR	Slave (servo drive) address Address range of servo drive (001~247), (8-bit hexadecimal number) Note: When address ADR=000H, be effective to all slaves and no message will be sent by any slave (broadcasting method)
CMD	Function code of data packet (06: Write contents of one register 03: Read contents from 1 or multiple registers continuously) (8-bit hexadecimal number) 07: Write contents of 1 register, no data backup for power failure
ADRESS	Sending of master station: Data address (16-bit hexadecimal number) in case of 06 function code, or data initial address (16-bit hexadecimal number) in case of 03 function code Reply of slave station: Data address (16-bit hexadecimal number) in case of 06 function code, or data initial address (8-bit hexadecimal number) in case of 03 function code
DATA	Sending of master station: Data contents (16-bit hexadecimal number) in case of 06 function code, or data number (16-bit hexadecimal number) in case of 03 function code Reply of slave station: Data contents (16-bit hexadecimal number) in case of 06 function code, or data contents (N 8-bit hexadecimal number) in case of 03 function code
CRC	Detection error value (16-bit hexadecimal number)

CRC detection error value, which is adopted in RTU, is calculated according to the following steps:

Step 1: Load a 16-bit register (CRC register) with contents of FFFFH.

Step 2: Carry out XOR calculation to the first byte of communication data and contents in CRC register and store the results in CRC register.

Step 3: Move the contents of CRC register to the lowest significance bit for 1 bit, fill the highest significance bit with 0 and detect the lowest significance bit of CRC register.

Step 4: Carry out XOR calculation to the CRC register and preset values if the lowest significance bit is 1. No action if the lowest significance bit is 0.

Step 5: Repeat the Step 3 and 4 for 8 times and the manipulation of this byte is done.

Step 6: Repeat the Step 2-5 to the next byte of communication data, until manipulation of all bytes is done; the final contents of CRC register are the CRC values. The low bytes will be added and followed by high bytes when transferring CRC value, which means, the low bytes will be transferred firstly.

For any communication error, the slave will reply ADDRESS and DATA as follows:

ADDRESS	DATA	Introduction	ADDRESS	DATA	Introduction
FF01	0001	Invalid address	FF01	0005	Invalid parameter
FF01	0002	CRC calibration error	FF01	0006	Parameter change invalid
FF01	0003	Command read/write error	FF01	0007	System lock
FF01	0004	Password error	FF01	0008	Storing parameters

6.4 Definition of Parameter Address of Communication Protocol

Introduction to Read/Write Address of Function Code Parameter:

The high bits of parameter address are composed of group and level of function code parameter, while the low bits of parameter address are composed of serial number.

EEPROM fails to be stored repeatedly during communication for some of them have limited service life; so, just change the values of RAM instead of storing the function codes into the EEPROM

Take the high-bit address of parameter address as hexadecimal value and convert the low-bit address into hexadecimal value as decimal numeral, in order to write the function codes into EEPROM. Finally, combine the high-bit and low-bit address into a 4-bit hexadecimal value.

For example, the address of F2.1.12 in EEPROM is:

High-bit address is hexadecimal 21, while low-bit address is decimal 12 and converted into hexadecimal 0C. So, the address is expressed as 0x210C.

6.5 Examples

Example 1 Set Revolving Speed of 1# Servo Drive

Set revolving speed of 1# servo drive as 1000 rpm

Method: Decimal 1000 is converted into hexadecimal 03E8H

Host sends data packet

ADR	01H
CMD	06H
ADDRESS	12H
	03H
DATA	03H
	E8H
CRC	7CH
	0CH

Reply data packet

ADR	01H
CMD	06H
ADDRESS	12H
	03H
DATA	03H
	E8H
CRC	7CH
	0CH

Example 2 Query Motor Revolving Speed of 1# Servo Drive

Query the "revolving speed" of 1# servo drive under the running status.

Method: Set the function code parameter of motor revolving speed as P9.0.00 and convert the address as 9000H

If "revolving speed" of 1# servo drive is 1000 rpm, the decimal 1000 will be converted into hexadecimal 03E8H

Host sends data packet

ADR	01H
CMD	03H
ADDRESS	90H
	00H
DATA	00H
	01H
CRC	A9H
	0AH

Reply from slave

ADR	01H
CMD	03H
ADDRESS	02H
DATA	03H
	E8H
CRC	B8H
	FAH

Chapter 7 Troubleshooting

7.1 Fault and Alarm Records

With fault recording function supported, the Product can record the name of the latest 3 faults, as well as the status parameters of the Product when fault or alarm occurs.

View the code of the latest 3 faults or alarms through the monitoring parameter of F5.1.00~F5.1.02. For example, “13” means Err. 13. The parameter shows “Err-- ” if there's no fault.

7.2 Diagnosis and Troubleshooting of Faults of Servo Drive

Fault	Introduction	Description	Troubleshooting
Err01	Hardware overcurrent	Feedback current from any phase is higher than the specified overcurrent point of drive.	<ul style="list-style-type: none"> • Check if the Product's output circuit has short circuit • Check if load has sudden changes; • Check if the motor or the Product has sufficient rated power;
Err05	Signal Z loss	Signal Z loss of incremental encoder	<ul style="list-style-type: none"> • Check if Signal Z is lost due to fault of the encoder; • Check if Signal Z is lost due to poor or wrong wiring;
Err06	Current detection fault	Fault of current detection circuit	<ul style="list-style-type: none"> • Check the current sampling device; • Check the Product;
Err08	Encoder fault 1	Detection fault of incremental encoder	<ul style="list-style-type: none"> • Check if the encoder has wrong wiring; • Check if the encoder's cable is loose; • Check if the encoder's Signal Z is disturbed; • Check if motor encoder has fault;
Err09	Parameter storage fault	Read-write fault of internal storage chip	<ul style="list-style-type: none"> • Check the storage chip of control board
Err10	Zero-drift detection fault	Power-on zero-drift detection fault	<ul style="list-style-type: none"> • Check if there's excessive analog quantity or hardware interface fault at startup
Err11	Undervoltage of main circuit	DC busbar voltage between P \oplus and - is lower than the fault value: Grade 220V: 200V Grade 380V: 380V	<ul style="list-style-type: none"> • Check if wiring terminal is loose • Check if there's instantaneous power failure or unstable power supply • Check if power voltage is dropped in running process • Check if there's open phase • Check if the Product is faulty
Err12	Overvoltage of main circuit	DC busbar voltage between P \oplus and - is over fault value: Grade 220V: 420V Grade 380V: 760V	<ul style="list-style-type: none"> • Check if input voltage of main circuit is too high; • Check if power supply is unstable or under lightning stroke; • Check if resistor fails; • Check if resistance of external resistor is too high; • Check if sampled value of busbar voltage has high deviation • Check if the Product is faulty;
Err13	Motor overspeed	Actual revolving speed of servo motor exceeds the fault threshold.	<ul style="list-style-type: none"> • Check if Phase U, V and W of motor cable are wrong; • Check if Parameter F5.0.03 is wrong; • Check if input command exceeds the threshold of overspeed fault; • Check if motor speed exceeds the limit; • Check if the Product is faulty;

Fault	Introduction	Description	Troubleshooting
Err15	Motor overload protection	Accumulative heat of motor is too high and reaches the fault threshold.	<ul style="list-style-type: none"> ● Check if wiring of motor and encoder is wrong and poor; ● Check if load is too high and there's long-term and continuous running; ● Check if acceleration/deceleration is too frequent or load inertia is too high; ● Check if gain adjustment is proper or rigidity is too high; ● Check if model of the Product or model is set wrongly; ● Check if motor is blocked due to mechanical factor; ● Check if the Product is faulty;
Err16	Integral saturation fault of speed ring	Internal algorithm is saturated	<ul style="list-style-type: none"> ● Check if wiring of motor and encoder is wrong and poor; ● Check if model of the Product or model is set wrongly; ● Check if motor is blocked due to mechanical factor; ● Check if the Product is faulty;
Err17	Open phase of input	Open phase of 3-phase drive	<ul style="list-style-type: none"> ● Check if 3-phase input wiring is poor; ● Check if 3-phase drive is running under single phase; ● Check if 3-phase power is imbalanced or mean value of 3-phase voltage is too low; ● Check if the Product is faulty;
Err18	Open phase of output	The actual phase current of motor is lower than 10% of rated current;	<ul style="list-style-type: none"> ● Check if power wire of motor is disconnected;
Err20	Position feedback fault	Motor running is out of control	<ul style="list-style-type: none"> ● Check if wiring of motor and encoder is wrong and poor; ● Check if gain adjustment is proper or rigidity is too high; ● Check if model of the Product or model is set wrongly; ● Check if the Product is faulty;
Err21	Drive overheat	Temperature of the Product's power module is higher than the over-temperature protection point.	<ul style="list-style-type: none"> ● Check if the ambient temperature is too high; ● Check if there's overload; ● Check if fan is damaged; ● Check if the Product's installation direction and spacing with other servo drives is reasonable; ● Check if the Product is faulty;
Err22	Original point reset timeout	Fail to find the original point within the specified period when recovering the Product's original point.	<ul style="list-style-type: none"> ● Check if the original point switch is faulty; ● Check if the switching signal speed of high-speed original point searching is too low;
Err23	Position deviation is too high	Position deviation is over F5.0.06 under the position control mode.	<ul style="list-style-type: none"> ● Check if the Product's output has open circuit or phase is connected wrongly; ● Check if the Product's output or encoder is d ● Check if motor is blocked due to mechanical factor; ● Check if the Product's gain is too low; ● Check if frequency of input pulse is too high; ● Check if fault value F5.0.06 is too low; ● Check if the Product/motor is faulty;

Fault	Introduction	Description	Troubleshooting
Err24	Speed deviation is too high	Speed deviation is over F5.0.07 and continuously higher than set value of F5.0.08 under the speed control mode.	<ul style="list-style-type: none"> • Check if the Product's output has open circuit or phase is connected wrongly • Check if the Product's output or encoder is disconnected • Check if motor is blocked due to mechanical factor; • Check if the Product's gain is too low • Check if fault value F5.0.07 is too low • Check if the Product/motor is faulty;
Err28	Brake resistor overload	Accumulative heat of the brake resistor is over the set value.	<ul style="list-style-type: none"> • Check if the wiring of external brake resistor is poor or disconnected • Check if cable between P\oplus and D is falling or has open circuit when inspecting the built-in brake resistor • Check if F1.0.17 is selected wrongly when inspecting the external brake resistor • Check if the resistance of external resistor is too high when inspecting the resistance of external resistor • Check if F1.0.19 is higher than the actual resistance of external brake resistor; • Check if the input voltage of main circuit exceeds the specified range; • Check if the ratio between load and rotational inertia is too high; • Check if motor speed is too high; deceleration is finished within the specified deceleration period, and if it is under continuous deceleration status in periodic movement; • Check if the Product or brake resistor's capacity is insufficient; • Check if the Product/motor is faulty;
Err29	Alarm of over stroke at positive direction	Corresponding DI terminals of DI function 27 have valid logic.	<ul style="list-style-type: none"> • Check DI function 27: Disable drive at positive direction and check if terminal logic is valid.
Err30	Alarm of over stroke at reverse direction	Corresponding DI terminals of DI function 26 have valid logic.	<ul style="list-style-type: none"> • Check DI function 26: Disable drive at reverse direction and check if terminal logic is valid.
Err34	CPLD/FPGA initialization fault	-	<ul style="list-style-type: none"> • Please contact our technician.
Err35	CPLD/FPGA internal communication fault	-	<ul style="list-style-type: none"> • Please contact our technician.
Err36	CPLD/FPGA version error	-	<ul style="list-style-type: none"> • Please contact our technician.
Err37	Internal position fault	-	<ul style="list-style-type: none"> • Please contact our technician.
Err97	Battery fault of absolute encoder	-	<ul style="list-style-type: none"> • Please change the encoder's batteries.
Err99	Disconnection fault of absolute encoder	-	<ul style="list-style-type: none"> • Please contact our technician.

Annex 1 Recommended Combination for Servo System

Take 2,500-wire incremental photoelectric encoder of motor as the example of the following combinations. The naming rules for motor S/N:

2,500-wire incremental photoelectric encoder: H.0xxx

17-bit absolute encoder: H.2xxx

23-bit absolute encoder: H.3xxx

Type 2S 220V drive is compatible with 1-phase 220v and 3-phase 220v input. Only 3-phase 220V input is supported by Type 2T drive.

Recommended Combination for 1/3-phase 220V Input of Drive			
Servo Motor		Servo Drive	
Motor S/N	Model	Model	Rated Current (A)
H.0100	CDM-40S-M00130	CDS500-2S016	1.6
H.0101	CDM-40S-M00330		
H.0200	CDM-60S-M00630	CDS500-2S030	3.0
H.0201	CDM-60S-M01330		
H.0202	CDM-60S-M01930		
H.0300	CDM-80S-M01330	CDS500-2S030	3.0
H.0301	CDM-80S-M02430		
H.0302	CDM-80S-M03520		
H.0303	CDM-80S-M03530	CDS500-2S045	4.5
H.0304	CDM-80S-M04025		
H.0305	CDM-80S-M04030		
H.0400	CDM-90S-M02430	CDS500-2S030	3.0
H.0401	CDM-90S-M03520		
H.0402	CDM-90S-M04025	CDS500-2S045	4.5
H.0500	CDM-100S-M03230	CDS500-2S060	6.0
H.0501	CDM-100S-M06430	CDS500-2S100	10.0
H.0600	CDM-110S-M02030	CDS500-2S030	3.0
H.0601	CDM-110S-M04020	CDS500-2S045	4.5
H.0602	CDM-110S-M04030	CDS500-2S060	6.0
H.0603	CDM-110S-M05030		
H.0604	CDM-110S-M06020	CDS500-2S045	4.5
H.0605	CDM-110S-M06030	CDS500-2S060	6.0
H.0700	CDM-130S-M04025	CDS500-2S045	4.5
H.0701	CDM-130S-M05025	CDS500-2S060	6.0
H.0702	CDM-130S-M06025		
H.0703	CDM-130S-M07715		

Recommended Combination for 1/3-phase 220V Input of Drive			
Servo Motor		Servo Drive	
Motor S/N	Model	Model	Rated Current (A)
H.0704	CDM-130S-M07725	CDS500-2S100	10.0
H.0705	CDM-130S-M10010	CDS500-2S045	4.5
H.0706	CDM-130S-M10015	CDS500-2S060	6.0
H.0707	CDM-130S-M10025	CDS500-2S100	10.0
H.0708	CDM-130S-M15015		
H.0709	CDM-130S-M15025	CDS500-2T140	14.0
H.0800	CDM-150S-M15020	CDS500-2T140	14.0
H.0801	CDM-150S-M15025	CDS500-2T200	20.0
H.0802	CDM-150S-M18020		
H.0901	CDM-180S-M17015	CDS500-2S100	10.0
H.0902	CDM-180S-M19015	CDS500-2T140	14.0
H.0903	CDM-180S-M21520		
H.0905	CDM-180S-M27015	CDS500-2T200	20.0
H.0906	CDM-180S-M35010		
Recommended Combination for 3-phase 380V Input of Drive			
Servo Motor		Servo Drive	
Motor S/N	Model	Model	Rated Current (A)
H.0710	CDM-130T-M10010	CDS500-4T085	8.5
H.0711	CDM-130T-M10015		
H.0712	CDM-130T-M10025		
H.0713	CDM-130T-M15015		
H.0714	CDM-130T-M15025	CDS500-4T120	12.0
H.0715	CDM-130T-M07725	CDS500-4T085	8.5
H.0716	CDM-130T-M04025		
H.0717	CDM-130T-M05025		
H.0718	CDM-130T-M06025		
H.0910	CDM-180T-M17015	CDS500-4T085	8.5
H.0912	CDM-180T-M19015		
H.0913	CDM-180T-M21520	CDS500-4T120	12.0
H.0915	CDM-180T-M27015		
H.0916	CDM-180T-M35010		
H.0917	CDM-180T-M35015		
H.0918	CDM-180T-M48015	CDS500-4T200	20.0